
Electronic Report

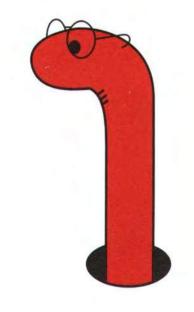

WORMS EYE

52 Bank Parade Burnley BB11 1TS Phone 01282 414649 / 458410 Our Ref: New Wellington Street/BB2 4PJ/2017 Date: 10 November 2017

Michael Harrison Lee Hough Chartered Engineer Blakewater House Phoenix Business Park Blakewater Road Blackburn PR2 2HY

Tel: 01254 260196 Email: michael.harrison@leehough.co.uk

HERON FOODS, NEW WELLINGTON STREET, BLACKBURN, BB2 4PJ PRELIMINARY RISK ASSESSMENT (DESK STUDY)

INTRODUCTION

A commercial development is proposed. The objective is to carry out a desk study, supplemented with a walk over survey, to form a Preliminary Risk Assessment to consider contamination, landfill gas and geotechnical issues.

SITE DESCRIPTION

The site is an approximately rectangular shape plot, about 60 by 50 metres located to the southwest of New Wellington Street in Blackburn and at OS Grid Reference 366978, 426315. The site was inspected by Mr S Gimeno (Geotechnician) on 31/10/17 and comprised an unused plot with a hard surface, mainly concrete. Along the north boundary there was a bund, where household fly tipping was seen. Along the west and north of the site boundary was rubble that appeared to be fly tipped.

Suspected asbestos cement fragments were seen among the rubble on the north of the site.

The west boundary is at the base of a retaining wall, this retaining about 4 metres high in the southwest corner and 0.5 metres in the northwest corner.

Just beneath the northeast corner of the site was a small sub-station. To the south of the site was a hard surfaced car/lorry park, with the canal at a higher level a further 60 metres to the southwest.

To the east of the site were local convenience stores, and 'G Plan and ICON Design' factory buildings.

The area slopes down to the northeast.

TREES

There are self-seeded sapling, but no significant trees on site.

This is not an accurate arboricultural survey.

PROPOSED DEVELOPMENT

It is proposed to build a food store about 20 x 30 metres towards the southwest of the site. To the northwest will be an associated carpark and small landscaped areas. The east of the site will be a new road, providing access to the adjacent site to the south.

LEGAL/COPYRIGHT

Material may be included in this report from Ordnance Survey (Licence No. AL100031635), Landmark, Environment Agency, Coal Authority and others. It may be copyright and the usual restrictions apply. This report can only be relied upon if the invoice has been paid promptly and in full. This report may be signed by an individual, but only on behalf of Worms Eye Limited.

NOT INCLUDED IN THE REPORT

- Arboricultural Survey.
- Asbestos Survey
- Invasive Plant Survey (Japanese Knotweed etc).
- Mining Risk Assessment.
- River/Tidal Flood Risk Assessment.
- Surface Water Flooding.
- Underground Services Survey.

General comments may be made with regards to the above where there are obvious features seen on site, in the data review or where they are applicable to the environmental and geotechnical risk assessment. These general comments do not constitute a detailed risk assessment.

DATA SOURCES

The following data sources have been viewed in compiling this report.

- BGS, Geology Map, 1:50000 scale, Solid and Drift Edition
- BGS, on-shore boreholes scans
- Environment Agency, What's In Your Backyard
- Groundwater
- Landfill Sites
- Pollution
- Landmark Envirocheck Report, 25/10/2017
- Ordnance Survey, Historical Maps, 1:10000 and 1:2500 scale
- Walkover Survey, 31/10/2017

ENVIRONMENTAL DATA

A Landmark Envirocheck report has been obtained for the site and geological maps have been reviewed, the following is a summary of the combined data. The Envirocheck report indicated none of the following within 250 metres:

- Contaminated land register entries
- Substantiated pollution incidents
- Water abstraction points
- Source protection zones
- Radioactive sites
- Areas of flooding from rivers
- Landfill or other waste sites
- Hazardous substances sites
- Fuel stations
- Sensitive land uses

Geology of Site

A geological fault (with the down throw to the southwest) is shown to run southeast – northwest, beyond or possibly at the southwest corner of the site.

The geological map indicates that the underlying solid rocks are mudstone on the site (to the northeast of the fault) and sandstone of the Great Arc Sandstone horizon to the southwest of the fault, both in the Pennine Lower Coal Measures, dipping to the northwest.

Surface drift is shown as glacial till (boulder clay) of unknown thickness.

Natural subsidence hazards are shown as very low to no hazard.

Surface Water (Hydrology)

The Leeds and Liverpool canal is 61 metres southwest (above the site), and the River Darwen is 540 metres northeast.

The only discharge consents within 250 metres is:

• 30 metres southeast, trade discharges, cooling water to freshwater stream/river in 1994, authorisation revoked in 2006 *.

There are three pollution incident to surface water within 250 metres:

- Minor incident, unknown pollutant to unknown receiver in 1991, 34 metres southeast *.
- Minor incident, other incident/unknown to unknown receiver in 1995, 45 metres northwest *.
- Minor incident, other cause to unknown receiver in 1999, 213 metres east *.

The area slopes down to the northeast and the flow of surface water is expected to be in this direction.

*Not relevant due to distance/severity/significance/age

Flooding - General

Information is obtained from the EA flood maps and suggests areas where rivers would flood. There are two zones:

- 'normal' flooding, based on a 1 in 100 chance of it happening in any year (1:200 if flooding is from the sea). This is normally closer to the river.
- 'extreme' flooding, further away from the river and having a 1 in 1000 chance.

Flooding can occur for many reasons other than those dealt with by the EA maps. These include:

- burst pipes
- blocked drains, sewers and culverts
- inadequate drainage
- cloudbursts/flash flooding overwhelming normally satisfactory drainage systems

Statements in this report such as 'clear of flooding are references to the EA river and sea flood maps and are no guarantee that flooding will not occur.

Groundwater Flooding

The site is shown to be in an area with a potential for groundwater flooding to occur at the surface.

Flooding from Rivers

The site is shown to be clear of flooding from rivers.

Surface Water Flooding

The middle of the site is shown to be at risk of 1 in 30 years surface water flooding, with a wider area at risk of 1 in 100 years flooding, and the whole site at risk of 1 in 1000 years flooding.

Groundwater (Hydrogeology)

The solid rocks under the site are indicated as a Secondary A aquifer.

Superficial (drift) deposits are classed as a Secondary Undifferentiated aquifer with a low permeability (clay).

Groundwater flow is likely to follow the topography and move to the northeast.

Filled Ground

Within 250 metres of the site there are the following suspected filled features.

- On southwest of site.
- 18 metres west.
- 79 metres southwest.
- 110 metres north.
- 155 metres northeast.
- 180 metres northeast
- 215 metres south.
- 250 metres south.

<u>Radon</u>

The site is in a lower probability radon area as less than 1% of homes in the area are above the radon action level.

Radon protection measures are not required.

Mining

The Coal Authority Interactive Mapping shows:

- Development High Risk Area lies just to the southwest (beyond the fault), probably beyond to the southwest corner of the site.
- Coal seams outcrop northeast southwest about 50 metres south and 30 metres northwest, dipping northwest.
- No nearby mine entries

A Coal Authority mining report has been obtained and a copy is enclosed with this report. The salient points are as follows:

- No record of past, or future underground coal mining.
- No likely shallow workings.
- No mine entries within 20 metres of the property
- No opencast workings.
- A fault is present beneath or close to the site.
- No recorded coal outcrops.
- No recorded shallow workings.

Coal Seams

The situation is complicated by the geological fault.

Northeast of the fault the Coal Authority and geology map suggest there are no shallow coal seams and no coal seams outcropping close to the site.

Southwest of the fault, the Lower Mountain Mine Coal Seam is shown to outcrop about 125 metres southeast of the site and dip to the northwest.

An approximate dip of the site has been calculated at about 8°, based on outcrops distance (interval and vertical) between seams and topography.

This suggests that if the seam passes beneath the site, this would be about 17m below rockhead.

Nearby Industry

There are 14 Trade Directory Entries within 250 metres:

- On site, sheet metal works, inactive
- 13 metres south, office furniture and equipment, inactive
- 104 metres east, dry cleaners, active (shop) *.
- 115 metres west, garage services, inactive *.
- 116 metres east, road haulage services, active *.
- 117 metres northeast, oven cleaning, inactive *.
- 149 metres east, garage services, inactive *.
- 149 metres southeast furniture manufacturers, Home and Office, inactive *.
- 149 metres southeast, upholstery manufacturers, inactive *.
- 196 metres north, reclaiming waste products, active *.
- 210 metres north, coating specialist, inactive *.
- 212 metres north laundries and launderettes, inactive *.
- 212 metres north, dry cleaners, inactive *.
- 230 metres north, car dealers, used, inactive *.
- * not relevant due to distance/severity/significance

SITE HISTORY

Date	On Site	Off Site
Circa 1800 (no map)		Canal built
1848 – 1849 1:10,560	Undeveloped field. Stream runs southeast – northwest across the site.	Poor mapping.
1894 1:2,500	Chapel on west of site Stream not present, valley filled and now probably enters a culvert, 40 metres southeast. Two semi-detached housed at the northeast corner, with gardens to the south.	Excavation 30m southeast. Housing to north, east and west. Coal yard 10 metres south. Reservoir 105 metres north and 200 metres south. Bridge Mills 115 metres southeast. Moorgate Mill (cotton) 125 metres southeast. Clay pit about 100 to 185 metres northeast.
1911 1:2,500	Building on northeast corner	Excavation filled and Pioneer Mill (cotton) built 25 metres southeast.
1931 1:2,500	Little or no change.	Tennis ground immediately south. Football ground 105 metres south. Coal yard no longer present. Pioneer Mill extended.
1956 1:2,500	Little or no change.	Reservoir to north filled. Football ground not present.
1966 1:10,000	New building, possibly industrial on southeast side.	Pioneer Mill to southeast, extend to northwest.
1972 – 1976	Chapel and houses demolished. Sub-station by northeast corner.	Terrace houses to southeast demolished and Pioneer Mill extended northeast.
1977 – 1988 1:1,250	Building on northeast of site demolished.	Reservoir to south now a marsh.
1993 1:1,250	Little or no change.	Bridge Mill demolished.
2017 1:10,000	Hard overgrown surface.	Area as existing.

DISCUSSION

Contamination

The site was previously occupied by a church (west), houses (northeast) and engineering works (southeast/east). A filled stream valley, running southeast to northwest, is also suspected.

Whilst the church and houses are not expected to be a source of contaminants it is likely that made ground (especially demolition rubble) will be present in those areas, especially if they had basements, and in the suspected filled valley.

Whilst made ground and/or demolition rubble is expected across the site, and can contain raised levels of contaminants, the levels are not expected to exceed commercial thresholds.

The former engineering works on the east/southeast is a possible source of higher levels of contaminants which may exceed commercial thresholds.

Although there have been several industrial sites in the surrounding area the closest to the site were a coal yard and cotton mill. These would not be different to or at higher levels than those expected to generate contaminants which may have been generated on-site.

The proposed development will be a food store, with carpark and small landscaping areas. Potential pollutant linkages are considered to be:

- Direct contact with soil.
- Ingestion of soil.
- Inhalation and ingestion of dust.
- Sulphate attack on buried concrete.
- Inhalation of vapours.
- Contaminants entering drinking water pipes.

Although contaminants are expected at raised levels, there are not expected to exceed commercial thresholds over a wide area. Some hot-spots may occur and only a low risk to end-users is anticipated.

Controlled Waters

There is an underlying Secondary A aquifer beneath low permeability clay.

The River Darwen is 540 metres northeast.

Although the canal is 61 metres southwest, this is above the level of the site and therefore not a receptor.

The small landscaped areas will allow very limited opportunity for rainwater to pass through the surface soils and leach out contaminants that may migrate to the underlying aquifer.

However, the underlying clay will impede the migration of water and only a low risk is expected to groundwater.

Landfill Gas/Ground Gas

There are no landfill sites within 250 metres.

There are several filled features within 250 metres of the site and likely made ground on-site. These are potential sources of ground gases, which could migrate to and present a risk to the development. Taking into account their size and age of filling only a low gas generation potential s thought likely.

Bearing in mind the size of the filled areas, distance from the site, and underlying geology, it is considered that there is likely to be a low risk to the development.

<u>Radon</u>

Radon protection measures are not required.

<u>Ground and Surface Water Flooding</u> The site is shown to be at risk of surface water flooding.

The site is shown to be in an area with potential for groundwater flooding to occur at the surface.

The old stream ran under the site and there may be a culvert present.

Foundations

It is expected that made ground will be present, with underlying clay. This can provide variable conditions for foundations and a range of options may need to be considered, including reinforced concrete raft to a piled foundation.

If foundations are to be on clay the shrinkage potential of the clay needs to be determined, to ensure foundations are below the potential effects of tree root shrinkage.

Coal Mining

The high risk area is thought to be clear of the site. If it does imping, assuming the Lower Mountain Mine coal seam passes beneath the site, the findings suggest a depth of 17 metres below bedrock.

To achieve a minimal thickness of rock cover over a worked coal seam, 10 times the seam thickness is widely accepted.

The seam is reported as being up to 0.6m. This would allow about 17m of rock over a 0.6m thick seam, about 28 times the seam thickness. This is sufficient to minimise risks to the development if mine workings were present and these were to collapse.

Furthermore no mine entries are shown within 300 metres, and none within 500 metres southwest of the fault

INDUSTRY PROFILE

The site was formerly occupied by a church, houses and engineers, made ground is also expected.

Industry	Possible Contaminants
Potential Contaminants	Metals: e.g. copper, zinc, chromium, nickel, lead, cadmium, arsenic, Inorganic compounds: cyanide, sulphates Phenols VOCs Mineral oils, fuel oils (TPHs) Acids Asbestos PCBs General hydrocarbons (PAHs)

CONCEPTUAL MODEL

A conceptual model based on the source-pathway-receptor concept is included with this desk study to show the potential pollutant linkages with this site.

Source	Receptors	Pathway	Potential/Likely Pollutant Linkage
Asbestos	Construction workers	Inhalation	Yes
Aspesios	End-users	Inhalation	Yes
	Construction workers	Short-term direct contact, inhalation of dust, ingestion	Yes
Inorganic	End-users	Direct contact, ingestion, inhalation of dust	Yes
contaminants	Groundwater	Leaching towards	No
	River/stream	Leaching towards	No
Sulphate	Building fabric	Concrete directly in contact with soil	Yes
	Construction workers	Short-term direct contact, inhalation of dust, ingestion	Yes
	End-users	Direct contact, ingestion, inhalation of dust	Yes
Hydrocarbons	Service pipes	Seeping into drinking water pipes	Yes
	Groundwater	Migrating towards	Unlikely
	River/stream	Migrating/leaching towards	No
Hydrocarbon	Construction workers	Short-term inhalation	Unlikely
vapours	End-users	Inhalation of vapours indoors and outdoors	Unlikely
Landfill gas	End-users - in buildings	Seeping into buildings, explosion, asphyxiation	Yes
Radon	End-users - in buildings	Seeping into buildings	No

CONCLUSION

Contamination

Taking into account the past use of the site it is thought likely that contamination will be present on the site. These are not expected to exceed commercial thresholds over much of the site, although levels may exceed thresholds on the east/southeast.

An intrusive investigation is required, consisting of boreholes/trial holes and tests to confirm the presence/absence and possible extent of contamination on the site.

Possible point sources for contamination are the former engineering works at the east/southeast.

The investigation will need to target this, proposed landscaping (most sensitive part of the development), proposed buildings and provide all round coverage.

Controlled Waters

A low risk to controlled water is expected and no further action is considered necessary at this stage. This may need to be reviewed following the soil tests.

Landfill Gas/Ground Gas

There are several nearby areas of filled ground and probable made ground on site.

A gas testing programme is required.

Radon

Radon protection measures are not required.

Coal Mining

A geological fault means the site is probably clear of any high risk zones. If the fault creeps onto the southwest corner, here the shallow seams are sufficiently deep not to pose a significant risk, and no further action is required.

Flooding

The EA maps indicate that the area is clear of flooding from rivers and no further action is required.

The maps suggest that the site could be subject to surface water flooding. These maps are fairly crude and it is beyond the scope of this report to provide a comprehensive flood risk assessment.

There may be a culvert present.

Foundations

A series of boreholes are required in the area of the proposed building to allow the most suitable foundations to be designed.

Plasticity tests are required to confirm the shrinkage potential of the clay.

Yours faithfully on behalf of Worms Eye Ltd

David Lun

David Lord BSc (Hons) FGS, MIEnvSc, AIEMA

HERON FOODS, NEW WELLINGTON STREET, BLACKBURN, BB2 4PJ

LIST OF APPENDICES – PRELIMINARY RISK ASSESSMENT (Desk Study)

Existing Site Plan

Photographs of site

Proposed Site Plan

Plan Showing Old Stream Route and Old Chapel

Landmark Summary Map

Landmark Envirocheck Report

Coal Mining Report


Landmark Data Maps

Historical Maps

Conceptual Model

ABBREVIATIONS

<u>Chemical</u>	BAP	Benzo(a)pyrene
	BTEX	Benzene, toluene, ethylbenzene, xylene
	DAHA	Dibenzo(ah)anthracene
	MTBE	Methyl tertiaryt-butyl ether (additive to petrol)
	EPH	Extractable Petroleum Hydrocarbons (formerly Diesel Range Organics – DRO)
	NFD	No fibres detected (asbestos test)
	PAH	Polycyclic aromatic hydrocarbons
	PCB	Polychlorinated biphenyls
	PID	Photo ionisation detector
	PRO/GRO	Petrol range organics/gasoline range organics
	SVOC	Semi-volatile organic compounds
	TCE	Trichloroethylene
	TPH	Total petroleum hydrocarbons
	VOC	Volatile organic compounds
<u>Other</u>	AGS	Association of Geotechnical Specialists
<u></u>	BGS	British Geological Survey
	BRE	Building Research Establishment
	CBR	California Bearing Ratio
	CIEH	Chartered Institute of Environmental Health
	CIRIA	Construction Industry Research and Information Association
	CLEA	Contaminated Land Exposure Assessment (Environment Agency)
	CLR 8	Contaminated Land Research Report 8 (Environment Agency)
	DWQ	Drinking water quality
	EA	Environment Agency
	EQS	Environmental quality standards
	ICRCL	Inter-departmental Commission for the Reclamation of Contaminated Land
	LQM	Land Quality Management Ltd (Land and Environmental Consultancy)
	NHBC	National House Builders Council
	SGV	Soil Guideline Values
	SPT	Standard penetration test
	TPHWG	TPH Working Group

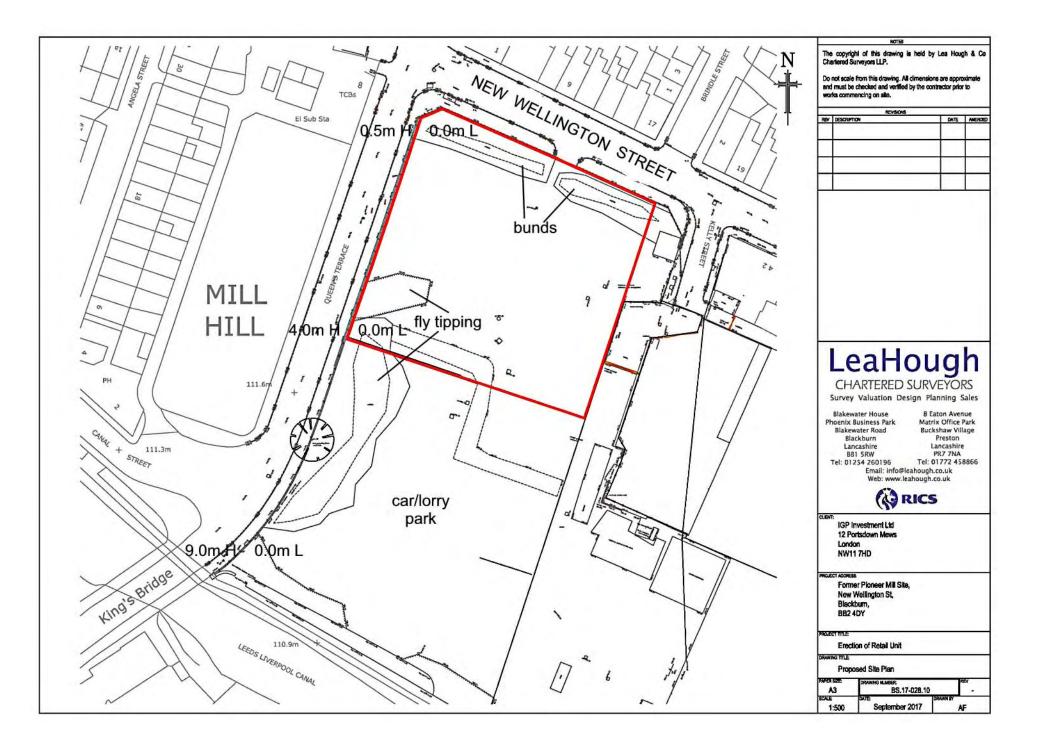

Heron Foods, New Wellington Street, Blackburn, Lancashire, BB2 4PJ




View looking southeast


Heron Foods, New Wellington Street, Blackburn, Lancashire, BB2 4PJ



View looking northeast from Queens Terrace

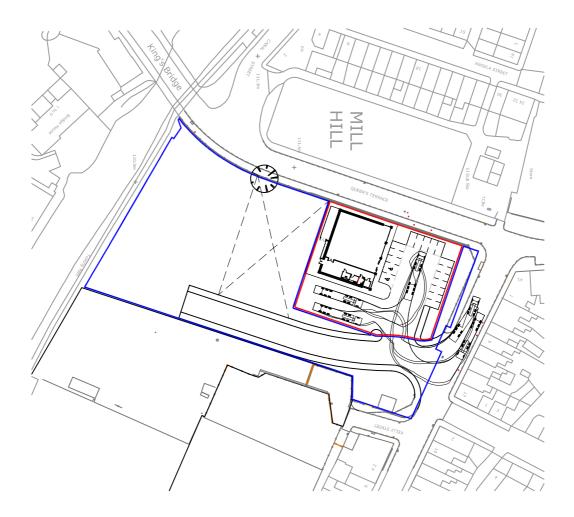



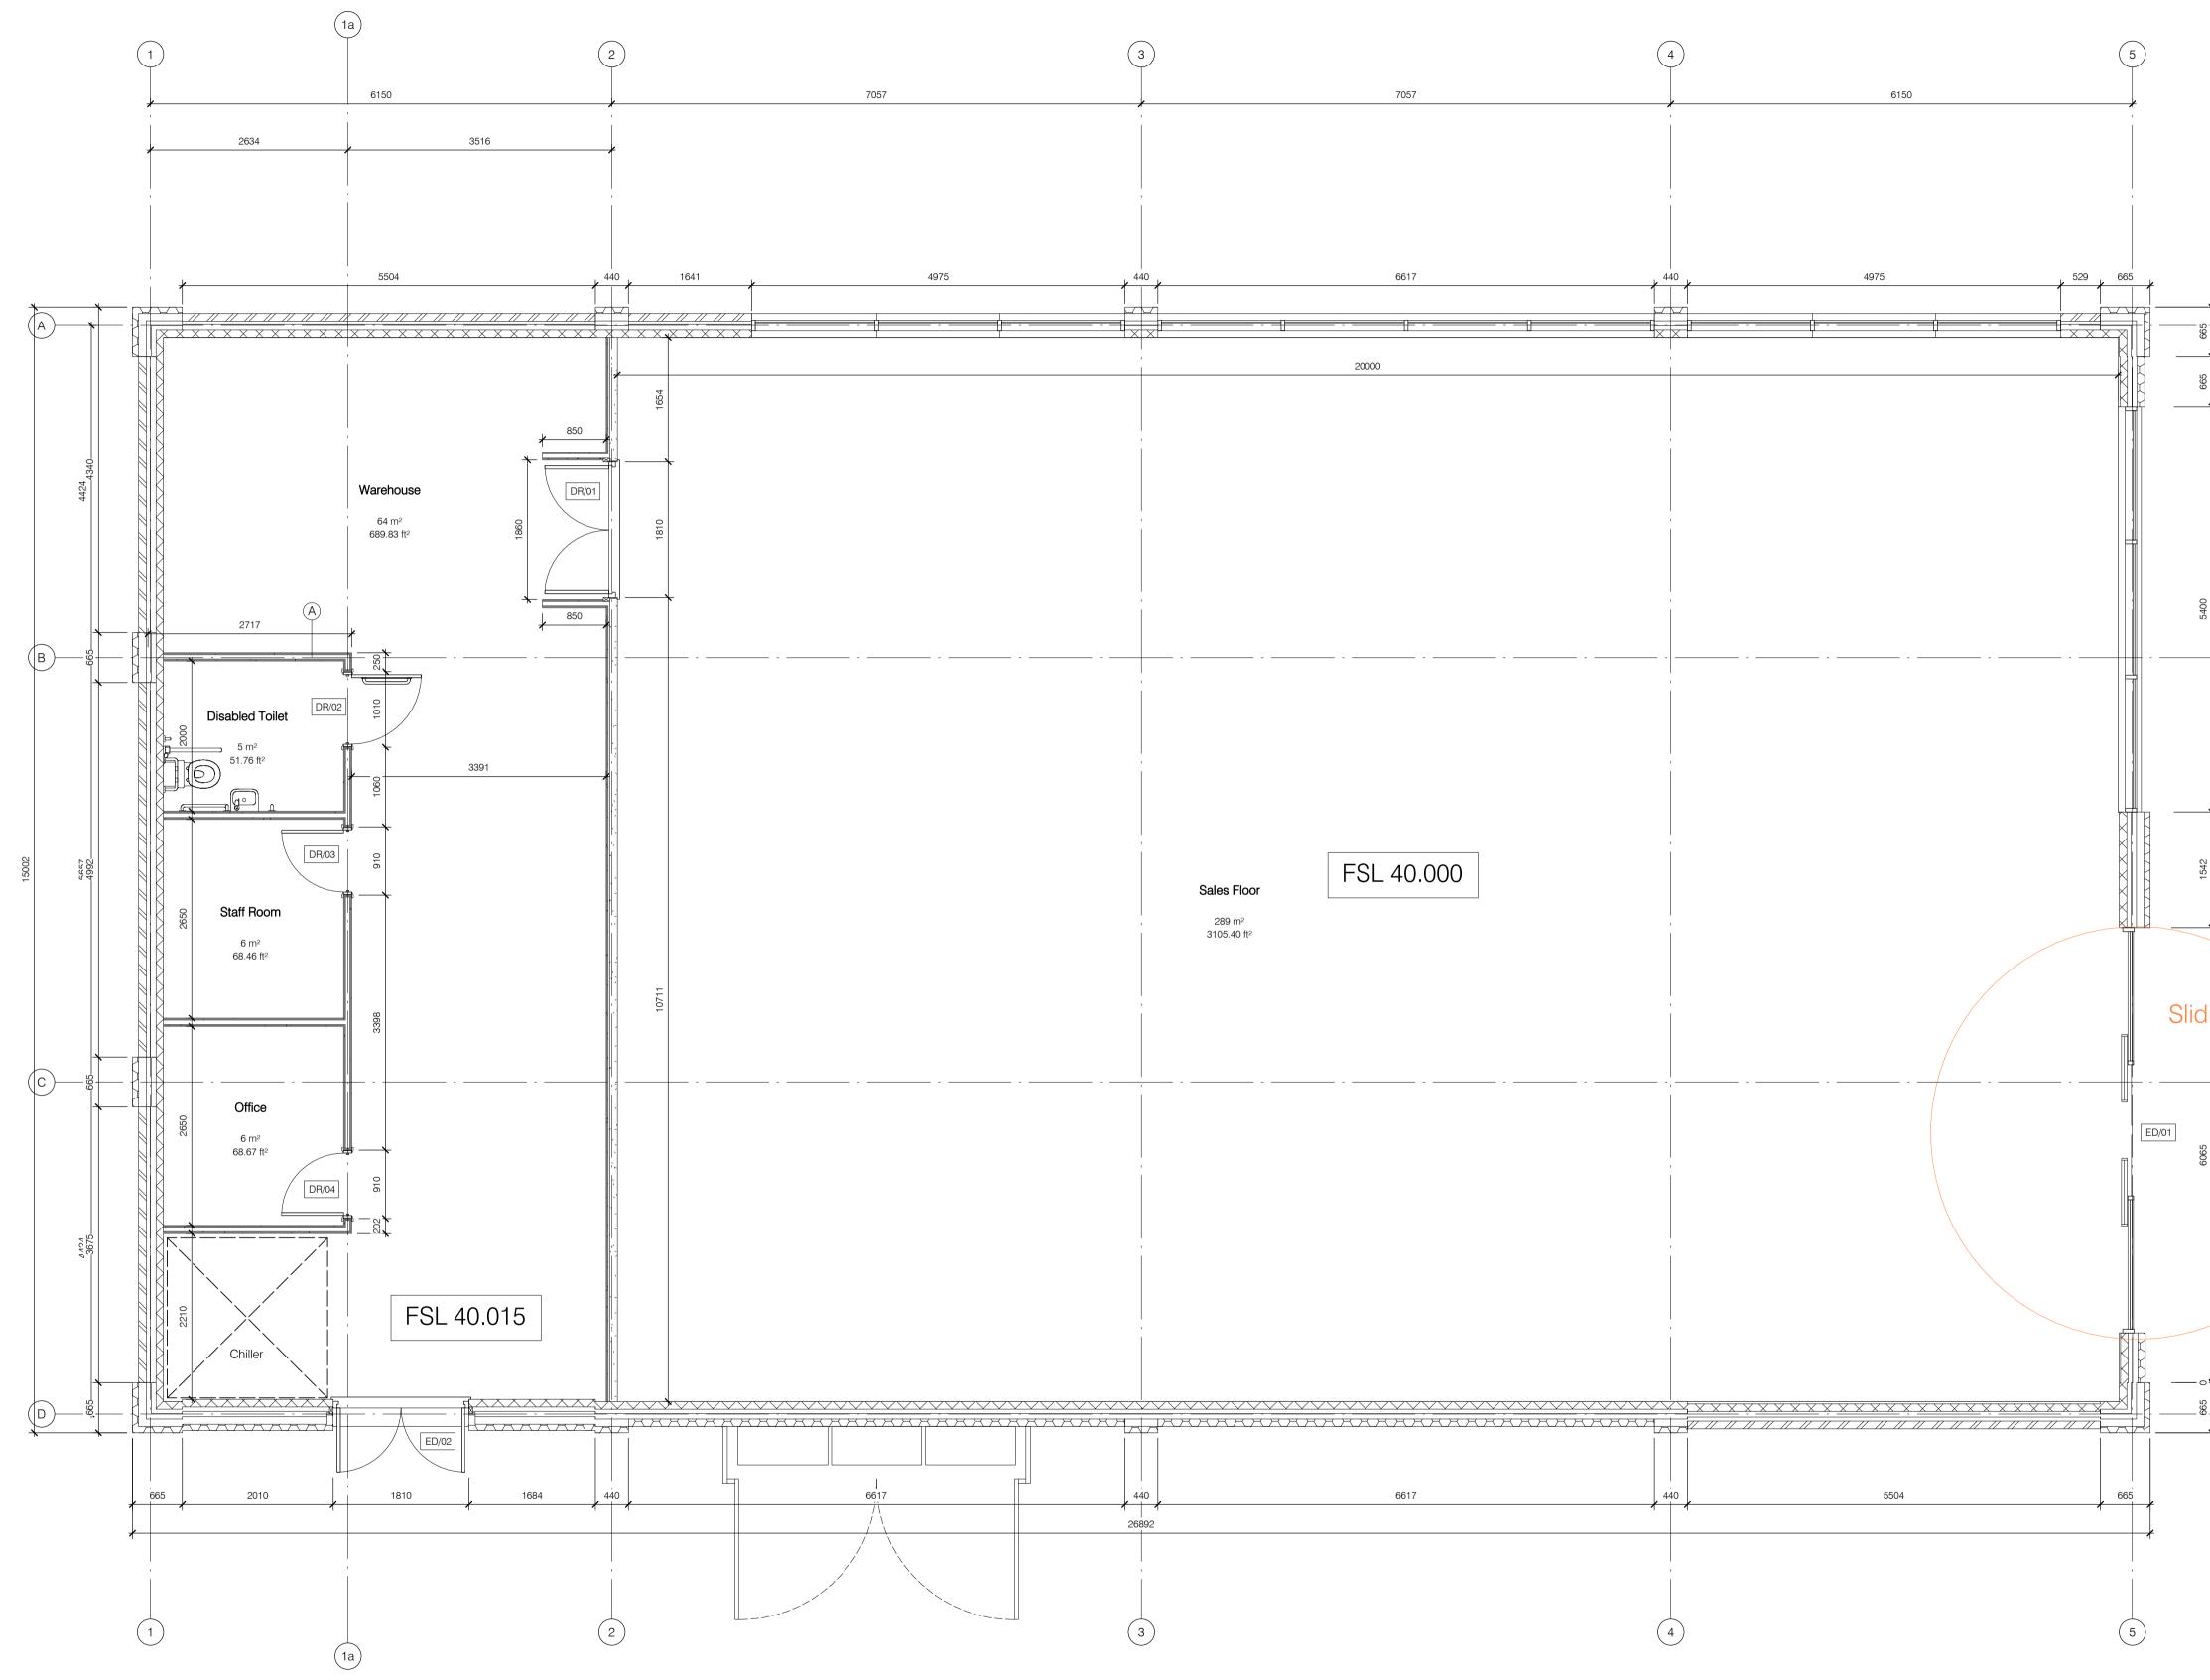

Proposed Ground Floor 1:50





By (Chk	2
Ŗ	3	BRADFORD
S25 5DL	J	
		MANCH

Б
č
ΪΪ
ğ
õ
Ē
Т

Sliding door: Subcontractor Design

(c)

-(D)

Rev Date Description

PRELIMINARY

LEEDS	
The Coach House,Monk Fryston Hall,Monk Fryston,LS25 5D Tel: 01977 681001 www.darntonb3.com	U
CLENT	

CLIENT		
Heron Foods		


PROJECT Proposed Foodstore Development

DRAWING Proposed GA Plan

SCALE @A1 1 : 50 CHECKED CREATION DATE DRAWN 08/05/16 AY Checker DARTONB3 DRAWING NO. REVISION 11113 - DB3 - XX - GF - DR - A - 20-01 PROJECT NO. COMPANY ZONE LEVEL TYPE ROLE NUMBER © COPYRIGHT: ALL RIGHTS RESERVED. THIS DRAWING IS TO BE READ IN CONJUNCTION WITH ALL OTHER RELEVANT DRAWINGS PREPARED BY CONSULTANTS AND SUB-CONTRACTORS. DO NOT SCALE FROM THIS DRAWING. WORK ONLY TO THE PRINTED DIMENSIONS. THIS DRAWING MUST NOT BE USED FOR CONSTRUCTION UNLESS ISSUED FOR CONSTRUCTION.

REPORT ANY DISCREPANCIES TO THE ARCHITECT OR REPRESENTATIVES THEREOF. DARITONEGS LTD WORK TO A MANAGEMENT SYSTEM WHICH IS APPROVED TO ISO-9001 BY LRQA - CERTIFICATE NUMBER LRQA-0947162' PLOT DATE: 12/08/2016 16:35:53 Model Ref: FILL OUT UNDER PROJECT PROPERTIES



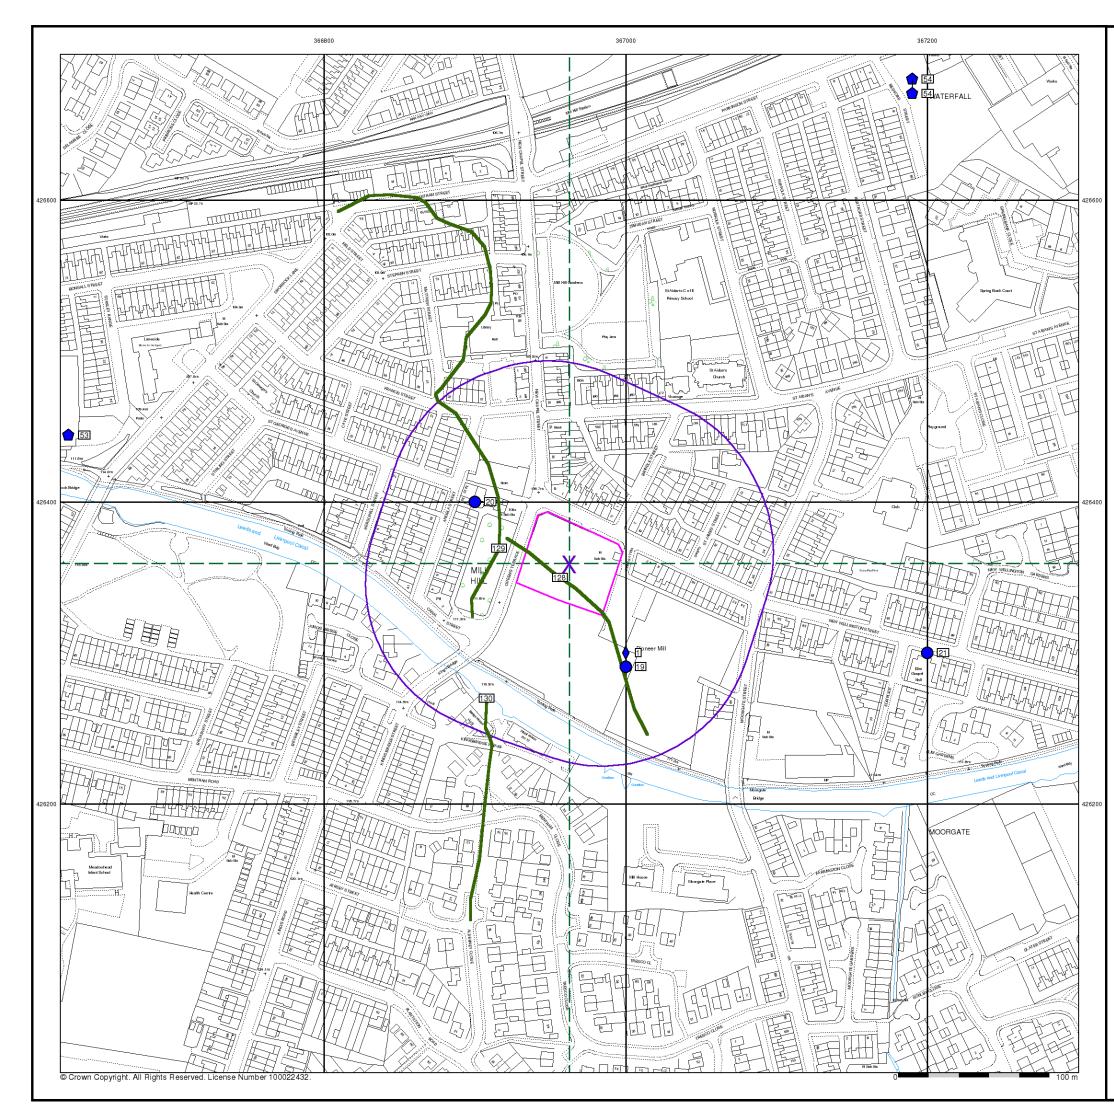




Geological

BGS Recorded Mineral Site

Site Sensitivity Map - Segment A13

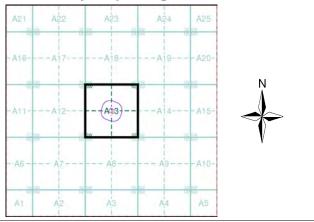

Order Details

0.00.00	
Order Number:	144159325_1_1
Customer Ref:	BB2 4PJ
National Grid Reference:	366960, 426360
Slice:	A
Site Area (Ha):	0.31
Plot Buffer (m):	100

Site Details

Former Pioneer Mill, New Wellington Street, Blackburn, BB2 4DY



Tel: Fax: Web: 0844 844 9952 0844 844 9951 www.envirocheck.co.uk

Page 1 of 1



Envirocheck® Report:

Datasheet

Order Details:

Order Number: 144159325_1_1

Customer Reference: BB2 4PJ

National Grid Reference: 366960, 426360

Slice:

A Site Area (Ha): 0.31

Search Buffer (m): 1000

Site Details:

Former Pioneer Mill New Wellington Street Blackburn BB2 4DY

Client Details:

Mr D Lord Worms Eye Ltd 52 Bank Parade Burnley Lancashire BB11 1TS



LANDMARK INFORMATION GROUP

Contents

Report Section	Page Number
Summary	-
Agency & Hydrological	1
Waste	38
Hazardous Substances	-
Geological	45
Industrial Land Use	52
Sensitive Land Use	76
Data Currency	77
Data Suppliers	83
Useful Contacts	84

Introduction

The Environment Act 1995 has made site sensitivity a key issue, as the legislation pays as much attention to the pathways by which contamination could spread, and to the vulnerable targets of contamination, as it does the potential sources of contamination. For this reason, Landmark's Site Sensitivity maps and Datasheet(s) place great emphasis on statutory data provided by the Environment Agency/Natural Resources Wales and the Scottish Environment Protection Agency; it also incorporates data from Natural England (and the Scottish and Welsh equivalents) and Local Authorities; and highlights hydrogeological features required by environmental and geotechnical consultants. It does not include any information concerning past uses of land. The datasheet is produced by querying the Landmark database to a distance defined by the client from a site boundary provided by the client.

In the attached datasheet the National Grid References (NGRs) are rounded to the nearest 10m in accordance with Landmark's agreements with a number of Data Suppliers.

Copyright Notice

© Landmark Information Group Limited 2017. The Copyright on the information and data and its format as contained in this Envirocheck® Report ("Report") is the property of Landmark Information Group Limited ("Landmark") and several other Data Providers, including (but not limited to) Ordnance Survey, British Geological Survey, the Environment Agency/Natural Resources Wales and Natural England, and must not be reproduced in whole or in part by photocopying or any other method. The Report is supplied under Landmark's Terms and Conditions accepted by the Customer.

A copy of Landmark's Terms and Conditions can be found with the Index Map for this report. Additional copies of the Report may be obtained from Landmark, subject to Landmark's charges in force from time to time. The Copyright, design rights and any other intellectual rights shall remain the exclusive property of Landmark and /or other Data providers, whose Copyright material has been included in this Report.

Natural England Copyright Notice

Site of Special Scientific Interest, National Nature Reserve, Ramsar, Special Protection Area, Special Conservation Area, Marine Nature Reserve data (derived from Ordnance Survey 1:10000 raster) is provided by, and used with the permission of, Natural England who retain the copyright and Intellectual Property Rights for the data.

Ove Arup Copyright Notice

The Data provided in this report was obtained on Licence from Ove Arup & Partners Limited (for further information, contact mining review@arup.com). No reproduction or further use of such Data is to be made without the prior written consent of Ove Arup & Partners Limited. The information and data supplied in the product are derived from publicly available records and other third party sources and neither Ove Arup & Partners nor Landmark warrant the accuracy or completeness of such information or data.

Peter Brett Associates Copyright Notice

The cavity data presented has been extracted from the PBA enhanced version of the original DEFRA national cavity databases. PBA/DEFRA retain the copyright & intellectual property rights in the data. Whilst all reasonable efforts are made to check that the information contained in the cavity databases is accurate we do not warrant that the data is complete or error free. The information is based upon our own researches and those collated from a number of external sources and is continually being augmented and updated by PBA. In no event shall PBA/DEFRA or Landmark be liable for any loss or damage including, without limitation, indirect or consequential loss or damage arising from the use of this data.

Radon Potential dataset Copyright Notice

Information supplied from a joint dataset compiled by The British Geological Survey and Public Health England.

Report Version v53.0

LANDMARK INFORMATION GROUP*

Data Type	Page Number	On Site	0 to 250m	251 to 500m	501 to 1000m (*up to 2000m)
Agency & Hydrological					
BGS Groundwater Flooding Susceptibility	pg 1	Yes	Yes	Yes	n/a
Contaminated Land Register Entries and Notices					
Discharge Consents	pg 2		1		41
Prosecutions Relating to Controlled Waters			n/a	n/a	n/a
Enforcement and Prohibition Notices					
Integrated Pollution Controls					
Integrated Pollution Prevention And Control					
Local Authority Integrated Pollution Prevention And Control					
Local Authority Pollution Prevention and Controls	pg 13			3	9
Local Authority Pollution Prevention and Control Enforcements					
Nearest Surface Water Feature	pg 14		Yes		
Pollution Incidents to Controlled Waters	pg 14		3	5	36
Prosecutions Relating to Authorised Processes					
Registered Radioactive Substances	pg 22				9
River Quality	pg 23		1	1	1
River Quality Biology Sampling Points					
River Quality Chemistry Sampling Points	pg 24				2
Substantiated Pollution Incident Register	pg 25			2	3
Water Abstractions	pg 26			1	16 (*7)
Water Industry Act Referrals					
Groundwater Vulnerability	pg 32	Yes	n/a	n/a	n/a
Drift Deposits	pg 32	1	n/a	n/a	n/a
Bedrock Aquifer Designations	pg 32	Yes	n/a	n/a	n/a
Superficial Aquifer Designations	pg 32	Yes	n/a	n/a	n/a
Source Protection Zones					
Extreme Flooding from Rivers or Sea without Defences				n/a	n/a
Flooding from Rivers or Sea without Defences				n/a	n/a
Areas Benefiting from Flood Defences				n/a	n/a
Flood Water Storage Areas				n/a	n/a
Flood Defences				n/a	n/a
OS Water Network Lines	pg 32		4	5	32

LANDMARK INFORMATION GROUP*

Data Type	Page Number	On Site	0 to 250m	251 to 500m	501 to 1000m (*up to 2000m)
Waste					
BGS Recorded Landfill Sites					
Historical Landfill Sites	pg 38				1
Integrated Pollution Control Registered Waste Sites					
Licensed Waste Management Facilities (Landfill Boundaries)					
Licensed Waste Management Facilities (Locations)	pg 38			2	2
Local Authority Landfill Coverage	pg 39	1	n/a	n/a	n/a
Local Authority Recorded Landfill Sites	pg 39			1	
Potentially Infilled Land (Non-Water)	pg 39		1	6	14
Potentially Infilled Land (Water)	pg 40	1	6	17	39
Registered Landfill Sites					
Registered Waste Transfer Sites	pg 43				1
Registered Waste Treatment or Disposal Sites	pg 44			1	
Hazardous Substances					
Control of Major Accident Hazards Sites (COMAH)					
Explosive Sites					
Notification of Installations Handling Hazardous Substances (NIHHS)					
Planning Hazardous Substance Consents					
Planning Hazardous Substance Enforcements					

LANDMARK INFORMATION GROUP*

Data Type	Page Number	On Site	0 to 250m	251 to 500m	501 to 1000m (*up to 2000m)
Geological					
BGS 1:625,000 Solid Geology	pg 45	Yes	n/a	n/a	n/a
BGS Estimated Soil Chemistry	pg 45	Yes	Yes	Yes	Yes
BGS Recorded Mineral Sites	pg 50			1	2
BGS Urban Soil Chemistry					
BGS Urban Soil Chemistry Averages					
CBSCB Compensation District			n/a	n/a	n/a
Coal Mining Affected Areas	pg 51	Yes	n/a	n/a	n/a
Mining Instability	pg 51	Yes	n/a	n/a	n/a
Man-Made Mining Cavities					
Natural Cavities					
Non Coal Mining Areas of Great Britain				n/a	n/a
Potential for Collapsible Ground Stability Hazards	pg 51	Yes		n/a	n/a
Potential for Compressible Ground Stability Hazards				n/a	n/a
Potential for Ground Dissolution Stability Hazards				n/a	n/a
Potential for Landslide Ground Stability Hazards	pg 51	Yes		n/a	n/a
Potential for Running Sand Ground Stability Hazards	pg 51	Yes		n/a	n/a
Potential for Shrinking or Swelling Clay Ground Stability Hazards	pg 51	Yes		n/a	n/a
Radon Potential - Radon Affected Areas			n/a	n/a	n/a
Radon Potential - Radon Protection Measures			n/a	n/a	n/a
Industrial Land Use					
Contemporary Trade Directory Entries	pg 52	1	13	42	84
Fuel Station Entries	pg 63				5
Points of Interest - Commercial Services	pg 64		3	8	32
Points of Interest - Education and Health	pg 67				1
Points of Interest - Manufacturing and Production	pg 68		3	29	26
Points of Interest - Public Infrastructure	pg 72			3	8
Points of Interest - Recreational and Environmental	pg 73		4	3	11
Gas Pipelines					
Underground Electrical Cables					

LANDMARK INFORMATION GROUP*

Data Type	Page Number	On Site	0 to 250m	251 to 500m	501 to 1000m (*up to 2000m)
Sensitive Land Use					
Ancient Woodland					
Areas of Adopted Green Belt	pg 76				1
Areas of Unadopted Green Belt					
Areas of Outstanding Natural Beauty					
Environmentally Sensitive Areas					
Forest Parks					
Local Nature Reserves	pg 76				1
Marine Nature Reserves					
National Nature Reserves					
National Parks					
Nitrate Sensitive Areas					
Nitrate Vulnerable Zones					
Ramsar Sites					
Sites of Special Scientific Interest					
Special Areas of Conservation					
Special Protection Areas					
World Heritage Sites					

LANDMARK INFORMATION GROUP*

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding to Occur at Surface	A13SW (SW)	0	1	366950 426350
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding to Occur at Surface	A13SE (N)	0	1	366963 426359
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding to Occur at Surface	A13SW (SW)	55	1	366900 426300
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding to Occur at Surface	A13NW (N)	157	1	366950 426550
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding to Occur at Surface	A13SE (E)	213	1	367200 426300
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding of Property Situated Below Ground Level	A13SW	265	1	366750
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding of Property Situated Below Ground Level	(SW) A13SW	278	1	426150 366800
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding of Property Situated Below Ground Level	(SW) A13SW	304	1	426100 366750
	BGS Groundwater Flooding Susceptibility Flooding Type: Limited Potential for Groundwater Flooding to Occur	(SW) A13SW	346	1	426100 366750
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding of Property Situated Below Ground Level	(SW) A8NW	352	1	426050 366850
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding to Occur at Surface	(S) A13NW	359	1	426000 366650
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding of Property Situated Below Ground Level	(NW) A8NW	369	1	426600 366800
	BGS Groundwater Flooding Susceptibility Flooding Type: Limited Potential for Groundwater Flooding to Occur	(SW) A13SW	372	1	426000 366650
	BGS Groundwater Flooding Susceptibility Flooding Type: Limited Potential for Groundwater Flooding to Occur	(SW) A13SW	374	1	426100 366700
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding to Occur at Surface	(SW) A14NW	398	1	426050 367350
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding of Property Situated Below Ground Level	(NE) A8NW	399	1	426550 366850
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding of Property Situated Below Ground Level	(S) A12SE	405	1	425950 366550
	BGS Groundwater Flooding Susceptibility Flooding Type: Limited Potential for Groundwater Flooding to Occur	(W) A13SW	407	1	426200 366650
	BGS Groundwater Flooding Susceptibility Flooding Type: Limited Potential for Groundwater Flooding to Occur	(SW) A12SE	410	1	426050 366600
	BGS Groundwater Flooding Susceptibility Flooding Type: Limited Potential for Groundwater Flooding to Occur	(SW) A8NW	416	1	426100 366800
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding of Property Situated Below Ground Level	(S) A12SE	426	1	425950 366550
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding of Property Situated Below Ground Level	(SW) A8NW (S)	427	1	426150 366950 425900

LANDMARK INFORMATION GROUP*

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	BGS Groundwater Flooding Susceptibility				
	Flooding Type: Potential for Groundwater Flooding to Occur at Surface	A18SE (NE)	430	1	367200 426750
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding to Occur at Surface	A12SE	431	1	366500
		(W)			426300
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding of Property Situated Below Ground Le	vel A8NW (S)	434	1	366900 425900
	BGS Groundwater Flooding Susceptibility				
	Flooding Type: Limited Potential for Groundwater Flooding to Occur	A8NW (SW)	435	1	366750 425950
	BGS Groundwater Flooding Susceptibility				
	Flooding Type: Potential for Groundwater Flooding of Property Situated Below Ground Le	vel A8NW (S)	446	1	366850 425900
	BGS Groundwater Flooding Susceptibility				
	Flooding Type: Potential for Groundwater Flooding of Property Situated Below Ground Le	vel A14SW (E)	453	1	367450 426359
	BGS Groundwater Flooding Susceptibility				
	Flooding Type: Potential for Groundwater Flooding to Occur at Surface	A14NW (E)	454	1	367450 426400
	BGS Groundwater Flooding Susceptibility				
	Flooding Type: Potential for Groundwater Flooding of Property Situated Below Ground Le	vel A8NE (S)	476	1	367000 425850
	BGS Groundwater Flooding Susceptibility				
	Flooding Type: Potential for Groundwater Flooding of Property Situated Below Ground Le	vel A8NE (S)	476	1	366963 425850
	BGS Groundwater Flooding Susceptibility				
	Flooding Type: Limited Potential for Groundwater Flooding to Occur	A8NW (S)	477	1	366950 425850
	BGS Groundwater Flooding Susceptibility	(0)			420000
	Flooding Type: Limited Potential for Groundwater Flooding to Occur	A12SE (SW)	494	1	366500 426100
	Discharge Consents	(011)			120100
1	Operator: Netlon Ltd Property Type: REAL ESTATE ACTIVITIES/BUYING/SELLING/RENTING Location: Netlon Ltd, New Wellington Street, Blackburn, Lancashire Authority: Environment Agency, North West Region Catchment Area: Not Given Reference: 017190505 Permit Version: 1 Effective Date: 21st September 1994 Issued Date: 21st September 1994 Revocation Date: 18th April 2006 Discharge Trade Discharges - Cooling Water Discharge Freshwater Stream/River	A13SE (SE)	30	2	367000 426300
	Receiving Water: Unnamed Trib Of R. Darwen Status: Authorisation revokedRevoked Positional Accuracy: Located by supplier to within 100m				
-	Discharge Consents			_	
2	Operator: United Utilities Water Limited Property Type: WWTW (NOT WATER CO) (NOT STP AT A PRIVATE PREMISES) Location: Queen Victoria St, Blackburn, Lancashire Authority: Environment Agency, North West Region Catchment Area: Not Given Reference: 01bbn0046 Permit Version: 1 Effective Date: 17th September 1992 Issued Date: Not Supplied Revocation Date: 1st January 1995 Discharge Unknown	A18SW (N)	528	2	366840 426910
	Environment: Environment: Receiving Water: Unknown Outlet; Licence Status: Revoked Status: Authorisation revokedRevoked Positional Accuracy: Located by supplier to within 100m				

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
3	Discharge Consent: Operator: Property Type: Location: Authority: Catchment Area: Reference: Permit Version: Effective Date: Issued Date: Revocation Date: Discharge Type: Discharge Environment: Receiving Water: Status: Positional Accuracy:	s Voith Fabrics Blackburn Ltd MAKING OF TEXTILES River Mill Office, Preston Old Road, Blackburn, Lancashire Environment Agency, North West Region Not Supplied 017190110 1 14th June 1984 Not Supplied 29th September 1986 Trade Discharges - Cooling Water Freshwater Stream/River River Darwen Authorisation revokedRevoked Located by supplier to within 10m	A17SE (NW)	567	2	366530 426780
3	Discharge Consents Operator: Property Type: Location: Authority: Catchment Area: Reference: Permit Version: Effective Date: Issued Date: Revocation Date: Discharge Type: Discharge Environment: Receiving Water: Status: Positional Accuracy:	s Voith Fabrics Blackburn Ltd MAKING OF TEXTILES River Mill Office, Preston Old Road, Blackburn, Lancashire Environment Agency, North West Region Not Supplied 017190110 2 30th September 1986 Not Supplied 14th December 1985 Trade Discharges - Cooling Water Freshwater Stream/River River Darwen Authorisation revokedRevoked Located by supplier to within 10m	A17SE (NW)	567	2	366530 426780
3	Discharge Consent: Operator: Property Type: Location: Authority: Catchment Area: Reference: Permit Version: Effective Date: Issued Date: Revocation Date: Discharge Type: Discharge Environment: Receiving Water: Status: Positional Accuracy:	s Voith Fabrics Blackburn Ltd MAKING OF TEXTILES River Mill Office, Preston Old Road, Blackburn, Lancashire Environment Agency, North West Region Not Supplied 017190110 3 15th December 1995 Not Supplied 30th May 1996 Trade Discharges - Cooling Water Freshwater Stream/River River Darwen Authorisation revokedRevoked Located by supplier to within 10m	A17SE (NW)	567	2	366530 426780
3	Discharge Consent: Operator: Property Type: Location: Authority: Catchment Area: Reference: Permit Version: Effective Date: Issued Date: Revocation Date: Discharge Type: Discharge Environment: Receiving Water: Status: Positional Accuracy:	s Voith Fabrics Blackburn Ltd MAKING OF TEXTILES River Mill Office, Preston Old Road, Blackburn, Lancashire Environment Agency, North West Region Not Supplied 017190110 4 31st May 1996 Not Supplied 26th November 1998 Trade Discharges - Cooling Water Freshwater Stream/River River Darwen Authorisation revokedRevoked Located by supplier to within 10m	A17SE (NW)	567	2	366530 426780

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
3	Discharge Consent Operator: Property Type: Location: Authority: Catchment Area: Reference: Permit Version: Effective Date: Issued Date: Revocation Date: Discharge Type: Discharge Environment: Receiving Water: Status: Positional Accuracy:	s Voith Fabrics Blackburn Ltd MAKING OF TEXTILES River Mill Office, Preston Old Road, Blackburn, Lancashire Environment Agency, North West Region Not Given 017190110 5 27th November 1998 Not Supplied 11th February 2010 Trade Discharges - Cooling Water Freshwater Stream/River River Darwen Revoked (Water Resources Act 1991, Section 88 & Schedule 10 as amended by Environment Act 1995) Located by supplier to within 100m	A17SE (NW)	567	2	366530 426780
3	-	Voith Fabrics Blackburn Ltd MAKING OF TEXTILES Stretcher 3 Boiler House River Mill, Off Preston Old Road,, Blackburn, Lancashire Environment Agency, North West Region Not Supplied 017190111 1 14th March 1984 Not Supplied 14th December 1995 Trade Discharges - Cooling Water Freshwater Stream/River River Darwen Authorisation revokedRevoked Located by supplier to within 10m	A17SE (NW)	589	2	366500 426780
3	Discharge Consent Operator: Property Type: Location: Authority: Catchment Area: Reference: Permit Version: Effective Date: Issued Date: Revocation Date: Discharge Type: Discharge Environment: Receiving Water: Status: Positional Accuracy:	s Voith Fabrics Blackburn Ltd MAKING OF TEXTILES Stretcher 3 Boiler House River Mill, Off Preston Old Road,, Blackburn, Lancashire Environment Agency, North West Region Not Supplied 017190111 2 15th December 1995 Not Supplied 30th May 1996 Trade Discharges - Cooling Water Freshwater Stream/River River Darwen Authorisation revokedRevoked Located by supplier to within 10m	A17SE (NW)	589	2	366500 426780
3	Discharge Consent Operator: Property Type: Location: Authority: Catchment Area: Reference: Permit Version: Effective Date: Issued Date: Revocation Date: Discharge Type: Discharge Environment: Receiving Water: Status: Positional Accuracy:	s Voith Fabrics Blackburn Ltd MAKING OF TEXTILES Stretcher 3 Boiler House River Mill, Off Preston Old Road,, Blackburn, Lancashire Environment Agency, North West Region Not Supplied 017190111 3 31st May 1996 Not Supplied 26th November 1998 Trade Discharges - Cooling Water Freshwater Stream/River River Darwen Authorisation revokedRevoked Located by supplier to within 10m	A17SE (NW)	589	2	366500 426780

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	Discharge Consents	S				
3	Operator: Property Type: Location: Authority: Catchment Area: Reference: Permit Version: Effective Date: Issued Date: Revocation Date: Discharge Type: Discharge Environment: Receiving Water: Status:	Voith Fabrics Blackburn Ltd MAKING OF TEXTILES Stretcher 3 Boiler House River Mill, Off Preston Old Road,, Blackburn, Lancashire Environment Agency, North West Region Not Given 017190111 4 27th November 1998 Not Supplied 11th February 2010 Trade Discharges - Cooling Water Freshwater Stream/River River Darwen Revoked (Water Resources Act 1991, Section 88 & Schedule 10 as amended by Environment Act 1995)	A17SE (NW)	589	2	366500 426780
	Positional Accuracy:	Located by supplier to within 100m				
4	Discharge Consents Operator: Property Type: Location: Authority: Catchment Area: Reference: Permit Version: Effective Date: Issued Date: Revocation Date: Discharge Type: Discharge Type: Discharge Type: Discharge Type: Status: Positional Accuracy:	s United Utilities Water Limited WWTW/SEWAGE TREATMENT WORKS (WATER COMPANY) Bolton Road Interceptor Sewer, Blackburn Dc, Lancashire Environment Agency, North West Region Not Given 01la1437 1 30th December 1965 Not Supplied 25th March 2010 Public Sewage: Storm Sewage Overflow Freshwater Stream/River River Darwen Revoked: New Consent issued (Water Act 1989, Section 113) Located by supplier to within 100m	A14NW (E)	625	2	367620 426420
	Discharge Consents	S				
4	-	United Utilities Water Limited STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Bolton Road Interceptor Sewer Bolton Road, Adjacent Aqueduct Bridge, ., Blackburn Environment Agency, North West Region Darwen Npswqd010749 3 12th August 2011 12th August 2011 Not Supplied Public Sewage: Storm Sewage Overflow Freshwater Stream/River River Darwen Varied under EPR 2010 Located by supplier to within 10m	A14NW (E)	630	2	367626 426405
	Discharge Consents	S				
4	Operator: Property Type: Location: Authority: Catchment Area: Reference: Permit Version: Effective Date: Issued Date: Revocation Date: Discharge Type: Discharge Environment: Receiving Water: Status: Positional Accuracy:	United Utilities Water Plc (?) STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Bolton Road Interceptor Sewer Bolton Road, Adjacent Aqueduct Bridge, ., Blackburn Environment Agency, North West Region Darwen Npswqd010749 1 26th March 2010 26th March 2010 26th March 2010 30th September 2010 Public Sewage: Storm Sewage Overflow Freshwater Stream/River River Darwen Modified (Water Resources Act 1991, Schedule 10 as amended by Environment Act 1995) Located by supplier to within 10m	A14NW (E)	630	2	367626 426405

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	Discharge Consents	S				
4	Operator: Property Type: Location:	United Utilities Water Plc (?) STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Bolton Road Interceptor Sewer Bolton Road, Adjacent Aqueduct Bridge, ., Blackburn	A14NW (E)	630	2	367626 426405
	Authority: Catchment Area: Reference: Permit Version:	Environment Agency, North West Region Darwen Npswqd010749 2				
	Effective Date: Issued Date: Revocation Date: Discharge Type:	1st October 2010 26th March 2010 11th August 2011 Public Sewage: Storm Sewage Overflow				
	Discharge Environment: Receiving Water: Status:	Freshwater Stream/River River Darwen Modified (Water Resources Act 1991, Schedule 10 as amended by				
		Environment Act 1995) Located by supplier to within 10m				
	Discharge Consents				<u> </u>	
5	Operator: Property Type: Location: Authority: Catchment Area:	United Utilities Water Limited STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Bolton Road, Blackburn Dc, Lancashire Environment Agency, North West Region Darwen	A14SE (E)	693	2	367690 426340
	Reference: Permit Version: Effective Date:	01bbn0023 2 26th March 2010				
	Issued Date: Revocation Date: Discharge Type:	26th March 2010 30th September 2011 Public Sewage: Storm Sewage Overflow				
	Discharge Environment: Receiving Water:	Freshwater Stream/River				
	Status:	New Consent (Water Resources Act 1991, Section 88 & Schedule 10 as amended by Environment Act 1995) Located by supplier to within 10m				
	-					
5	Discharge Consents Operator: Property Type: Location: Authority: Catchment Area:	s United Utilities Water Limited STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Bolton Road, Blackburn Dc, Lancashire Environment Agency, North West Region Darwen	A14SE (E)	693	2	367690 426340
	Reference: Permit Version:	01bbn0023 3				
	Effective Date: Issued Date: Revocation Date:	1st October 2011 26th March 2010 Not Supplied				
	Discharge Type: Discharge Environment:	Public Sewage: Storm Sewage Overflow Freshwater Stream/River				
	Receiving Water: Status:	River Darwen Modified (Water Resources Act 1991, Schedule 10 as amended by Environment Act 1995)				
	-	Located by supplier to within 10m				
_	Discharge Consents			700	6	007717
5	Operator: Property Type: Location: Authority: Catchment Area: Reference: Permit Version:	United Utilities Water Limited STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Bolton Road, Blackburn Dc, Lancashire Environment Agency, North West Region Darwen 01BBN0023 1	A14NE (E)	720	2	367717 426364
	Effective Date: Issued Date: Revocation Date:	1st January 1995 Not Supplied 25th March 2010				
	Discharge Type: Discharge Environment:	Public Sewage: Storm Sewage Overflow Freshwater Stream/River				
	Receiving Water: Status:	River Darwen Post National Rivers Authority Legislation where issue date > 31/08/1989 Located by supplier to within 10m				

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
6	Discharge Consents Operator: Property Type: Location: Authority: Catchment Area: Reference: Permit Version: Effective Date: Issued Date: Revocation Date: Discharge Type: Discharge Environment: Receiving Water: Status: Positional Accuracy:	s United Utilities Water Limited STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Wellington Road Cso Wellington Road, Blackburn, Lancashire, ., Bb2 2nq Environment Agency, North West Region Darwen 01bbn0024 2 3rd September 2010 3rd September 2010 4th February 2016 Public Sewage: Storm Sewage Overflow Freshwater Stream/River River Darwen Varied under EPR 2010 Located by supplier to within 10m	A18NE (NE)	731	2	367290 427040
6	Discharge Consent: Operator: Property Type: Location: Authority: Catchment Area: Reference: Permit Version: Effective Date: Issued Date: Revocation Date: Discharge Type: Discharge Environment: Receiving Water: Status: Positional Accuracy:	s United Utilities Water Limited STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Wellington Road Cso Wellington Road, Blackburn, Lancashire, ., Bb2 2nq Environment Agency, North West Region Darwen 01BBN0024 1 1st January 1995 Not Supplied 2nd September 2010 Public Sewage: Storm Sewage Overflow Freshwater Stream/River River Darwen Varied under EPR 2010 Located by supplier to within 100m	A18NE (NE)	731	2	367290 427040
6	-	United Utilities Water Limited STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Wellington Road Cso Wellington Road, Blackburn, Lancashire, ., Bb2 2nq Environment Agency, North West Region Darwen 01bbn0024 3 5th February 2016 5th February 2016 5th February 2016 Not Supplied Public Sewage: Storm Sewage Overflow Freshwater Stream/River River Darwen Varied under EPR 2010 Located by supplier to within 10m	A18NE (NE)	735	2	367297 427042
7	Discharge Consents Operator: Property Type: Location: Authority: Catchment Area: Reference: Permit Version: Effective Date: Issued Date: Revocation Date: Discharge Type: Discharge Environment: Receiving Water: Status: Positional Accuracy:	s Voith Fabrics Blackburn Ltd MAKING OF TEXTILES Plant Room 2, D9 Bay Scapa Scandia Off, Preston Old Road, Blackburn, Lancashire Environment Agency, North West Region Not Supplied 017190271 1 25th July 1988 Not Supplied 15th April 1992 Trade Discharges - Cooling Water Freshwater Stream/River River Darwen Authorisation revokedRevoked Located by supplier to within 10m	A17SE (NW)	816	2	366330 426930

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	Discharge Consent	S				
7	Operator: Property Type: Location: Authority: Catchment Area:	Voith Fabrics Blackburn Ltd MAKING OF TEXTILES Plant Room 2, D9 Bay Scapa Scandia Off, Preston Old Road, Blackburn, Lancashire Environment Agency, North West Region Not Supplied	A17SE (NW)	816	2	366330 426930
	Reference: Permit Version: Effective Date: Issued Date: Revocation Date: Discharge Type: Discharge Environment:	017190271 2 16th April 1992 Not Supplied 30th May 1996 Trade Discharges - Cooling Water Freshwater Stream/River				
	Receiving Water: Status: Positional Accuracy:	River Darwen Authorisation revokedRevoked Located by supplier to within 10m				
	Discharge Consent	s				
7	Operator: Property Type: Location: Authority: Catchment Area: Reference:	Voith Fabrics Blackburn Ltd MAKING OF TEXTILES Plant Room 2, D9 Bay Scapa Scandia Off, Preston Old Road, Blackburn, Lancashire Environment Agency, North West Region Not Supplied 017190271	A17SE (NW)	816	2	366330 426930
	Permit Version: Effective Date: Issued Date: Revocation Date: Discharge Type: Discharge Environment:	3 31st May 1996 Not Supplied 26th November 1998 Trade Discharges - Cooling Water Freshwater Stream/River				
	Receiving Water: Status:	River Darwen Authorisation revokedRevoked Located by supplier to within 10m				
	Discharge Consent	S				
7	Operator: Property Type: Location:	Voith Fabrics Blackburn Ltd MAKING OF TEXTILES Plant Room 2, D9 Bay Scapa Scandia Off, Preston Old Road, Blackburn, Lancashire	A17SE (NW)	816	2	366330 426930
	Authority: Catchment Area: Reference: Permit Version:	Environment Agency, North West Region Not Given 017190271 4 27th November 1998				
	Effective Date: Issued Date: Revocation Date: Discharge Type: Discharge Environment:	Not Supplied 11th February 2010 Trade Discharges - Cooling Water Freshwater Stream/River				
	Receiving Water: Status: Positional Accuracy:	River Darwen Revoked (Water Resources Act 1991, Section 88 & Schedule 10 as amended by Environment Act 1995) Located by supplier to within 100m				
	Discharge Consent	S				
8	Operator: Property Type: Location:	Voith Fabrics Blackburn Ltd MAKING OF TEXTILES Plant Room 1, D9 Bay Scapa Scandia, Off Preston Old Road, Blackburn, Lancashire	A17SW (NW)	867	2	366280 426950
	Authority: Catchment Area: Reference: Permit Version: Effective Date: Issued Date:	Environment Agency, North West Region Not Supplied 017190114 1 7th February 1979 Not Supplied				
	Revocation Date: Discharge Type: Discharge Environment: Receiving Water:	14th December 1995 Trade Discharges - Cooling Water Freshwater Stream/River River Darwen				
	Status:	Authorisation revokedRevoked Located by supplier to within 10m				

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	Discharge Consent	S				
8	Operator: Property Type: Location:	Voith Fabrics Blackburn Ltd MAKING OF TEXTILES Plant Room 1, D9 Bay Scapa Scandia, Off Preston Old Road, Blackburn, Lancashire	A17SW (NW)	867	2	366280 426950
	Authority: Catchment Area: Reference: Permit Version: Effective Date:	Environment Agency, North West Region Not Supplied 017190114 2 15th December 1995				
	Issued Date: Revocation Date: Discharge Type: Discharge	Not Supplied 30th May 1996 Trade Discharges - Cooling Water Freshwater Stream/River				
	Environment: Receiving Water: Status: Positional Accuracy:	River Darwen Authorisation revokedRevoked Located by supplier to within 10m				
	Discharge Consent	S				
8	Operator: Property Type: Location: Authority: Catchment Area: Reference:	Voith Fabrics Blackburn Ltd MAKING OF TEXTILES Plant Room 1, D9 Bay Scapa Scandia, Off Preston Old Road, Blackburn, Lancashire Environment Agency, North West Region Not Supplied 017190114	A17SW (NW)	867	2	366280 426950
	Permit Version: Effective Date: Issued Date: Revocation Date: Discharge Type: Discharge	3 31st May 1996 Not Supplied 26th November 1998 Trade Discharges - Cooling Water Freshwater Stream/River				
	Environment: Receiving Water: Status: Positional Accuracy:	River Darwen Authorisation revokedRevoked Located by supplier to within 10m				
	Discharge Consent	S				
8	Operator: Property Type: Location:	Voith Fabrics Blackburn Ltd MAKING OF TEXTILES Plant Room 1, D9 Bay Scapa Scandia, Off Preston Old Road, Blackburn, Lancashire	A17SW (NW)	867	2	366280 426950
	Authority: Catchment Area: Reference: Permit Version:	Environment Agency, North West Region Not Given 017190114 4 27th November 1998				
	Effective Date: Issued Date: Revocation Date: Discharge Type: Discharge	Not Supplied 11th February 2010 Trade Discharges - Cooling Water Freshwater Stream/River				
	Environment: Receiving Water: Status:	River Darwen Revoked (Water Resources Act 1991, Section 88 & Schedule 10 as amended by Environment Act 1995)				
	Positional Accuracy:	Located by supplier to within 100m				
	Discharge Consent	s				
8	Operator: Property Type: Location:	United Utilities Water Limited STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Preston Old Road Cso Preston Old Road, Fenniscliffe, Blackburn, Lancashire, Bb2 2tr	A17SW (NW)	910	2	366240 426970
	Authority: Catchment Area: Reference: Permit Version:	Environment Agency, North West Region Darwen 01bbn0045 3 5th Enhung: 2016				
	Effective Date: Issued Date: Revocation Date: Discharge Type: Discharge	5th February 2016 5th February 2016 Not Supplied Public Sewage: Storm Sewage Overflow Freshwater Stream/River				
	Environment: Receiving Water: Status: Positional Accuracy:	River Darwen Varied under EPR 2010 Located by supplier to within 10m				

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	Discharge Consents	S				
8	Operator: Property Type: Location:	United Utilities Water Limited STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Preston Old Road Cso Preston Old Road, Fenniscliffe, Blackburn, Lancashire, Bb2 2tr	A17SW (NW)	910	2	366240 426970
	Authority: Catchment Area: Reference: Permit Version: Effective Date: Issued Date:	Environment Agency, North West Region Darwen 01bbn0045 2 3rd September 2010 3rd September 2010				
	Revocation Date: Discharge Type: Discharge Environment: Receiving Water:	4th February 2016 Public Sewage: Storm Sewage Overflow Freshwater Stream/River River Darwen				
	Status: Positional Accuracy:	Varied under EPR 2010 Located by supplier to within 10m				
	Discharge Consents	S				
8	Operator: Property Type: Location:	United Utilities Water Limited STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Preston Old Road Cso Preston Old Road, Fenniscliffe, Blackburn, Lancashire, Bb2 2tr	A17SW (NW)	910	2	366240 426970
	Authority: Catchment Area: Reference: Permit Version: Effective Date:	Environment Agency, North West Region Darwen 01BBN0045 1 1st January 1995				
	Issued Date: Revocation Date: Discharge Type: Discharge	Not Supplied 2nd September 2010 Public Sewage: Storm Sewage Overflow Freshwater Stream/River				
	Environment: Receiving Water: Status: Positional Accuracy:	River Darwen Varied under EPR 2010 Located by supplier to within 10m				
	Discharge Consents	S				
9	Operator: Property Type: Location: Authority: Catchment Area: Reference: Permit Version:	United Utilities Water Limited STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Infirmary Rd, Blackburn Dc, Lancashire Environment Agency, North West Region Darwen 01bbn0028 2	A19SE (NE)	907	2	367800 426790
	Effective Date: Issued Date: Revocation Date: Discharge Type: Discharge Environment:	26th March 2010 26th March 2010 1st May 2011 Public Sewage: Storm Sewage Overflow Canal				
	Receiving Water: Status:	Leeds/Liverpool Canal Modified (Water Resources Act 1991, Schedule 10 as amended by Environment Act 1995)				
	Positional Accuracy:	Located by supplier to within 10m				
	Discharge Consents	s				
9	Operator: Property Type: Location: Authority: Catchment Area: Reference: Permit Version:	United Utilities Water Limited STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Infirmary Rd, Blackburn Dc, Lancashire Environment Agency, North West Region Darwen 01BBN0028	A19SE (NE)	907	2	367800 426790
	Effective Date: Issued Date: Revocation Date: Discharge Type: Discharge Environment:	1st January 1995 Not Supplied 25th March 2010 Public Sewage: Storm Sewage Overflow Canal				
	Receiving Water: Status: Positional Accuracy:	Leeds/Liverpool Canal Post National Rivers Authority Legislation where issue date > 31/08/1989 Located by supplier to within 100m				

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
10	Discharge Consents Operator: Property Type: Location: Authority: Catchment Area: Reference: Permit Version: Effective Date: Issued Date: Revocation Date: Discharge Type: Discharge Environment: Receiving Water: Status: Positional Accuracy:	s United Utilities Water Limited STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Markham St, Blackburn Dc, Lancashire Environment Agency, North West Region Darwen 01BBN0043 1 1st January 1995 Not Supplied 2nd September 2010 Public Sewage: Storm Sewage Overflow Freshwater Stream/River River Blakewater Varied under EPR 2010 Located by supplier to within 100m	A17SW (NW)	922	2	366245 426995
10	Discharge Consent: Operator: Property Type: Location: Authority: Catchment Area: Reference: Permit Version: Effective Date: Issued Date: Revocation Date: Discharge Type: Discharge Environment: Receiving Water: Status: Positional Accuracy:	s United Utilities Water Limited STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Markham St, Blackburn Dc, Lancashire Environment Agency, North West Region Darwen 01bbn0043 2 3rd September 2010 3rd September 2010 15th March 2017 Public Sewage: Storm Sewage Overflow Freshwater Stream/River River Blakewater Surrendered under EPR 2010 Located by supplier to within 10m	A17SW (NW)	930	2	366240 427000
10	Discharge Consent: Operator: Property Type: Location: Authority: Catchment Area: Reference: Permit Version: Effective Date: Issued Date: Revocation Date: Discharge Type: Discharge Environment: Receiving Water: Status: Positional Accuracy:	s United Utilities Water Limited STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Preston Old Road Cso Preston Old Road, Fenniscliffe, Blackburn, Lancashire, Bb2 2tr Environment Agency, North West Region Darwen 01bbn0044 2 14th April 2009 14th April 2009 25th March 2010 Public Sewage: Storm Sewage Overflow Freshwater Stream/River River Blakewater Post National Rivers Authority Legislation where issue date > 31/08/1989 Located by supplier to within 10m	A17SW (NW)	930	2	366240 427000
10	Discharge Consent: Operator: Property Type: Location: Authority: Catchment Area: Reference: Permit Version: Effective Date: Issued Date: Issued Date: Discharge Type: Discharge Environment: Receiving Water: Status: Positional Accuracy:	s North West Water Limited Not Given Markham Street , BLACKBURN Environment Agency, North West Region Not Given BBN0043 Not Supplied Not Supplied Not Supplied Not Supplied Sewage Effluent Discharge-Storm Effluent Unknown Not Supplied Not Supplied Located by supplier to within 100m	A17SW (NW)	930	2	366240 427000

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	Discharge Consents	S				
10	Operator: Property Type: Location: Authority:	United Utilities Water Limited STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Preston Old Road Cso Preston Old Road, Fenniscliffe, Blackburn, Lancashire, Bb2 2tr Environment Agency, North West Region	A17SW (NW)	930	2	366240 427000
	Catchment Area: Reference: Permit Version: Effective Date:	Darwen 01BBN0044 1 1st January 1995				
	Issued Date: Revocation Date: Discharge Type: Discharge	Not Supplied 13th April 2009 Public Sewage: Storm Sewage Overflow Freshwater Stream/River				
	Environment: Receiving Water: Status:	River Blakewater Post National Rivers Authority Legislation where issue date > 31/08/1989 Located by supplier to within 10m				
	Discharge Consents	S				
10	Operator: Property Type: Location: Authority:	United Utilities Water Limited STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Preston Old Road Cso Preston Old Road, Fenniscliffe, Blackburn, Lancashire, Bb2 2tr	A17SW (NW)	936	2	366242 427012
	Catchment Area: Reference: Permit Version: Effective Date:	Environment Agency, North West Region Darwen 01bbn0044 3 26th March 2010				
	Issued Date: Revocation Date: Discharge Type: Discharge Environment:	26th March 2010 31st January 2013 Public Sewage: Storm Sewage Overflow Freshwater Stream/River				
	Receiving Water: Status:	River Blakewater Modified (Water Resources Act 1991, Schedule 10 as amended by Environment Act 1995)				
	-	Located by supplier to within 10m				
10	Discharge Consents Operator: Property Type: Location:	United Utilities Water Limited STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Preston Old Road Cso Preston Old Road, Fenniscliffe, Blackburn, Lancashire,	A17SW (NW)	936	2	366242 427012
	Authority: Catchment Area: Reference:	Bb2 2tr Environment Agency, North West Region Darwen 01bbn0044				
	Permit Version: Effective Date: Issued Date: Revocation Date:	4 1st February 2013 26th March 2010 Not Supplied				
	Discharge Type: Discharge Environment:	Public Sewage: Storm Sewage Overflow Freshwater Stream/River River Blakewater				
	Receiving Water: Status: Positional Accuracy:	Modified (Water Resources Act 1991, Schedule 10 as amended by Environment Act 1995) Located by supplier to within 10m				
	Discharge Consents	5				
10	Operator: Property Type: Location: Authority: Catchment Area: Reference: Permit Version:	United Utilities Water Limited PUMPING STATION ON SEWERAGE NETWORK (WATER COMPANY) Witton Sso No 56, Blackburn, Lancashire Environment Agency, North West Region Not Given 01la0024 1	A17SW (NW)	936	2	366240 427010
	Effective Date: Issued Date: Revocation Date: Discharge Type: Discharge Environment:	11th April 1960 Not Supplied 11th April 1960 Storm /emergency overflow Freshwater Stream/River				
	Receiving Water: Status: Positional Accuracy:	River Blakewater Authorisation revokedRevoked Located by supplier to within 100m				

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	Local Authority Pol	Iution Prevention and Controls				
11	Name: Location: Authority: Permit Reference: Dated: Process Type: Description: Status: Positional Accuracy:	Promat Uk Ltd Victoria Works, Bonsall Street, BLACKBURN, Lancashire, BB2 4DD Blackburn with Darwen Borough Council, Environmental Health Department Bb10 1st October 1992 Local Authority Pollution Prevention and Control PG3/7 Exfloliation of vermiculite and expansion of perlite Permitted Automatically positioned to the address	A12NE (W)	334	3	366618 426476
	Local Authority Pol	lution Prevention and Controls				
11	Name: Location: Authority: Permit Reference: Dated: Process Type: Description: Status: Positional Accuracy:	Promat Uk Ltd Bonsall Street, Blackburn, Bb2 4dd Blackburn with Darwen Borough Council, Environmental Health Department BB116 1st September 2008 Local Authority Pollution Prevention and Control PG3/1Blending, packing, loading and use of bulk cement Permitted Located by supplier to within 10m	A12NE (W)	372	3	366580 426480
	Local Authority Pol	Iution Prevention and Controls				
12	Name: Location: Authority: Permit Reference: Dated: Process Type: Description: Status: Positional Accuracy:	Livesey Branch Service Station Livesey Branch Road, BLACKBURN, Lancashire, BB2 Blackburn with Darwen Borough Council, Environmental Health Department Bb100 Not Supplied Local Authority Air Pollution Control PG1/14 Petrol filling station Authorisation revokedRevoked Manually positioned to the address or location	A8NW (S)	499	3	366904 425833
	Local Authority Pol	Iution Prevention and Controls				
13	Name: Location: Authority: Permit Reference: Dated: Process Type: Description: Status: Positional Accuracy:	Thorsman & Co (Uk) Ltd Stancliffe Street, BLACKBURN, Lancashire, BB2 2QU Blackburn with Darwen Borough Council, Environmental Health Department BB48 Not Supplied Local Authority Air Pollution Control PG6/4 Processes for the manufacture of particleboard and fibreboard Authorisation revokedRevoked Automatically positioned to the address	A18SE (N)	598	3	367085 426976
	Local Authority Pol	Iution Prevention and Controls				
13	Name: Location: Authority: Permit Reference: Dated: Process Type: Description: Status: Positional Accuracy:	Thorsman and Co Ltd Stancliffe Street, BLACKBURN, BB3 Blackburn with Darwen Borough Council, Environmental Health Department BB85 Not Supplied Local Authority Air Pollution Control PG6/23 Coating of metal and plastic Authorised Automatically positioned to the address	A18SE (N)	603	3	367085 426981
	Local Authority Pol	Iution Prevention and Controls				
14	Name: Location: Authority: Permit Reference: Dated: Process Type: Description: Status:	Lock Mill Service Station Bolton Road, BLACKBURN, BB2 4HL Blackburn with Darwen Borough Council, Environmental Health Department BB73 31st December 1997 Local Authority Pollution Prevention and Control PG1/14 Petrol filling station Permitted Automatically positioned to the address	A14NE (E)	704	3	367694 426470
	Local Authority Pol	lution Prevention and Controls				
15	Name: Location: Authority: Permit Reference: Dated: Process Type: Description: Status: Positional Accuracy:	Abbots Car Repairs Hollin Bridge Street, BLACKBURN, Lancashire, BB2 4BA Blackburn with Darwen Borough Council, Environmental Health Department BB44 1st November 1993 Local Authority Pollution Prevention and Control PG6/34 Respraying of road vehicles Permitted Automatically positioned to the address	A14NE (E)	762	3	367718 426615

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	Local Authority Pol	Iution Prevention and Controls				
16	Name: Location: Authority: Permit Reference: Dated: Process Type: Description: Status: Positional Accuracy:	Scapa Scandia Ltd Cartmel Road, BLACKBURN, Lancashire, BB2 2SZ Blackburn with Darwen Borough Council, Environmental Health Department BB51 Not Supplied Local Authority Air Pollution Control PG6/8 Textile and fabric coating of finishing processes Authorisation revokedRevoked Automatically positioned to the address	A17NE (NW)	860	3	366418 427073
	Local Authority Pol	Iution Prevention and Controls				
17	Name: Location: Authority: Permit Reference: Dated: Process Type: Description: Status: Positional Accuracy:	Courtaulds Electrical (Blackburn) Ltd Lower Hollin Bank Street, BLACKBURN, Lancashire, BB2 4AD Blackburn with Darwen Borough Council, Environmental Health Department BB36 Not Supplied Local Authority Air Pollution Control PG6/32 Adhesive coating Authorisation revokedRevoked Manually positioned to the road within the address or location	A19SE (NE)	942	3	367745 426941
	Local Authority Pol	Iution Prevention and Controls				
17	Name: Location: Authority: Permit Reference: Dated: Process Type: Description: Status:	Kensulat PIc Lower Hollin Bank Street, BLACKBURN, Lancashire, BB2 4UB Blackburn with Darwen Borough Council, Environmental Health Department Bb55 Not Supplied Local Authority Air Pollution Control PG6/32 Adhesive coating Authorisation revokedRevoked Automatically positioned to the address	A19SE (NE)	971	3	367780 426942
	Local Authority Pol	Iution Prevention and Controls				
17	Name: Location: Authority: Permit Reference: Dated: Process Type: Description: Status: Positional Accuracy:	Kensulat Plc Lower Hollin Bank Street, BLACKBURN, Lancashire, BB2 4UB Blackburn with Darwen Borough Council, Environmental Health Department BB86 Not Supplied Local Authority Air Pollution Control PG6/32 Adhesive coating Authorisation revokedRevoked Automatically positioned to the address	A19SE (NE)	971	3	367780 426942
	Local Authority Pol	Iution Prevention and Controls				
18	Name: Location: Authority: Permit Reference: Dated: Process Type: Description: Status: Positional Accuracy:	Minimix Concrete Fletcher Street, BLACKBURN, Lancashire, BB2 4AQ Blackburn with Darwen Borough Council, Environmental Health Department BB17 Not Supplied Local Authority Air Pollution Control PG3/1Blending, packing, loading and use of bulk cement Authorisation revokedRevoked Manually positioned to the road within the address or location	A19NE (NE)	998	3	367722 427055
	Nearest Surface Wa	ater Feature				
			A13SW (SW)	61	-	366888 426301
	Pollution Incidents	to Controlled Waters	(011)			
19	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity: Decitional Accuracy:	Not Given Lancashire Environment Agency, North West Region Not Given Leeds and Liverpool Canal 20th August 1991 91320177 Leeds Liverpool Canal - North Not Given Not Given Category 3 - Minor Incident Located by supplier to within 100m	A13SE (SE)	34	2	367000 426295

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
20	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity:	to Controlled Waters Not Given Lancashire Environment Agency, North West Region Unknown Leeds and Liverpool Canal 4th December 1995 95430290 Leeds Liverpool Canal - North Not Given Other Incident/Unknown Category 3 - Minor Incident Located by supplier to within 100m	A13NW (NW)	43	2	366900 426400
21	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity:	to Controlled Waters Other Premises Liverpool / Leeds Canal, Moorgate St Environment Agency, North West Region Not Given Not Supplied 3rd March 1999 1893 Leeds Liverpool Canal - North Not Given Other Cause Category 3 - Minor Incident Approximate location provided by supplier	A13SE (E)	213	2	367200 426300
22	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity:	to Controlled Waters Not Given Lancashire Environment Agency, North West Region Oils - Diesel (Including Agricultural) Leeds and Liverpool Canal; Oil 13th August 1996 96430135 Leeds Liverpool Canal - North Not Given Not Given Category 3 - Minor Incident Located by supplier to within 100m	A12NE (W)	332	2	366600 426400
23	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity:	to Controlled Waters Not Given Lancashire Environment Agency, North West Region Oils - Diesel (Including Agricultural) Leeds and Liverpool Canal; Diesel Oil 15th February 1996 96430020 Leeds Liverpool Canal - North Not Given Other Incident/Unknown Category 3 - Minor Incident Located by supplier to within 100m	A12NE (W)	359	2	366600 426500
24	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity:	to Controlled Waters Not Given Lancashire Environment Agency, North West Region Oils - Petrol Tributary Darwen; Petrol And Solvent 2nd December 1996 96430207 Darwen Not Given Not Given Category 3 - Minor Incident Located by supplier to within 100m	A8NW (S)	462	2	366800 425900
25	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity:	to Controlled Waters Industrial: Other River Darwen Adjacent To , Scapa Scandia Site , BLACKBURN Environment Agency, North West Region Chemicals - Unknown River Darwen; Chemical 28th October 1997 97430168 Darwen Freshwater Stream/River Unknown Category 3 - Minor Incident Located by supplier to within 100m	A18SW (NW)	475	2	366700 426800

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
26	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity:	to Controlled Waters Road Livesey Branch Road, Blackburn Road Environment Agency, North West Region Oils - Diesel (Including Agricultural) Tributary River Darwen; Diesel Oil 1st October 1997 97430154 Darwen Freshwater Stream/River Road Traffic Accident Category 3 - Minor Incident Located by supplier to within 100m	A8NE (SE)	477	2	367200 425900
27	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity:	to Controlled Waters Not Given River Darwen , Holland Weir Environment Agency, North West Region Miscellaneous - Unknown River Darwen; Smell 2nd October 1997 97430148 Darwen Freshwater Stream/River Unknown Category 3 - Minor Incident Located by supplier to within 100m	A19SW (NE)	522	2	367400 426700
28	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity:	to Controlled Waters Not Given Lancashire Environment Agency, North West Region Oils - Petrol Tributary Darwen; Petroleum Solvent 3rd March 1996 96430028 Darwen Not Given Not Given Not Given Category 3 - Minor Incident Located by supplier to within 100m	A8NE (S)	526	2	367000 425800
29	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity:	to Controlled Waters Domestic/Residential Mill Hill Street, Mill Hill, BLACKBURN Environment Agency, North West Region Rubbish River Darwen; Rubbish Litter 20th March 1997 97430058 Darwen Freshwater Stream/River Unknown Category 3 - Minor Incident Located by supplier to within 100m	A18SW (N)	528	2	366800 426900
30	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity:	to Controlled Waters Not Given Harwood Homes On River Darwen Environment Agency, North West Region Sewage - Wrong Connection Not Supplied 24th June 1998 CE980576 Darwen Freshwater Stream/River Not Given Category 3 - Minor Incident Located by supplier to within 100m	A12NE (W)	530	2	366400 426395
30	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity:	to Controlled Waters Demolition Leeds & Liverpool Canal At , Brother Street Environment Agency, North West Region Oils - Diesel (Including Agricultural) Diesel; Darwen; Diesel Oil 7th October 1997 97430158 Darwen Canal Vandalism Category 3 - Minor Incident Located by supplier to within 100m	A12NE (W)	531	2	366400 426400

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
31	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity:	to Controlled Waters Not Given Location Description Not Available Environment Agency, North West Region Oils - Diesel (Including Agricultural) River Darwen 3rd August 1994 94430159 Darwen Not Given Other Incident/Unknown Category 3 - Minor Incident Located by supplier to within 100m	A17SE (NW)	533	2	366600 426800
32	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity:	to Controlled Waters Not Given Location Description Not Available Environment Agency, North West Region Chemicals - Other Organic River Darwen 9th June 1994 94430137 Darwen Not Given Wrong Connection Category 2 - Significant Incident Located by supplier to within 100m	A17SE (NW)	539	2	366500 426700
33	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity:	to Controlled Waters Not Given Lancashire Environment Agency, North West Region Not Given Not Supplied 25th August 1993 93320243 Darwen Not Given Not Given Category 3 - Minor Incident Located by supplier to within 100m	A8NW (S)	557	2	366800 425800
34	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity:	to Controlled Waters Textile industry Witton Park, BLACKBURN Environment Agency, North West Region Oils - Other Oil Oil In R Darwen; River Darwen; Oil 5th November 1997 97430169 Darwen Freshwater Stream/River Leaking Tank Category 2 - Significant Incident Located by supplier to within 100m	A17SE (NW)	602	2	366500 426800
35	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity:	to Controlled Waters Water Company Sewage: Sewage Treatment Works Location Description Not Available Environment Agency, North West Region Sewage - Treated Effluent River Darwen 11th February 1993 93320043 Darwen Not Given Unknown Category 2 - Significant Incident Located by supplier to within 100m	A14NW (E)	604	2	367600 426400
36	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity:	to Controlled Waters Manufacturing: Textile Manufacture River Darwen, Witton Park, Near Preston Old Road, Lancashire Environment Agency, North West Region Other Not Supplied 26th October 1999 33535 Darwen River Stretch (Freshwater) Plant / Machinery Failure : Pump / Machine Failure / Breakdown Category 3 - Minor Incident Located by supplier to within 100m	A17SE (NW)	613	2	366600 426900

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
37	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity:	to Controlled Waters Not Given Lancashire Environment Agency, North West Region Rubble/Litter Or Solids River Darwen; Rubbish 22nd April 1996 96430046 Darwen Not Given Not Given Category 3 - Minor Incident Located by supplier to within 100m	A14NW (E)	616	2	367600 426495
37	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity:	to Controlled Waters Not Given Location Description Not Available Environment Agency, North West Region Miscellaneous - Unknown River Darwen 10th September 1993 93320261 Darwen Not Given Unknown Category 2 - Significant Incident Located by supplier to within 100m	A14NW (E)	617	2	367600 426500
38	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity:	to Controlled Waters Not Given Lancashire Environment Agency, North West Region Miscellaneous - Inert Suspended Solids River Darwen; Sand 14th November 1996 96430197 Darwen Not Given Not Given Category 3 - Minor Incident Located by supplier to within 100m	A18SE (N)	657	2	367200 427000
39	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity:	to Controlled Waters Not Given Lancashire Environment Agency, North West Region Rubble/Litter Or Solids River Darwen; Solid Refuse 26th November 1996 96430204 Darwen Not Given Not Given Category 3 - Minor Incident Located by supplier to within 100m	A17SE (NW)	699	2	366600 427000
40	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity:	to Controlled Waters Not Given Location Description Not Available Environment Agency, North West Region Miscellaneous - Inert Suspended Solids River Blakewater 18th August 1995 95430210 Darwen Not Given Deliberate Disposal To Drain Category 2 - Significant Incident Located by supplier to within 100m	A17SE (NW)	753	2	366500 427000
41	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity:	to Controlled Waters Connection To Surface Drains Location Description Not Available Environment Agency, North West Region Oils - Waste Oil River Blakewater 18th April 1995 95430082 Darwen Not Given Wrong Connection Category 3 - Minor Incident Located by supplier to within 100m	A18NE (N)	809	2	367000 427200

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	Pollution Incidents	to Controlled Waters				
42	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity: Positional Accuracy:	Private Sewage (Non-PLC): Sewerage Systems Lancashire Environment Agency, North West Region Crude Sewage River Darwen; Green Dye 6th August 1996 96430142 Darwen Not Given Not Given Category 2 - Significant Incident Located by supplier to within 100m	A17SE (NW)	812	2	366305 426895
	Pollution Incidents	to Controlled Waters				
42	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity: Positional Accuracy:	Water Company Sewage: Sewage Treatment Works Location Description Not Available Environment Agency, North West Region Sewage Sludge River Darwen 9th February 1993 93320036 Darwen Not Given Unknown Category 2 - Significant Incident Located by supplier to within 100m	A17SE (NW)	816	2	366300 426895
	Pollution Incidents	to Controlled Waters				
42	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity: Positional Accuracy:	Connection To Surface Drains Location Description Not Available Environment Agency, North West Region Chemicals - Detergents/Surfactant River Darwen 5th May 1992 92320132 Darwen Not Given Unknown Category 2 - Significant Incident Located by supplier to within 100m	A17SE (NW)	819	2	366300 426900
	Pollution Incidents	to Controlled Waters				
43		Darwen Not Given Unknown Category 3 - Minor Incident Located by supplier to within 100m	A17SE (NW)	878	2	366305 426995
		to Controlled Waters			_	
43	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity: Positional Accuracy:	Not Given Location Description Not Available Environment Agency, North West Region Industrial Effluent Tributary Blakewater 14th July 1993 93320206 Darwen Not Given Unknown Category 2 - Significant Incident Located by supplier to within 100m	A17SE (NW)	881	2	366305 427000
		to Controlled Waters				
43	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity: Positional Accuracy:	Not Given Location Description Not Available Environment Agency, North West Region Miscellaneous - Unknown Blakewater 10th August 1993 93320228 Darwen Not Given Unknown Category 2 - Significant Incident Located by supplier to within 100m	A17SE (NW)	882	2	366300 426995

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
44	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity:	to Controlled Waters Not Given Location Description Not Available Environment Agency, North West Region Rubble/Litter Or Solids River Darwen 11th April 1995 95430120 Darwen Not Given Vandalism Category 3 - Minor Incident Located by supplier to within 100m	A9NE (SE)	879	2	367800 426000
45	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity:	to Controlled Waters Not Given Lancashire Environment Agency, North West Region Unknown None Affected; None Pollution Found 20th June 1996 96430106 Darwen Not Given Other Incident/Unknown Category 3 - Minor Incident Located by supplier to within 100m	A17NE (NW)	893	2	366400 427100
46	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity:	to Controlled Waters Not Given Location Description Not Available Environment Agency, North West Region Chemicals - Unknown Irish Sea; Hydrocarbon Cocktail 4th January 1994 94220001 Irish Sea Coastal Not Given Other Incident/Unknown Category 2 - Significant Incident Located by supplier to within 100m	A9SW (SE)	952	2	367600 425600
47	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity:	to Controlled Waters Not Given Location Description Not Available Environment Agency, North West Region Miscellaneous - Inert Suspended Solids River Darwen/Waterside 7th September 1995 95430225 Darwen Not Given Land Runoff Category 2 - Significant Incident Located by supplier to within 100m	A17SW (NW)	953	2	366205 426995
47	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity:	to Controlled Waters Not Given Location Description Not Available Environment Agency, North West Region Miscellaneous - Inert Suspended Solids River Darwen 18th October 1995 95430259 Darwen Not Given Land Runoff Category 3 - Minor Incident Located by supplier to within 100m	A17SW (NW)	956	2	366205 427000
47	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity:	to Controlled Waters Private Sewage (Non-PLC): Sewerage Systems Location Description Not Available Environment Agency, North West Region Crude Sewage River Blakewater 10th May 1995 95430122 Darwen Not Given Other Incident/Unknown Category 3 - Minor Incident Located by supplier to within 100m	A17SW (NW)	957	2	366200 426995

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
47	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity:	to Controlled Waters Not Given Lancashire Environment Agency, North West Region Miscellaneous - Inert Suspended Solids Blakewater; Silt 17th December 1996 96430220 Darwen Not Given Not Given Category 2 - Significant Incident Located by supplier to within 100m	A17SW (NW)	959	2	366205 427005
47	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity:	to Controlled Waters Not Given Location Description Not Available Environment Agency, North West Region Miscellaneous - Inert Suspended Solids River Blakewater 6th June 1991 91320116 Darwen Not Given Unknown Category 3 - Minor Incident Located by supplier to within 100m	A17SW (NW)	960	2	366200 427000
47	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity:	to Controlled Waters Private Sewage (Non-PLC): Sewerage Systems Lancashire Environment Agency, North West Region Miscellaneous - Colour River Darwen; Drain Tracing Dye 18th September 1996 96430178 Darwen Not Given Sewer Maintenance Category 3 - Minor Incident Located by supplier to within 100m	A17SW (NW)	963	2	366200 427005
47	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity:	to Controlled Waters No Premises Identified River Blakewater, Witto Environment Agency, North West Region Inert : Clays Not Supplied 18th January 1999 1922 River Blakewater River Blakewater River Stretch (Freshwater) Other Cause Category 3 - Minor Incident Located by supplier to within 100m	A17SW (NW)	964	2	366195 427000
47	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity:	to Controlled Waters Water Company Sewage: Combined Sewer Overflow River Blakewater, WITTON PARK Environment Agency, North West Region Sewage - Storm Overflow Not Supplied 19th March 1998 CE980207 Darwen Freshwater Stream/River Blocked Sewer Category 3 - Minor Incident Located by supplier to within 100m	A17SW (NW)	967	2	366195 427005
48	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity:	to Controlled Waters Not Given Location Description Not Available Environment Agency, North West Region Oils - Diesel (Including Agricultural) River Blakewater 21st September 1992 92320286 Ribble - Non-Tidal Not Given Unknown Category 2 - Significant Incident Located by supplier to within 100m	A17NE (NW)	957	2	366300 427100

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	Pollution Incidents	to Controlled Waters				
49	Property Type: Location: Authority: Pollutant: Note: Incident Date: Incident Reference: Catchment Area: Receiving Water: Cause of Incident: Incident Severity: Positional Accuracy:	Not Given River Darwen , BLACKBURN Environment Agency, North West Region Miscellaneous - Foam Darwen; Foam 19th August 1997 97430145 Darwen Freshwater Stream/River Unknown Category 3 - Minor Incident Located by supplier to within 100m	A9NE (SE)	971	2	367800 425800
	Registered Radioac	tive Substances				
50	Name: Location: Authority: Permit Reference: Dated: Process Type: Description: Status: Positional Accuracy:	Blackburn Hyndburn And Ribble Valley Hc NHS Trust Blackburn Royal Infirmary, Bolton Road, BLACKBURN, Lancashire, BB2 3LR Environment Agency, North West Region AP8250 13th March 1995 Registration under S7 RSA for the keeping and use of Radioactive materials (was RSA60 S1) Registration under the Act of an open source which is also the subject of an authorisation Authorisation superseded by a substantial or non substantial variationSuperseded	A14NE (E)	913	2	367855 426680
	Registered Radioac	tive Substances				
50	Name: Location: Authority: Permit Reference: Dated: Process Type: Description: Status: Positional Accuracy:	East Lancashire Hospitals Nhs Trust Infirmary Road, Blackburn, Lancashire, BB2 3LR Environment Agency, North West Region Bu5054 11th December 2003 Authorisation under S13 RSA for the disposal of Radioactive waste (was RSA60 S7) Authorisation under RSA Authorisation either revoked or cancelledCancelled Automatically positioned to the address	A14NE (E)	916	2	367860 426675
	Registered Radioac	tive Substances				
50	Name: Location: Authority: Permit Reference: Dated: Process Type: Description: Status:	East Lancashire Hospitals Nhs Trust Blackburn Royal Infirmary, Bolton Road, Blackburn, Lancashire, Bb2 3Ir Environment Agency, North West Region Bu5089 8th December 2003 Registration under S7 RSA for the keeping and use of Radioactive materials (was RSA60 S1) Registration under the Act of an open source which is also the subject of an authorisation Authorisation Manually positioned to the address or location	A14NE (E)	916	2	367860 426675
	Registered Radioac	tive Substances				
50	Name: Location: Authority: Permit Reference: Dated: Process Type: Description: Status: Positional Accuracy:	Blackburn Hyndburn And Ribble Valley Hc Nhs Trust Infirmary Road, Blackburn, Lancashire, BB2 3LR Environment Agency, North West Region Bm5496 25th January 2002 Registration under S7 RSA for the keeping and use of Radioactive materials (was RSA60 S1) Minor variation to a registration under the Act of an open source which is also the subject of an authorisation Authorisation either revoked or cancelledCancelled Automatically positioned to the address	A14NE (E)	916	2	367860 426675
	Registered Radioac					
50	Name: Location: Authority: Permit Reference: Dated: Process Type: Description: Status: Positional Accuracy:	Blackburn Hyndburn And Ribble Valley Hc Nhs Trust Infirmary Road, Blackburn, Lancashire, BB2 3LR Environment Agency, North West Region Bm5470 25th January 2002 Authorisation under S13 RSA for the disposal of Radioactive waste (was RSA60 S7) Minor variation to authorisation under RSA Authorisation either revoked or cancelledCancelled Automatically positioned to the address	A14NE (E)	916	2	367860 426675

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	Registered Radioad	tive Substances				
50	Name: Location: Authority: Permit Reference: Dated: Process Type: Description: Status:	Blackburn Hyndburn And Ribble Valley Hc Nhs Trust Blackburn Royal Infirmary, Bolton Road, BLACKBURN, Lancashire, BB2 3LR Environment Agency, North West Region AB9640 31st March 1991 Authorisation under S13 RSA for the disposal of Radioactive waste (was RSA60 S7) Authorisation under RSA Authorisation superseded by a substantial or non substantial variationSuperseded	A14NE (E)	916	2	367860 426675
	Positional Accuracy:	Automatically positioned to the address				
50	Registered Radioac Name: Location: Authority: Permit Reference: Dated: Process Type: Description: Status:	Blackburn Hyndburn And Ribble Valley Hc Nhs Trust Infirmary Road, BLACKBURN, Lancashire, BB2 3LR Environment Agency, North West Region AB6900 22nd September 1992 Not Supplied Minor variation to authorisation under RSA Authorisation superseded by a substantial or non substantial variationSuperseded	A14NE (E)	918	2	367860 426680
	Positional Accuracy:					
50	Registered Radioac Name: Location: Authority: Permit Reference: Dated: Process Type: Description: Status:	tive Substances Blackburn Hyndburn And Ribble Valley Hc Nhs Trust Infirmary Road, BLACKBURN, Lancashire, BB2 3LR Environment Agency, North West Region AK0669 31st March 1991 Authorisation under S13 RSA for the disposal of Radioactive waste (was RSA60 S7) Authorisation under RSA Authorisation either revoked or cancelledCancelled	A14NE (E)	919	2	367865 426670
	Positional Accuracy:	Unknown				
50	Registered Radioad Name: Location: Authority: Permit Reference: Dated: Process Type: Description: Status:	Blackburn Hyndburn And Ribble Valley Hc Nhs Trust Infirmary Road, BLACKBURN, Lancashire, BB2 3LR Environment Agency, North West Region AG7164 28th October 1992 Authorisation under S13 RSA for the disposal of Radioactive waste (was RSA60 S7) Minor variation to authorisation under RSA Authorisation superseded by a substantial or non substantial variationSuperseded	A14NE (E)	921	2	367865 426675
	Positional Accuracy:	Unknown				
	River Quality Name: GQA Grade: Reach: Estimated Distance (km): Flow Rate: Flow Rate: Flow Type: Year:	Leeds/Liverpool Canal River Quality C Johnsons Hillock To Rishton 27.4 Flow greater than 80 cumecs Canal 2000	A13SW (S)	101	2	366920 426241
	River Quality					
	Name: GQA Grade: Reach: Estimated Distance (km): Flow Rate: Flow Type: Year:	Darwen River Quality D Darwen Stw Storm Tanks To Roddlesworth 8.5 Flow less than 2.5 cumecs River 2000	A14NW (NE)	484	2	367357 426693
	River Quality Name: GQA Grade: Reach: Estimated Distance (km): Flow Rate: Flow Type: Year:	Blakewater River Quality D Qsl At Whitebirk le To Darwen 5.8 Flow less than 1.25 cumecs River 2000	A18NE (N)	827	2	366963 427220

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	River Quality Chemi	istry Sampling Points				
51	Name: Reach: Estimated Distance: Objective:	Leeds/Liverpool Canal Johnsons Hillock To Rishton		699	2	367660 426590
	Year: GQA Grade:	2009 River Quality Chemistry GQA Grade A - Very Good				
	Compliance:	Not Supplied				

LANDMARK INFORMATION GROUP*

 Name: Reach: Estimated Distance:	istry Sampling Points				
Name: Reach: Estimated Distance:					
Objective:	Not Supplied	A17SW (NW)	939	2	366247 427022
Year: GQA Grade: Compliance:	Located by supplier to within 10m 1990 River Quality Chemistry GQA Grade D - Fair Not Supplied				
Year: GQA Grade: Compliance: Year:	1993 River Quality Chemistry GQA Grade C - Fairly Good Not Supplied 1994				
GQA Grade: Compliance: Year: GQA Grade:	River Quality Chemistry GQA Grade C - Fairly Good Not Supplied 1995 River Quality Chemistry GQA Grade C - Fairly Good				
Compliance: Year: GQA Grade:	Not Supplied 1996 River Quality Chemistry GQA Grade C - Fairly Good				
Compliance: Year: GQA Grade: Compliance:	Not Supplied 1997 River Quality Chemistry GQA Grade C - Fairly Good Not Supplied				
Year: GQA Grade: Compliance: Year:	1998 River Quality Chemistry GQA Grade C - Fairly Good Not Supplied 1999				
GQA Grade: Compliance: Year: GQA Grade:	River Quality Chemistry GQA Grade B - Good Not Supplied 2000 River Quality Chemistry GQA Grade B - Good				
Compliance: Year: GQA Grade:	Not Supplied 2001 River Quality Chemistry GQA Grade B - Good				
Compliance: Year: GQA Grade: Compliance:	Not Supplied 2002 River Quality Chemistry GQA Grade B - Good Not Supplied				
Year: GQA Grade: Compliance: Year:	2003 River Quality Chemistry GQA Grade B - Good Not Supplied 2004				
GQA Grade: Compliance: Year: GQA Grade:	River Quality Chemistry GQA Grade B - Good Not Supplied 2005 River Quality Chemistry GQA Grade B - Good				
Compliance: Year: GQA Grade: Compliance:	Not Supplied 2006 River Quality Chemistry GQA Grade B - Good Not Supplied				
Year: GQA Grade: Compliance: Year:	2007 River Quality Chemistry GQA Grade B - Good Not Supplied 2008				
GQA Grade: Compliance: Year: GQA Grade:	River Quality Chemistry GQA Grade D - Fair Not Supplied 2009 River Quality Chemistry GQA Grade C - Fairly Good				
Compliance:	Not Supplied				
Substantiated Pollu	tion Incident Register				
	Environment Agency - North West Region, Central Area 2nd December 2016 1488700 Cotecory 4, No Import	A13NW (W)	313	2	366631 426444
Water Impact: Air Impact: Land Impact: Positional Accuracy: Pollutant:	Category 4 - No Impact Category 2 - Significant Incident Category 2 - Significant Incident Located by supplier to within 10m Specific Waste Materials: Commercial Waste				
Substantiated Pollu	tion Incident Register				
Authority: Incident Date: Incident Reference: Water Impact: Air Impact: Land Impact: Positional Accuracy: Pollutant:	Environment Agency - North West Region, North Area 5th May 2005 312785 Category 4 - No Impact Category 4 - No Impact Category 2 - Significant Incident Located by supplier to within 10m Inert : Construction / Demolition Material	A13NE (NE)	365	2	367190 426680

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
55	Authority: Incident Date: Incident Reference: Water Impact: Air Impact: Land Impact:	ttion Incident Register Environment Agency - North West Region, Central Area 28th June 2010 795392 Category 3 - Minor Incident Category 2 - Significant Incident Category 3 - Minor Incident Located by supplier to within 10m Atmospheric Pollutants And Effects: Smoke Contaminated Water: Firefighting Run-Off	A14NE (E)	722	2	367689 426573
56	Authority: Incident Date: Incident Reference: Water Impact: Air Impact: Land Impact:	ttion Incident Register Environment Agency - North West Region, North Area 16th September 2007 531772 Category 2 - Significant Incident Category 4 - No Impact Category 3 - Minor Incident Located by supplier to within 10m Qils - Unknown	A17SE (NW)	772	2	366358 426896
57	Authority: Incident Date: Incident Reference: Water Impact: Air Impact: Land Impact:	tion Incident Register Environment Agency - North West Region, Central Area 13th July 2013 1132705 Category 4 - No Impact Category 2 - Significant Incident Category 3 - Minor Incident Located by supplier to within 10m Atmospheric Pollutants And Effects: Smoke	A19SE (NE)	897	2	367747 426860
58	Water Abstractions Operator: Licence Number: Permit Version: Location: Authority: Abstraction Type: Source: Daily Rate (m3): Yearly Rate (m3): Details: Authorised Start: Authorised Start: Authorised End: Permit Start Date: Positional Accuracy:	Tower Laundry Services 2671340047 101 Borehole At Premises,Charnley Street,Blackburn Environment Agency, North West Region Other Industrial/Commercial/Public Services: General Use (Medium Loss) Water may be abstracted from a single point Groundwater 18 6637 Premises At Charnley Street, Blackbu 01 January 31 December 18th August 1999 Not Supplied Located by supplier to within 100m	A14NW (NE)	465	2	367400 426600
59	Water Abstractions Operator: Licence Number: Permit Version: Location: Authority: Abstraction Type: Source: Daily Rate (m3): Yearly Rate (m3): Details: Authorised Start: Authorised Start: Authorised End: Permit Start Date: Permit End Date: Positional Accuracy:	Voith Paper Fabrics Blackburn Limited 2671340020 103 Boreholes (2) At Works On Cartmel Rd Blackburn Environment Agency, North West Region Other Industrial/Commercial/Public Services: General Cooling (Existing Licences Only) (Low Loss) Water may be abstracted from a single point Groundwater Not Supplied Not Supplied Works At Cartmell Rd, Blackburn 01 January 31 December 18th November 2005 Not Supplied Located by supplier to within 100m	A17SE (NW)	624	2	366400 426700

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
59	Water Abstractions Operator: Licence Number: Permit Version: Location: Authority: Abstraction Type: Source: Daily Rate (m3): Yearly Rate (m3): Details: Authorised Start: Authorised Start: Authorised End: Permit Start Date: Positional Accuracy:	Voith Paper Fabrics Blackburn Limited 2671340020 103 Boreholes (2) At Works On Cartmel Rd Blackburn Environment Agency, North West Region Other Industrial/Commercial/Public Services: Process Water Water may be abstracted from a single point Groundwater Not Supplied Not Supplied Works At Cartmell Rd, Blackburn 01 January 31 December 18th November 2005 Not Supplied Located by supplier to within 100m	A17SE (NW)	624	2	366400 426700
59		Voith Fabrics Blackburn Ltd 2671340020 102 Boreholes (2) At Works On Cartmel Rd Blackburn Environment Agency, North West Region Other Industrial/Commercial/Public Services: General Cooling (Existing Licences Only) (Low Loss) Water may be abstracted from a single point Groundwater Not Supplied Not Supplied Works At Cartmell Rd, Blackburn 01 January 31 December 7th March 2002 Not Supplied Located by supplier to within 100m	A17SE (NW)	624	2	366400 426700
59	Water Abstractions Operator: Licence Number: Permit Version: Location: Authority: Abstraction: Abstraction: Abstraction: Daily Rate (m3): Yearly Rate (m3): Details: Authorised Start: Authorised Start: Permit Start Date: Permit End Date: Positional Accuracy:	Voith Fabrics Blackburn Ltd 2671340020 102 Boreholes (2) At Works On Cartmel Rd Blackburn Environment Agency, North West Region Other Industrial/Commercial/Public Services: Process Water Water may be abstracted from a single point Groundwater Not Supplied Not Supplied Works At Cartmell Rd, Blackburn 01 January 31 December 7th March 2002 Not Supplied Located by supplier to within 100m	A17SE (NW)	624	2	366400 426700
59	Water Abstractions Operator: Licence Number: Permit Version: Location: Authority: Abstraction Type: Source: Daily Rate (m3): Yearly Rate (m3): Details: Authorised Start: Authorised Start: Authorised End: Permit Start Date: Permit End Date: Positional Accuracy:	Voith Fabrics Blackburn Ltd 2671340020 101 Boreholes (2) At Works On Cartmel Rd Blackburn Environment Agency, North West Region Other Industrial/Commercial/Public Services: General Cooling (Existing Licences Only) (Low Loss) Water may be abstracted from a single point Groundwater Not Supplied Not Supplied Works At Cartmell Rd, Blackburn 01 January 31 December 1st October 1999 Not Supplied Located by supplier to within 10m	A17SE (NW)	624	2	366400 426700

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
59	Water Abstractions Operator: Licence Number: Permit Version: Location: Authority: Abstraction Type: Source: Daily Rate (m3): Yearly Rate (m3): Details: Authorised Start: Authorised Start: Authorised End: Permit Start Date: Permit End Date: Positional Accuracy:	Voith Fabrics Blackburn Ltd 2671340020 101 Boreholes (2) At Works On Cartmel Rd Blackburn Environment Agency, North West Region Other Industrial/Commercial/Public Services: Process Water Water may be abstracted from a single point Groundwater Not Supplied Not Supplied Works At Cartmell Rd, Blackburn 01 January 31 December 1st October 1999 Not Supplied Located by supplier to within 10m	A17SE (NW)	624	2	366400 426700
59	Water Abstractions Operator: Licence Number: Permit Version: Location: Authority: Abstraction Type: Source: Daily Rate (m3): Yearly Rate (m3): Details: Authorised Start: Authorised Start: Authorised End: Permit Start Date: Permit End Date: Positional Accuracy:	Scapa Scandia Ltd 2671340020 100 Boreholes (2) At Works On Cartmel Rd Blackburn Environment Agency, North West Region Other Industrial/Commercial/Public Services: Process Water Water may be abstracted from a single point Groundwater Not Supplied Not Supplied Works At Cartmell Rd, Blackburn 01 January 31 December 27th June 1997 Not Supplied Located by supplier to within 10m	A17SE (NW)	624	2	366400 426700
59	Water Abstractions Operator: Licence Number: Permit Version: Location: Authority: Abstraction Type: Source: Daily Rate (m3): Yearly Rate (m3): Yearly Rate (m3): Details: Authorised Start: Authorised Start: Authorised End: Permit Start Date: Positional Accuracy:	Scapa Scandia Ltd 2671340020 100 Boreholes (2) At Works On Cartmel Rd Blackburn Environment Agency, North West Region Other Industrial/Commercial/Public Services: General Cooling (Existing Licences Only) (Low Loss) Water may be abstracted from a single point Groundwater 1589 230000 Works At Cartmell Rd, Blackburn 01 January 31 December 27th June 1997 Not Supplied Located by supplier to within 100m	A17SE (NW)	624	2	366400 426700
60	Water Abstractions Operator: Licence Number: Permit Version: Location: Authority: Abstraction Type: Source: Daily Rate (m3): Yearly Rate (m3): Yearly Rate (m3): Details: Authorised Start: Authorised End: Permit Start Date: Permit End Date: Positional Accuracy:	Voith Paper Fabrics Blackburn Limited 2671340020 103 Boreholes (2) At Works On Cartmel Rd Blackburn Environment Agency, North West Region Other Industrial/Commercial/Public Services: General Cooling (Existing Licences Only) (Low Loss) Water may be abstracted from a single point Groundwater Not Supplied Not Supplied Works At Cartmell Rd, Blackburn 01 January 31 December 18th November 2005 Not Supplied Located by supplier to within 100m	A17SE (NW)	885	2	366300 427000

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
60	Water Abstractions Operator: Licence Number: Permit Version: Location: Authority: Abstraction Type: Source: Daily Rate (m3): Yearly Rate (m3): Details: Authorised Start: Authorised Start: Authorised End: Permit Start Date: Positional Accuracy:	Voith Paper Fabrics Blackburn Limited 2671340020 103 Boreholes (2) At Works On Cartmel Rd Blackburn Environment Agency, North West Region Other Industrial/Commercial/Public Services: Process Water Water may be abstracted from a single point Groundwater Not Supplied Not Supplied Works At Cartmell Rd, Blackburn 01 January 31 December 18th November 2005 Not Supplied Located by supplier to within 100m	A17SE (NW)	885	2	366300 427000
60	-	Voith Fabrics Blackburn Ltd 2671340020 102 Boreholes (2) At Works On Cartmel Rd Blackburn Environment Agency, North West Region Other Industrial/Commercial/Public Services: General Cooling (Existing Licences Only) (Low Loss) Water may be abstracted from a single point Groundwater Not Supplied Not Supplied Works At Cartmell Rd, Blackburn 01 January 31 December 7th March 2002 Not Supplied Located by supplier to within 100m	A17SE (NW)	885	2	366300 427000
60	Water Abstractions Operator: Licence Number: Permit Version: Location: Authority: Abstraction: Abstraction Type: Source: Daily Rate (m3): Yearly Rate (m3): Yearly Rate (m3): Details: Authorised Start: Authorised End: Permit Start Date: Permit End Date: Positional Accuracy:	Voith Fabrics Blackburn Ltd 2671340020 102 Boreholes (2) At Works On Cartmel Rd Blackburn Environment Agency, North West Region Other Industrial/Commercial/Public Services: Process Water Water may be abstracted from a single point Groundwater Not Supplied Not Supplied Works At Cartmell Rd, Blackburn 01 January 31 December 7th March 2002 Not Supplied Located by supplier to within 100m	A17SE (NW)	885	2	366300 427000
60	Water Abstractions Operator: Licence Number: Permit Version: Location: Authority: Abstraction Type: Source: Daily Rate (m3): Yearly Rate (m3): Details: Authorised Start: Authorised Start: Authorised End: Permit Start Date: Permit End Date: Positional Accuracy:	Voith Fabrics Blackburn Ltd 2671340020 101 Boreholes (2) At Works On Cartmel Rd Blackburn \$359 Environment Agency, North West Region Other Industrial/Commercial/Public Services: General Cooling (Existing Licences Only) (Low Loss) Water may be abstracted from a single point Groundwater Not Supplied Not Supplied Works At Cartmell Rd, Blackburn 01 January 31 December 1st October 1999 Not Supplied Located by supplier to within 10m	A17SE (NW)	885	2	366300 427000

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
60	Water Abstractions Operator: Licence Number: Permit Version: Location: Authority: Abstraction: Abstraction Type: Source: Daily Rate (m3): Yearly Rate (m3): Details: Authorised Start: Authorised Start: Authorised End: Permit Start Date: Permit End Date: Positional Accuracy:	Voith Fabrics Blackburn Ltd 2671340020 101 Boreholes (2) At Works On Cartmel Rd Blackburn \$359 Environment Agency, North West Region Other Industrial/Commercial/Public Services: Process Water Water may be abstracted from a single point Groundwater Not Supplied Not Supplied Works At Cartmell Rd, Blackburn 01 January 31 December 1st October 1999 Not Supplied Located by supplier to within 10m	A17SE (NW)	885	2	366300 427000
60	Water Abstractions Operator: Licence Number: Permit Version: Location: Authority: Abstraction Type: Source: Daily Rate (m3): Yearly Rate (m3): Details: Authorised Start: Authorised End: Permit Start Date: Permit End Date: Positional Accuracy:	Scapa Scandia Ltd 2671340020 100 Boreholes (2) At Works On Cartmel Rd Blackburn \$359 Environment Agency, North West Region Other Industrial/Commercial/Public Services: Process Water Water may be abstracted from a single point Groundwater Not Supplied Not Supplied Works At Cartmell Rd, Blackburn 01 January 31 December 27th June 1997 Not Supplied Located by supplier to within 10m	A17SE (NW)	885	2	366300 427000
60	Water Abstractions Operator: Licence Number: Permit Version: Location: Authority: Abstraction Type: Source: Daily Rate (m3): Yearly Rate (m3): Details: Authorised Start: Authorised End: Permit Start Date: Permit End Date: Positional Accuracy:	Scapa Scandia Ltd 2671340020 100 Boreholes (2) At Works On Cartmel Rd Blackburn \$359 Environment Agency, North West Region Other Industrial/Commercial/Public Services: General Cooling (Existing Licences Only) (Low Loss) Water may be abstracted from a single point Groundwater 0 0 Works At Cartmell Rd, Blackburn 01 January 31 December 27th June 1997 Not Supplied Located by supplier to within 100m	A17SE (NW)	885	2	366300 427000
	Water Abstractions Operator: Licence Number: Permit Version: Location: Authority: Abstraction Type: Source: Daily Rate (m3): Yearly Rate (m3): Details: Authorised Start: Authorised Start: Authorised End: Permit Start Date: Positional Accuracy:	Advanced Dyers Ltd 2671341032 1 Land At Advanced Dyers Ltd, Blackburn Environment Agency, North West Region Other Industrial/Commercial/Public Services: General Use (Medium Loss) Water may be abstracted from a single point Groundwater Not Supplied Not Supplied Not Supplied O1 January 31 December 29th November 2005 Not Supplied Located by supplier to within 10m	A19SE (NE)	1016	2	367830 426950

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	Water Abstractions Operator: Licence Number:	Blackburn Products Limited 2671341021	A24SW (NE)	1460	2	367600 427700
	Permit Version: Location: Authority: Abstraction: Abstraction Type: Source: Daily Rate (m3):	Not Supplied River Blakewater, Whalley Banks, BLACKBURN, Lancashire Environment Agency, North West Region Industrial Manufacturing & Cooling Not Supplied Surface 982				
	Yearly Rate (m3): Details: Authorised Start: Authorised End: Permit Start Date: Permit End Date:	245484 Additional Purposes: Manufacturing; Cooling; Licence Status: Revoked Not Supplied Not Supplied Not Supplied Located by supplier to within 100m				
	Water Abstractions					
	Operator: Licence Number: Permit Version: Location: Authority:	P C Shorrock 2671343005 100 Well At Livesey, Darwen Environment Agency, North West Region	A2SW (SW)	1890	2	366000 424700
	Abstraction: Abstraction Type: Source: Daily Rate (m3): Yearly Rate (m3):	General Agriculture; General Use (Medium Loss) Water may be abstracted from a single point Groundwater 7 2046				
	Details: Authorised Start: Authorised End: Permit Start Date: Permit End Date:	Potters Farm,Livesey, Darwen 01 January 31 December 1st April 1966 Not Supplied				
	Positional Accuracy:	Located by supplier to within 100m				
	Water Abstractions					
	Operator: Licence Number: Permit Version:	Advanced Dyers Ltd 2671341030 1	(N)	1908	2	367000 428300
	Location: Authority: Abstraction:	Borehole At Lancashire Laundry Ltd, Blackburn Environment Agency, North West Region Laundry: General Use (Medium Loss)				
	Abstraction Type: Source: Daily Rate (m3):	Water may be abstracted from a single point Groundwater Not Supplied Not Supplied				
	Yearly Rate (m3): Details: Authorised Start: Authorised End:	Not Supplied 01 January 31 December				
	Permit Start Date: Permit End Date:	Alst July 2002 Not Supplied Located by supplier to within 100m				
	Water Abstractions					
	Operator: Licence Number: Permit Version:	Advanced Dyers Ltd 2671341028 101	(N)	1908	2	367000 428300
	Location: Authority: Abstraction: Abstraction Type:	Borehole At Lancashire Laundry Ltd, Blackburn Environment Agency, North West Region Other Industrial/Commercial/Public Services: General Use (Medium Loss) Water may be abstracted from a single point				
	Source: Daily Rate (m3): Yearly Rate (m3): Details:	Groundwater Not Supplied Not Supplied Land At Lancashire Laundry Ltd				
	Authorised Start: Authorised End: Permit Start Date:	01 January 31 December 1st January 2000				
	Permit End Date: Positional Accuracy:	Not Supplied Located by supplier to within 100m				

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	Water Abstractions					
	Operator: Licence Number: Permit Version: Location: Authority: Abstraction Type: Source: Daily Rate (m3): Yearly Rate (m3): Details: Authorised Start: Authorised Start: Authorised End: Permit Start Date: Positional Accuracy:	Lancashire Laundry Ltd 2671341028 100 Borehole At Lancashire Laundry Ltd, Blackburn Environment Agency, North West Region Other Industrial/Commercial/Public Services: General Use (Medium Loss) Water may be abstracted from a single point Groundwater 218 79498 Land At Lancashire Laundry Ltd 01 January 31 December 2nd April 1997 Not Supplied Located by supplier to within 100m	(N)	1908	2	367000 428300
	Water Abstractions Operator: Licence Number: Permit Version: Location: Authority: Abstraction Type: Source: Daily Rate (m3): Yearly Rate (m3): Details: Authorised Start: Authorised Start: Authorised End: Permit Start Date: Permit End Date: Positional Accuracy:	Blackburn Yarn Dyers Ltd 2671341025 100 Borehole At Grimshaw Park Dyeworks, Blackburn Environment Agency, North West Region Other Industrial/Commercial/Public Services: General Use (Medium Loss) Water may be abstracted from a single point Groundwater 215 50000 Premises At Grimshaw Park,Blackburn 01 January 31 December 29th September 1994 Not Supplied Located by supplier to within 100m	(E)	1951	2	368900 426800
	Groundwater Vulne Soil Classification: Map Sheet: Scale:	rability Soils of High Leaching Potential (U) - Soil information for restored mineral workings and urban areas is based on fewer observations than elsewhere. A worst case vulnerability classification (H) assumed, until proved otherwise Sheet 10 Central Lancashire 1:100,000	A13SE (N)	0	2	366963 426359
	Drift Deposits Drift Deposit: Map Sheet: Scale:	Low permeability drift deposits occuring at the surface and overlying Major and Minor Aquifers are head, clay-with-flints, brickearth, peat, river terrace deposits and marine and estuarine alluvium Sheet 10 Central Lancashire 1:100,000		0	2	366963 426359
	Bedrock Aquifer De Aquifer Designation:	signations Secondary Aquifer - A	A13SE (N)	0	1	366963 426359
		Secondary Aquifer - Undifferentiated	A13SE (N)	0	1	366963 426359
	None	rom Rivers or Sea without Defences				
	Flooding from Rive	rs or Sea without Defences				
	Areas Benefiting fro None Flood Water Storag None Flood Defences None					
61	OS Water Network I Watercourse Form: Watercourse Length: Watercourse Level: Permanent: Watercourse Name: Catchment Name: Primacy:	Canal : 394.8	A13SW (SW)	66	4	366915 426275

LANDMARK INFORMATION GROUP*

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
62	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 33.3 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Ribble Primacy: 2	A13SE (S)	99	4	366998 426227
63	OS Water Network Lines Watercourse Form: Canal Watercourse Length: 7.4 Watercourse Level: On ground surface Permanent: True Watercourse Name: Leeds and Liverpool Canal Catchment Name: Ribble Primacy: 1	A13SE (S)	99	4	366998 426227
64	OS Water Network Lines Watercourse Form: Canal Watercourse Length: 341.7 Watercourse Level: On ground surface Permanent: True Watercourse Name: Leeds and Liverpool Canal Catchment Name: Ribble Primacy: 1	A13SE (S)	103	4	367005 426224
65	OS Water Network Lines Watercourse Form: Canal Watercourse Length: 11.1 Watercourse Level: Not Supplied Permanent: True Watercourse Name: Leeds and Liverpool Canal Catchment Name: Ribble Primacy: 1	A13NW (W)	278	4	366657 426404
66	OS Water Network Lines Watercourse Form: Canal Watercourse Length: 1752.7 Watercourse Level: On ground surface Permanent: True Watercourse Name: Leeds and Liverpool Canal Catchment Name: Ribble Primacy: 1	A13NW (W)	289	4	366646 426407
67	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 75.8 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Ribble Primacy: 1	A13SE (SE)	347	4	367174 426035
68	OS Water Network Lines Watercourse Form: Canal Watercourse Length: 350.1 Watercourse Level: On ground surface Permanent: True Watercourse Name: Leeds and Liverpool Canal Catchment Name: Ribble Primacy: 1	A14SW (E)	359	4	367336 426246
69	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 12.1 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Ribble Primacy: 1	A8NE (S)	451	4	367134 425900
70	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 923.2 Watercourse Level: On ground surface Permanent: True Watercourse Name: River Darwen Catchment Name: Ribble Primacy: 1	A18SW (N)	526	4	366858 426912

LANDMARK INFORMATION GROUP*

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
71	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 48.8 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Ribble Primacy: 1	A14NW (E)	527	4	367507 426500
72	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 412.2 Watercourse Level: On ground surface Permanent: True Watercourse Name: River Darwen Catchment Name: Ribble Primacy: 1	A19SW (NE)	536	4	367379 426746
73	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 26.8 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Ribble Primacy: 1	A12NE (W)	560	4	366391 426506
74	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 195.4 Watercourse Level: Not Supplied Permanent: True Watercourse Name: River Darwen Catchment Name: Ribble Primacy: 1	A19SW (NE)	565	4	367326 426830
75	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 91.6 Watercourse Level: Underground Permanent: True Watercourse Name: River Darwen Catchment Name: Ribble Primacy: 1	A14NW (E)	610	4	367588 426521
76	OS Water Network Lines Watercourse Form: Canal Watercourse Length: 23.0 Watercourse Level: On ground surface Permanent: True Watercourse Name: Leeds and Liverpool Canal Catchment Name: Ribble Primacy: 1	A14NW (E)	617	4	367606 426468
77	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 72.5 Watercourse Level: Not Supplied Permanent: True Watercourse Name: River Darwen Catchment Name: Ribble Primacy: 1	A18SW (N)	631	4	366956 427024
78	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 314.7 Watercourse Level: On ground surface Permanent: True Watercourse Name: River Darwen Catchment Name: Ribble Primacy: 1	A18SE (N)	636	4	367026 427025
79	OS Water Network Lines Watercourse Form: Canal Watercourse Length: 141.6 Watercourse Level: On ground surface Permanent: True Watercourse Name: Leeds and Liverpool Canal Catchment Name: Ribble Primacy: 1	A14NW (E)	637	4	367623 426483

LANDMARK INFORMATION GROUP*

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
80	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 371.3 Watercourse Level: On ground surface Permanent: True Watercourse Name: River Darwen Catchment Name: Ribble Primacy: 1	A14NE (E)	649	4	367642 426443
81	OS Water Network Lines Watercourse Form: Canal Watercourse Length: 3.7 Watercourse Level: Not Supplied Permanent: True Watercourse Name: Leeds and Liverpool Canal Catchment Name: Ribble Primacy: 1	A14NE (E)	724	4	367680 426608
82	OS Water Network Lines Watercourse Form: Canal Watercourse Length: 171.4 Watercourse Level: On ground surface Permanent: True Watercourse Name: Leeds and Liverpool Canal Catchment Name: Ribble Primacy: 1	A14NE (E)	727	4	367682 426611
83	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 279.5 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Ribble Primacy: 1	A8SW (S)	842	4	366672 425543
84	OS Water Network Lines Watercourse Form: Transfer Watercourse Length: 8.7 Watercourse Level: On ground surface Permanent: False Watercourse Name: Not Supplied Catchment Name: Ribble Primacy: 2	A19SE (NE)	858	4	367767 426746
85	OS Water Network Lines Watercourse Form: Canal Watercourse Length: 5.7 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Ribble Primacy: 2	A19SE (NE)	861	4	367765 426757
86	OS Water Network Lines Watercourse Form: Canal Watercourse Length: 2426.4 Watercourse Level: On ground surface Permanent: True Watercourse Name: Leeds and Liverpool Canal Catchment Name: Ribble Primacy: 1	A19SE (NE)	861	4	367765 426757
87	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 111.7 Watercourse Level: On ground surface Permanent: True Watercourse Name: River Darwen Catchment Name: Ribble Primacy: 1	A14SE (E)	863	4	367837 426167
88	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 135.4 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Ribble Primacy: 1	A14SE (E)	863	4	367837 426167

LANDMARK INFORMATION GROUP*

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
89	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 101.6 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Ribble Primacy: 1	A9NE (SE)	902	4	367649 425715
90	OS Water Network Lines Watercourse Form: Lake Watercourse Length: 4.0 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Ribble Primacy: 1	A9SW (SE)	905	4	367591 425654
91	OS Water Network Lines Watercourse Form: Inland river Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Ribble Primacy: 1	A9SW (SE)	908	4	367595 425653
92	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 434.3 Watercourse Level: On ground surface Permanent: True Watercourse Name: River Blakewater Catchment Name: Ribble Primacy: 1	A17NE (NW)	912	4	366495 427186
93	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 174.6 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Ribble Primacy: 1	A14SE (E)	916	4	367862 426063
94	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 236.6 Watercourse Level: On ground surface Permanent: True Watercourse Name: River Darwen Catchment Name: Ribble Primacy: 1	A14SE (E)	916	4	367862 426063
95	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 31.9 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Ribble Primacy: 1	A9SW (SE)	919	4	367606 425650
96	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 83.3 Watercourse Level: Not Supplied Permanent: True Watercourse Name: Not Supplied Catchment Name: Ribble Primacy: 1	A9NE (SE)	924	4	367673 425710
97	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 127.5 Watercourse Level: On ground surface Permanent: True Watercourse Name: River Darwen Catchment Name: Ribble Primacy: 1	A17SW (NW)	937	4	366225 426994

LANDMARK INFORMATION GROUP*

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
98	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 35.3 Watercourse Level: On ground surface Permanent: True Watercourse Name: River Blakewater Catchment Name: Ribble Primacy: 1	A17SW (NW)	937	4	366225 426994
99	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 11.8 Watercourse Level: Not Supplied Permanent: True Watercourse Name: River Blakewater Catchment Name: Ribble Primacy: 1	A17SW (NW)	938	4	366249 427023
100	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 146.7 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Ribble Primacy: 1	A9SE (SE)	981	4	367692 425646
101	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 77.1 Watercourse Level: Underground Permanent: True Watercourse Name: River Blakewater Catchment Name: Ribble Primacy: 1	A17NE (NW)	982	4	366553 427293

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	Historical Landfill S	lites				
102	Licence Holder: Location: Name: Operator Location: Boundary Accuracy: Provider Reference: First Input Date: Last Input Date: Specified Waste Type: EA Waste Ref: Regis Ref: WRC Ref: BGS Ref: Other Ref:		A12NW (NW)	779	2	366223 426689
l .	Licensed Waste Ma	nagement Facilities (Locations)				
103	Licence Number: Location: Operator Name: Operator Location: Authority: Site Category: Licence Status: Issued: Last Modified: Expires: Suspended: Revoked: Surrendered: IPPC Reference: Positional Accuracy:	54193 Queen Victoria Street, Mill Hill, Blackburn, Lancashire T Lethbridge Ltd Not Supplied Environment Agency - North West Region, North Area Household, Commercial And Industrial Transfer Stations Surrendered 29th December 1994 Not Supplied Not Supplied Not Supplied Not Supplied 18th March 2005 Not Supplied Located by supplier to within 100m	A18SE (N)	311	2	367000 426700
	Licensed Waste Ma	nagement Facilities (Locations)				
104		403234 Victoria Works, Bonsall Street, Blackburn, Lancashire, BB2 4DD The Furniture Recycling Group Limited Not Supplied Environment Agency - North West Region, North Area HCI Waste TS + treatment Issued 16th March 2017 Not Supplied Not Supplied Not Supplied Not Supplied Not Supplied Not Supplied Not Supplied Not Supplied Not Supplied	A12NE (W)	469	2	366469 426443
		nagement Facilities (Locations)				
105	Licence Number: Location: Operator Name: Operator Location: Authority: Site Category: Licence Status: Issued: Last Modified: Expires: Suspended: Revoked: Surrendered: IPPC Reference: Positional Accuracy:	401586 Unit 3, Kensulate Park, Lower Hollin Bank Street, Blackburn, Lancashire, BB2 4AD 1 First Choice Skip Hire Ltd Not Supplied Environment Agency - North West Region, North Area Not Supplied Issued 9th July 2014 Not Supplied Not Supplied Not Supplied Not Supplied Not Supplied Not Supplied Not Supplied Located by supplier to within 10m	A19SE (NE)	902	2	367759 426851

Envirocheck[®]

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
105	Licence Number: Location: Operator Name: Operator Location: Authority: Site Category: Licence Status: Issued:	nagement Facilities (Locations) 101580 Unit 2a, Lower Hollin Bank Street, Blackburn, Lancashire, BB2 4AD Blackburn Skip Hire Ltd Not Supplied Environment Agency - North West Region, North Area HCI Waste TS + treatment Expired 28th July 2010	A19SE (NE)	916	2	367763 426870
	Last Modified: Expires: Suspended: Revoked: Surrendered: IPPC Reference: Positional Accuracy:	Not Supplied Not Supplied Not Supplied Not Supplied Not Supplied Not Supplied Located by supplier to within 10m				
	Local Authority Lan Name:	Idfill Coverage Blackburn with Darwen Unitary Council - Has supplied landfill data		0	5	366963 426359
106	Local Authority Rec Location: Reference: Authority: Last Reported Status: Types of Waste: Date of Closure:	corded Landfill Sites St Frances Road Playing Fields, Blackburn 10/052 Blackburn with Darwen Borough Council Unknown Not Supplied	A12NE (NW)	464	5	366537 426617
	Positional Accuracy: Boundary Quality: Potentially Infilled L					
107	Bearing Ref: Use: Date of Mapping:	NE Unknown Filled Ground (Pit, quarry etc) 1993	A13NE (NE)	180	-	367086 426530
108	Potentially Infilled L Bearing Ref: Use: Date of Mapping:	. and (Non-Water) E Unknown Filled Ground (Pit, quarry etc) 1993	A13SE (E)	289	-	367282 426316
109	Potentially Infilled L Bearing Ref: Use: Date of Mapping:	.and (Non-Water) NW Unknown Filled Ground (Pit, quarry etc) 1993	A13NW (NW)	358	-	366693 426648
110	Potentially Infilled L Bearing Ref: Use: Date of Mapping:	and (Non-Water) W Unknown Filled Ground (Pit, quarry etc) 1993	A12SE (W)	432	-	366514 426226
111	Potentially Infilled L Bearing Ref: Use: Date of Mapping:	.and (Non-Water) NW Unknown Filled Ground (Pit, quarry etc) 1993	A12NE (NW)	444	-	366560 426617
112	Potentially Infilled L Bearing Ref: Use: Date of Mapping:	.and (Non-Water) E Unknown Filled Ground (Pit, quarry etc) 1993	A14SW (E)	465	-	367429 426190
113	Potentially Infilled L Bearing Ref: Use: Date of Mapping:	.and (Non-Water) W Unknown Filled Ground (Pit, quarry etc) 1993	A12NE (W)	494	-	366443 426440
114	Potentially Infilled L Bearing Ref: Use: Date of Mapping:	and (Non-Water) E Unknown Filled Ground (Pit, quarry etc) 1993	A14NW (E)	507	-	367474 426539
115	Potentially Infilled L Bearing Ref: Use: Date of Mapping:	and (Non-Water) W Unknown Filled Ground (Pit, quarry etc) 1993	A12SE (W)	517	-	366411 426338
116	Potentially Infilled L Bearing Ref: Use: Date of Mapping:	and (Non-Water) NW Unknown Filled Ground (Pit, quarry etc) 1993	A12NE (NW)	584	-	366438 426684

LANDMARK INFORMATION GROUP*

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
117	Potentially Infilled Land (Non-Water) Bearing Ref: NW Use: Unknown Filled Ground (Pit, quarry etc) Date of Mapping: 1993	A17SE (NW)	631	-	366426 426753
118	Potentially Infilled Land (Non-Water) Bearing Ref: W Use: Unknown Filled Ground (Pit, quarry etc) Date of Mapping: 1993	A12SW (W)	652	-	366286 426228
119	Potentially Infilled Land (Non-Water) Bearing Ref: E Use: Unknown Filled Ground (Pit, quarry etc) Date of Mapping: 1993	A14SE (E)	781	-	367773 426284
120	Potentially Infilled Land (Non-Water) Bearing Ref: E Use: Unknown Filled Ground (Pit, quarry etc) Date of Mapping: 1993	A14SE (E)	829	-	367821 426272
121	Potentially Infilled Land (Non-Water) Bearing Ref: E Use: Unknown Filled Ground (Pit, quarry etc) Date of Mapping: 1993	A14NE (E)	888	-	367884 426413
122	Potentially Infilled Land (Non-Water) Bearing Ref: N Use: Unknown Filled Ground (Pit, quarry etc) Date of Mapping: 1993	A18NE (N)	900	-	367130 427275
123	Potentially Infilled Land (Non-Water) Bearing Ref: S Use: Unknown Filled Ground (Pit, quarry etc) Date of Mapping: 1993	A8SE (S)	921	-	367162 425421
124	Potentially Infilled Land (Non-Water) Bearing Ref: SW Use: Unknown Filled Ground (Pit, quarry etc) Date of Mapping: 1993	A7NW (SW)	961	-	366176 425749
125	Potentially Infilled Land (Non-Water) Bearing Ref: E Use: Unknown Filled Ground (Pit, quarry etc) Date of Mapping: 1993	A14SE (E)	963	-	367952 426242
126	Potentially Infilled Land (Non-Water) Bearing Ref: E Use: Unknown Filled Ground (Pit, quarry etc) Date of Mapping: 1993	A9NE (E)	977	-	367905 426000
127	Potentially Infilled Land (Non-Water) Bearing Ref: E Use: Unknown Filled Ground (Pit, quarry etc) Date of Mapping: 1993	A14SE (E)	979	-	367964 426209
128	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1849	A13SW (SW)	0	-	366957 426350
129	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1849	A13NW (W)	18	-	366916 426369
130	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1894	A13SW (SW)	79	-	366908 426270
131	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1913 Potentially Infilled Land (Water)	A13NW (N)	110	-	366947 426504
132	Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1894 Potentially Infilled Land (Water)	A13NE (NE)	155	-	367038 426522
133	Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1956 Potentially Infilled Land (Water)	A13SW (S)	215	-	366895 426129
134	Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1956	A13SW (S)	250	-	366899 426091

LANDMARK INFORMATION GROUP*

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	Potentially Infilled Land (Water)				
135	Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1894	A13NE (E)	263	-	367260 426360
136	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1849	A13NW (NW)	308	-	366785 426656
137	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1938	A18SW (N)	312	-	366954 426705
138	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1956	A13SE (SE)	320	-	367162 426060
139	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1894	A8NW (S)	325	-	366901 426012
140	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1956	A8NW (S)	329	-	366928 426002
141	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1894	A13NE (NE)	359	-	367216 426655
142	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1894	A13NW (NW)	368	-	366734 426694
143	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1894	A12NE (NW)	368	-	366623 426575
144	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1894	A18SW (NW)	374	-	366764 426720
145	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1894	A14NW (NE)	390	-	367324 426580
146	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1849	A18SE (NE)	409	-	367141 426754
147	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1894	A14NW (NE)	430	-	367377 426568
148	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1849	A12SE (W)	442	-	366502 426228
149	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1894	A18SE (N)	454	-	367072 426830
150	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1849	A18SE (N)	465	-	366964 426858
151	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1849	A12SE (W)	492	-	366437 426314
152	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1849	A18SW (NW)	511	-	366655 426814
153	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1849	A18SW (NW)	513	-	366680 426832
154	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1894	A18SE (N)	513	-	366967 426907
155	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1956	A8NW (S)	538	-	366813 425815

LANDMARK INFORMATION GROUP*

Waste

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	Potentially Infilled Land (Water)				
156	Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1849	A18SE (NE)	547	-	367224 426869
157	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1849	A14NW (NE)	559	-	367471 426664
158	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1913	A18SW (NW)	562	-	366673 426884
159	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1894	A14NW (E)	570	-	367566 426393
160	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1956	A19SW (NE)	571	-	367326 426837
161	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1938	A18SW (NW)	572	-	366656 426886
162	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1849	A8NE (S)	587	-	367161 425766
163	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1956	A17SE (NW)	601	-	366540 426837
164	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1894	A8NW (S)	621	-	366862 425716
165	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1849	A19SW (NE)	645	-	367349 426910
166	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1894	A18NW (N)	646	-	366960 427039
167	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1849	A19SW (NE)	666	-	367463 426845
168	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1849	A14SW (E)	671	-	367627 426134
169	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1956	A8SW (S)	697	-	366768 425663
170	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1894	A9NW (SE)	705	-	367595 425975
171	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1894	A9NW (SE)	707	-	367577 425941
172	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1956	A8SE (S)	718	-	367107 425618
173	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1849	A19SW (NE)	727	-	367368 426996
174	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1956	A8SE (S)	739	-	367068 425591
175	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1956	A8SW (S)	764	-	366750 425598
176	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1849	A7NE (SW)	770	-	366290 425915

Date: 25-Oct-2017

rpr_ec_datasheet v53.0

A Landmark Information Group Service

LANDMARK INFORMATION GROUP*

Waste

Map ID	Details		Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	Potentially Infilled La	and (Water)				
177	Use: Date of Mapping:	Unknown Filled Ground (Pond, marsh, river, stream, dock etc) 1849	A19SE (NE)	773	-	367657 426771
178	Potentially Infilled La Use: Date of Mapping:	and (Water) Unknown Filled Ground (Pond, marsh, river, stream, dock etc) 1849	A18NE (N)	826	-	367119 427202
179	Potentially Infilled La Use: Date of Mapping:	and (Water) Unknown Filled Ground (Pond, marsh, river, stream, dock etc) 1849	A18NE (N)	850	-	367144 427220
180	Potentially Infilled La Use: Date of Mapping:	and (Water) Unknown Filled Ground (Pond, marsh, river, stream, dock etc) 1894	A17NE (NW)	881	-	366552 427181
181	Potentially Infilled La Use: Date of Mapping:	and (Water) Unknown Filled Ground (Pond, marsh, river, stream, dock etc) 1913	A7NW (SW)	902	-	366190 425828
182	Potentially Infilled La Use: Date of Mapping:	and (Water) Unknown Filled Ground (Pond, marsh, river, stream, dock etc) 1849	A7NW (SW)	909	-	366267 425722
183	Potentially Infilled La Use: Date of Mapping:	and (Water) Unknown Filled Ground (Pond, marsh, river, stream, dock etc) 1913	A14SE (E)	912	-	367866 426091
184		and (Water) Unknown Filled Ground (Pond, marsh, river, stream, dock etc) 1956	A9NE (SE)	915	-	367677 425728
185	Potentially Infilled La Use: Date of Mapping:	and (Water) Unknown Filled Ground (Pond, marsh, river, stream, dock etc) 1849	A19SE (NE)	930	-	367718 426956
186	Potentially Infilled La Use: Date of Mapping:	and (Water) Unknown Filled Ground (Pond, marsh, river, stream, dock etc) 1913	A12SW (W)	953	-	365975 426342
187	Potentially Infilled La Use: Date of Mapping:	and (Water) Unknown Filled Ground (Pond, marsh, river, stream, dock etc) 1956	A9NE (SE)	956	-	367753 425758
188	Potentially Infilled La Use: Date of Mapping:	and (Water) Unknown Filled Ground (Pond, marsh, river, stream, dock etc) 1849	A12SW (W)	968	-	366006 426053
189	Potentially Infilled La Use: Date of Mapping:	and (Water) Unknown Filled Ground (Pond, marsh, river, stream, dock etc) 1894	A14SE (E)	971	-	367956 426217
190	Potentially Infilled La Use: Date of Mapping:	and (Water) Unknown Filled Ground (Pond, marsh, river, stream, dock etc) 1849	A12SW (W)	977	-	365988 426082
191	Licence Reference: Site Location: Operator Location: Authority: Site Category: Max Input Rate: Waste Source Restrictions: Licence Status: Dated: Preceded By Licence: Superseded By Licence:	T P K Smith	A19SW (NE)	715	2	367630 426700
	Boundary Quality: Authorised Waste	Manually positioned to the address of location Not Supplied Max.Storage In Licence Waste Paint Waste With Flash Pt. < 21 C				

LANDMARK INFORMATION GROUP*

Waste

Map ID		Details			Contact	NGR
	Registered Waste T	egistered Waste Treatment or Disposal Sites				
192	Licence Holder: Licence Reference: Site Location: Authority: Site Category: Max Input Rate: Waste Source Restrictions: Licence Status: Dated: Preceded By Licence: Superseded By Licence: Positional Accuracy: Boundary Quality: Authorised Waste	T Lethbridge Ltd L 614 Queen Victoria Street, Mill Hill, Blackburn, Lancashire Greenbank Works, Gorse Street, BLACKBURN, Lancashire, BB1 3EU Environment Agency - North West Region, Central Area Scrapyard - with Transfer Station Medium (Equal to or greater than 25,000 and less than 75,000 tonnes per year) No known restriction on source of waste Operational as far as is knownOperational 29th December 1994 Not Given Manually positioned to the road within the address or location Not Supplied Asbestos In All Forms Cement/Plasterboard/Plaster Ferrous Metal Scrap Foundry Sand Glass, Slate, Concrete, Brick, Ceramic Max.Waste Permitted By Licence Metal Swarf Non-Ferrous Metal Scrap Non-Haz. Metals Paper Pulp Paper/Cardboard Rubber Scrap Vehicles/Assoc.Parts Shavings/Sawdust Solid Fully Polymerised Plastics Tarmacadam Textiles/Fibres - Nat'L/Mam-Made Timber/Prods Treated/Untreat Incl. Uncontam. Plastic Drums Uncontam.Soli, Clay, Nat'L Sand, Rock Vegetable Matter Clinical Wastes	A18SE (N)	410	2	367000 426800
		Liquid Wastes Waste N.O.S Whether/Not Pack./Pre-Trt				

LANDMARK INFORMATION GROUP*

Map ID	Details		Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	BGS 1:625,000 Soli	d Geology				
	Description:	Pennine Lower Coal Measures Formation And South Wales Lower Coal Measures Formation (Undifferentiated)	A13SE (N)	0	1	366963 426359
	BGS Estimated Soil Source: Soil Sample Type: Arsenic Concentration: Cadmium Concentration: Chromium Concentration: Lead Concentration: Nickel	British Geological Survey, National Geoscience Information Service Rural Soil and Sediment <15 mg/kg <1.8 mg/kg 60 - 90 mg/kg	A13SW (SW)	0	1	366940 426341
	Concentration: BGS Estimated Soil Source: Soil Sample Type: Arsenic Concentration: Cadmium Concentration: Chromium Concentration: Lead Concentration: Nickel Concentration:	British Geological Survey, National Geoscience Information Service Rural Soil and Sediment <15 mg/kg <1.8 mg/kg 90 - 120 mg/kg	A13SE (N)	0	1	366963 426359
	BGS Estimated Soil Source: Soil Sample Type: Arsenic Concentration: Cadmium Concentration: Chromium Concentration: Lead Concentration: Nickel Concentration:	British Geological Survey, National Geoscience Information Service Rural Soil and Sediment <15 mg/kg <1.8 mg/kg 60 - 90 mg/kg	A13NW (NW)	140	1	366831 426476
	BGS Estimated Soil Source: Soil Sample Type: Arsenic Concentration: Cadmium Concentration: Chromium Concentration: Lead Concentration: Nickel Concentration:	British Geological Survey, National Geoscience Information Service Rural Soil and Sediment <15 mg/kg <1.8 mg/kg 60 - 90 mg/kg	A8NE (SE)	359	1	367169 426017
	BGS Estimated Soil Source: Soil Sample Type: Arsenic Concentration: Cadmium Concentration: Chromium Concentration: Lead Concentration: Nickel Concentration:	British Geological Survey, National Geoscience Information Service Rural Soil and Sediment 15 - 25 mg/kg <1.8 mg/kg 60 - 90 mg/kg	A13NE (NE)	361	1	367218 426655
	BGS Estimated Soil Source: Soil Sample Type: Arsenic Concentration: Cadmium Concentration: Chromium Concentration: Lead Concentration: Nickel Concentration:	British Geological Survey, National Geoscience Information Service Rural Soil and Sediment <15 mg/kg <1.8 mg/kg 60 - 90 mg/kg	A13NW (NW)	363	1	366688 426650

LANDMARK INFORMATION GROUP*

Map ID	Details		Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	BGS Estimated Soil	Chemistry				
	Source: Soil Sample Type: Arsenic Concentration:	British Geological Survey, National Geoscience Information Service Rural Soil and Sediment 15 - 25 mg/kg	A8NE (SE)	493	1	367260 425917
	Cadmium Concentration: Chromium Concentration:	<1.8 mg/kg 60 - 90 mg/kg				
	Lead Concentration: Nickel Concentration:	<100 mg/kg 15 - 30 mg/kg				
	BGS Estimated Soil	Chemistry				
	Source: Soil Sample Type: Arsenic Concentration: Cadmium	British Geological Survey, National Geoscience Information Service Rural Soil and Sediment 15 - 25 mg/kg <1.8 mg/kg	A8NE (SE)	495	1	367278 425927
	Concentration: Chromium Concentration:	90 - 120 mg/kg				
	Lead Concentration: Nickel Concentration:	<100 mg/kg 15 - 30 mg/kg				
	BGS Estimated Soil	Chemistry				
	Source: Soil Sample Type: Arsenic Concentration:	British Geological Survey, National Geoscience Information Service Rural Soil and Sediment 15 - 25 mg/kg	A12SE (SW)	553	1	366450 426069
	Cadmium Concentration: Chromium	<1.8 mg/kg 60 - 90 mg/kg				
	Concentration: Lead Concentration: Nickel Concentration:					
	BGS Estimated Soil Source: Soil Sample Type:	Chemistry British Geological Survey, National Geoscience Information Service Rural Soil and Sediment	A12NE (W)	555	1	366376 426402
	Arsenic Concentration: Cadmium	15 - 25 mg/kg <1.8 mg/kg				
	Concentration: Chromium Concentration:	90 - 120 mg/kg				
	Lead Concentration: Nickel Concentration:	<100 mg/kg 15 - 30 mg/kg				
	BGS Estimated Soil	Chemistry				
	Source: Soil Sample Type: Arsenic Concentration: Cadmium	British Geological Survey, National Geoscience Information Service Rural Soil and Sediment 15 - 25 mg/kg <1.8 mg/kg	A12SE (SW)	555	1	366455 426056
	Concentration: Chromium	90 - 120 mg/kg				
	Concentration: Lead Concentration: Nickel Concentration:	<100 mg/kg 15 - 30 mg/kg				
	BGS Estimated Soil					
	Source: Soil Sample Type: Arsenic Concentration:	British Geological Survey, National Geoscience Information Service Rural Soil and Sediment 15 - 25 mg/kg	A12SE (SW)	561	1	366413 426124
	Cadmium Concentration:	<1.8 mg/kg				
	Chromium Concentration: Lead Concentration:					
	Nickel Concentration:	15 - 30 mg/kg				

LANDMARK INFORMATION GROUP*

Map ID	Details		Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	BGS Estimated Soil	Chemistry				
	Source: Soil Sample Type: Arsenic Concentration:	British Geological Survey, National Geoscience Information Service Rural Soil and Sediment <15 mg/kg	A17SE (NW)	571	1	366505 426758
	Cadmium Concentration: Chromium	<1.8 mg/kg 90 - 120 mg/kg				
	Concentration: Lead Concentration: Nickel Concentration:	<100 mg/kg 15 - 30 mg/kg				
	BGS Estimated Soil	Chemistry				
	Source: Soil Sample Type: Arsenic Concentration: Cadmium	British Geological Survey, National Geoscience Information Service Rural Soil and Sediment 15 - 25 mg/kg <1.8 mg/kg	A18SW (N)	609	1	366904 427000
	Concentration: Chromium Concentration:	90 - 120 mg/kg				
	Lead Concentration: Nickel Concentration:	<100 mg/kg 15 - 30 mg/kg				
	BGS Estimated Soil	Chemistry				
	Source: Soil Sample Type: Arsenic Concentration:	British Geological Survey, National Geoscience Information Service Rural Soil and Sediment 15 - 25 mg/kg	A18SE (N)	609	1	367000 427000
	Cadmium Concentration: Chromium	1.8 - 2.2 mg/kg 60 - 90 mg/kg				
	Concentration: Lead Concentration: Nickel Concentration:					
	BGS Estimated Soil Source: Soil Sample Type: Arsenic	British Geological Survey, National Geoscience Information Service Rural Soil and Sediment <15 mg/kg	A12SE (SW)	617	1	366395 426035
	Concentration: Cadmium Concentration:	<1.8 mg/kg				
	Chromium Concentration: Lead Concentration:	60 - 90 mg/kg				
	Nickel Concentration:	15 - 30 mg/kg				
	BGS Estimated Soil	Chemistry				
	Source: Soil Sample Type: Arsenic Concentration:	British Geological Survey, National Geoscience Information Service Rural Soil and Sediment <15 mg/kg	A12SE (W)	624	1	366331 426164
	Cadmium Concentration: Chromium	<1.8 mg/kg 90 - 120 mg/kg				
	Concentration: Lead Concentration: Nickel Concentration:	<100 mg/kg 15 - 30 mg/kg				
		Chamister				
	BGS Estimated Soil Source: Soil Sample Type: Arsenic	British Geological Survey, National Geoscience Information Service Rural Soil and Sediment 15 - 25 mg/kg	A14NW (E)	644	1	367619 426538
	Concentration: Cadmium Concentration:	<1.8 mg/kg				
	Chromium Concentration: Lead Concentration:					
	Nickel Concentration:	15 - 30 mg/kg				

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	BGS Estimated Soil	Chemistry				
	Source: Soil Sample Type: Arsenic Concentration:	British Geological Survey, National Geoscience Information Service Rural Soil and Sediment <15 mg/kg	A14NW (E)	646	1	367630 426499
	Cadmium Concentration: Chromium	<1.8 mg/kg 90 - 120 mg/kg				
	Concentration: Lead Concentration: Nickel Concentration:					
	BGS Estimated Soil	Chemistry				
	Source: Soil Sample Type: Arsenic Concentration: Cadmium Concentration: Chromium Concentration: Lead Concentration: Nickel Concentration:	British Geological Survey, National Geoscience Information Service Rural Soil and Sediment 15 - 25 mg/kg <1.8 mg/kg 90 - 120 mg/kg	A12NE (NW)	655	1	366355 426682
	BGS Estimated Soil Source: Soil Sample Type: Arsenic Concentration: Cadmium Concentration: Chromium Concentration: Lead Concentration: Nickel Concentration:	British Geological Survey, National Geoscience Information Service Rural Soil and Sediment <15 mg/kg <1.8 mg/kg 60 - 90 mg/kg	A12SW (W)	686	1	366251 426239
	Concentration.					
	BGS Estimated Soil Source: Soil Sample Type:	British Geological Survey, National Geoscience Information Service Rural Soil and Sediment	A14NE (E)	688	1	367683 426423
	Arsenic Concentration: Cadmium Concentration:	<15 mg/kg <1.8 mg/kg				
	Chromium Concentration: Lead Concentration: Nickel	60 - 90 mg/kg <100 mg/kg 15 - 30 mg/kg				
	Concentration:					
	BGS Estimated Soil Source: Soil Sample Type: Arsenic Concentration: Cadmium Concentration: Chromium Concentration:	Chemistry British Geological Survey, National Geoscience Information Service Rural Soil and Sediment 15 - 25 mg/kg <1.8 mg/kg 60 - 90 mg/kg	A14NE (E)	693	1	367678 426495
	Lead Concentration: Nickel Concentration:	<100 mg/kg 15 - 30 mg/kg				
	BGS Estimated Soil	Chemistry				
	Source: Soil Sample Type: Arsenic Concentration: Cadmium	British Geological Survey, National Geoscience Information Service Rural Soil and Sediment 15 - 25 mg/kg 1.8 - 2.2 mg/kg	A18NE (NE)	745	1	367281 427060
	Concentration: Chromium Concentration: Lead Concentration:	90 - 120 mg/kg 100 - 200 mg/kg				
	Nickel Concentration:	15 - 30 mg/kg				

LANDMARK INFORMATION GROUP*

Map ID	Details		Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	BGS Estimated Soil	Chomistry				
	Source: Soil Sample Type: Arsenic Concentration:	British Geological Survey, National Geoscience Information Service Rural Soil and Sediment <15 mg/kg	A14NE (NE)	765	1	367696 426679
	Cadmium Concentration: Chromium	<1.8 mg/kg 60 - 90 mg/kg				
	Concentration: Lead Concentration: Nickel Concentration:					
	BGS Estimated Soil	Chemistry				
	Source: Soil Sample Type: Arsenic Concentration: Cadmium Concentration: Chromium Concentration: Lead Concentration:	British Geological Survey, National Geoscience Information Service Rural Soil and Sediment <15 mg/kg <1.8 mg/kg 90 - 120 mg/kg	A14NE (NE)	768	1	367694 426689
	Nickel Concentration:	15 - 30 mg/kg				
	BGS Estimated Soil	Chemistry				
	Source: Soil Sample Type: Arsenic Concentration: Cadmium	British Geological Survey, National Geoscience Information Service Rural Soil and Sediment <15 mg/kg <1.8 mg/kg	A9SW (SE)	811	1	367463 425671
	Concentration: Chromium Concentration:	90 - 120 mg/kg				
	Lead Concentration: Nickel Concentration:	<100 mg/kg 15 - 30 mg/kg				
	BGS Estimated Soil	Chemistry				
	Source: Soil Sample Type: Arsenic Concentration:	British Geological Survey, National Geoscience Information Service Rural Soil and Sediment <15 mg/kg	A8SW (S)	897	1	366866 425436
	Cadmium Concentration: Chromium	<1.8 mg/kg 90 - 120 mg/kg				
	Concentration: Lead Concentration: Nickel					
	Concentration:					
	BGS Estimated Soil Source: Soil Sample Type: Arsenic Concentration:	British Geological Survey, National Geoscience Information Service Rural Soil and Sediment 15 - 25 mg/kg	A18NE (N)	937	1	367135 427311
	Cadmium Concentration: Chromium	1.8 - 2.2 mg/kg 90 - 120 mg/kg				
	Concentration: Lead Concentration: Nickel Concentration:	100 - 200 mg/kg 15 - 30 mg/kg				
	BGS Estimated Soil	Chemistry				
	Source: Soil Sample Type: Arsenic Concentration:	British Geological Survey, National Geoscience Information Service Rural Soil and Sediment 15 - 25 mg/kg	A17NE (NW)	948	1	366441 427196
	Cadmium Concentration:	<1.8 mg/kg				
	Chromium Concentration: Lead Concentration:					
	Nickel Concentration:	15 - 30 mg/kg				

LANDMARK INFORMATION GROUP*

Map ID		Details		Estimated Distance From Site	Contact	NGR
	BGS Estimated Soil	l Chemistry				
	Source: Soil Sample Type: Arsenic Concentration:	British Geological Survey, National Geoscience Information Service Rural Soil and Sediment 15 - 25 mg/kg	A7NW (SW)	968	1	366057 425925
	Cadmium Concentration:	<1.8 mg/kg				
	Chromium Concentration:	90 - 120 mg/kg				
	Lead Concentration: Nickel Concentration:	<100 mg/kg 15 - 30 mg/kg				
	BGS Estimated Soil	Chemistry				
	Source: Soil Sample Type: Arsenic Concentration:	British Geological Survey, National Geoscience Information Service Rural Soil and Sediment 15 - 25 mg/kg	A9SW (SE)	973	1	367500 425500
	Cadmium Concentration:	<1.8 mg/kg				
	Chromium Concentration:	60 - 90 mg/kg				
	Lead Concentration: Nickel	100 - 200 mg/kg 15 - 30 mg/kg				
	Concentration:	Chamiatan				
	BGS Estimated Soil Source: Soil Sample Type: Arsenic Concentration:	Chemistry British Geological Survey, National Geoscience Information Service Rural Soil and Sediment <15 mg/kg	A19SE (NE)	985	1	367754 427000
	Cadmium Concentration:	1.8 - 2.2 mg/kg				
	Chromium Concentration:	90 - 120 mg/kg				
	Lead Concentration: Nickel Concentration:	100 - 200 mg/kg 15 - 30 mg/kg				
	BGS Recorded Mine	eral Sites				
193	Site Name: Location: Source: Reference: Type: Status: Operator: Operator Location: Periodic Type: Geology: Commodity: Positional Accuracy:	Mill Hill Brick & Tile Works , Mill Hill, Blackburn, Lancashire British Geological Survey, National Geoscience Information Service 15226 Opencast Ceased Not Supplied Not Supplied Carboniferous Pennine Lower Coal Measures Formation Common Clay and Shale Located by supplier to within 10m	A14NW (E)	336	1	367315 426475
	BGS Recorded Mine	eral Sites				
194		Red Scar Delf , Blackburn, Lancashire British Geological Survey, National Geoscience Information Service 93503 Opencast Ceased Not Supplied Not Supplied Carboniferous Milnrow Sandstone Sandstone Located by supplier to within 10m	A17SE (NW)	578	1	366475 426731
105	BGS Recorded Mine		A17SW	012	1	366336
195	Site Name: Location: Source: Reference: Type: Status: Operator: Operator Location: Periodic Type: Geology: Commodity: Positional Accuracy:	Feniscliffe , Blackburn, Lancashire British Geological Survey, National Geoscience Information Service 93502 Opencast Ceased Not Supplied Not Supplied Quaternary Glaciofluvial Deposits, Devensian Sand Located by supplier to within 10m	A1/SW (NW)	813	1	366236 426793
	BGS Measured Urba	an Soil Chemistry				

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	BGS Urban Soil Ch	emistry Averages				
	No data available					
	Coal Mining Affecte	ed Areas				
	Description:	In an area which may be affected by coal mining activity. It is recommended that a coal mining report is obtained from the Coal Authority. Contact details are included in the Useful Contacts section of this report.	A13SE (N)	0	6	366963 426359
	Mining Instability					
	Mining Evidence: Source: Boundary Quality:	Inconclusive Coal Mining Ove Arup & Partners As Supplied	A13SE (N)	0	-	366963 426359
	Non Coal Mining Ar	reas of Great Britain				
	No Hazard					
	Potential for Collap	sible Ground Stability Hazards				
	Hazard Potential: Source:	Very Low British Geological Survey, National Geoscience Information Service	A13SE (N)	0	1	366963 426359
	Potential for Comp	ressible Ground Stability Hazards				
	Hazard Potential: Source:	No Hazard British Geological Survey, National Geoscience Information Service	A13SE (N)	0	1	366963 426359
	Potential for Groun	d Dissolution Stability Hazards				
	Hazard Potential: Source:	No Hazard British Geological Survey, National Geoscience Information Service	A13SE (N)	0	1	366963 426359
	Potential for Lands	lide Ground Stability Hazards				
	Hazard Potential: Source:	Very Low British Geological Survey, National Geoscience Information Service	A13SE (N)	0	1	366963 426359
	Potential for Runni	ng Sand Ground Stability Hazards				
	Hazard Potential: Source:	Very Low British Geological Survey, National Geoscience Information Service	A13SE (N)	0	1	366963 426359
	Potential for Shrink	ing or Swelling Clay Ground Stability Hazards				
	Hazard Potential: Source:	Very Low British Geological Survey, National Geoscience Information Service	A13SE (N)	0	1	366963 426359
	Radon Potential - R	adon Affected Areas				
	Affected Area: Source:	The property is in a Lower probability radon area (less than 1% of homes are estimated to be at or above the Action Level).	A13SE (N)	0	1	366963 426359
		British Geological Survey, National Geoscience Information Service				
		adon Protection Measures	A13SE	0	1	366963
	Source:	No radon protective measures are necessary in the construction of new dwellings or extensions British Geological Survey, National Geoscience Information Service	(N)		I	426359

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
196	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries S P Fabrications Ltd Unit 2,3,Pioneer Business Centre,Mill Hill, Blackburn, Lancashire, BB2 4PG Sheet Metal Work Inactive Manually positioned within the geographical locality	A13SW (W)	0	-	366949 426356
196	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries S R Tubular Systems Unit 1, Pioneer Mill, Kelly Street, BLACKBURN, BB2 4PG Office Furniture & Equipment Inactive Automatically positioned to the address	A13SW (S)	13	-	366951 426323
197	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Laundry Smart 51, New Wellington Street, Blackburn, BB2 4HA Dry Cleaners Active Automatically positioned to the address	A13SE (E)	104	-	367100 426347
198	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Rda Mobile Vehicle Servicing 8, Kings Bridge Close, Blackburn, BB2 4RY Garage Services Inactive Automatically positioned to the address	A13SW (W)	115	-	366814 426330
199	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries H Light Haulage Ltd 14, Moorgate Street, Blackburn, BB2 4EZ Road Haulage Services Active Automatically positioned to the address	A13NE (E)	116	-	367104 426412
199	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Blackburn Services 173, St. Aidans Avenue, Blackburn, BB2 4EA Oven cleaning Inactive Automatically positioned to the address	A13NE (NE)	117	-	367083 426448
200	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Keith Jones 46, New Wellington Street, Blackburn, BB2 4HA Garage Services Inactive Automatically positioned to the address	A13SE (E)	149	-	367135 426310
201	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Restlay Ltd Moorgate Mill, Moorgate Street, Blackburn, BB2 4NZ Furniture Manufacturers - Home & Office Inactive Automatically positioned to the address	A13SE (SE)	149	-	367039 426187
201	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Rosehill Leather Collection Moorgate Mill, Moorgate Street, Blackburn, BB2 4NZ Upholstery Manufacturers Inactive Automatically positioned to the address	A13SE (SE)	149	-	367039 426187
202	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Cash For Clothes Blackburn 7, New Chapel Street, Blackburn, BB2 4DT Reclaiming - Waste Products Active Automatically positioned to the address	A13NW (N)	196	-	366949 426589
202	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries The Washbowl Launderettes 1, New Chapel Street, Blackburn, BB2 4DT Laundries & Launderettes Inactive Automatically positioned to the address	A13NW (N)	212	-	366950 426605
202	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries The Washbowl 1, New Chapel Street, Blackburn, BB2 4DT Dry Cleaners Inactive Automatically positioned to the address	A13NW (N)	212	-	366950 426605

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
202	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Mill Hill Car Cntr Ltd Parkinson St, Blackburn, Lancashire, BB2 4BY Car Dealers - Used Inactive Manually positioned within the geographical locality	A13NE (N)	230	-	366997 426618
203	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Chemical Blacking Ltd 1-11, Grantham Street, Blackburn, BB2 4BZ Coating Specialists Inactive Automatically positioned to the address	A13NW (N)	210	-	366884 426593
204	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Pass & Company Ltd 83a, Shorrock Lane, Blackburn, BB2 4DA Testing, Inspection & Calibration Equipment Manufacturers Inactive Automatically positioned to the address	A13NW (W)	263	-	366675 426419
205	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Station Tyres Parkinson Street, Blackburn, BB2 4BY Garage Services Inactive Automatically positioned to the address	A13NE (N)	268	-	367011 426654
205	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Station Garage Parkinson Street, BLACKBURN, BB2 4BY Garage Services Inactive Automatically positioned to the address	A13NE (N)	268	-	367011 426654
206	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries J H Mackereth 36, Bonsall Street, Blackburn, BB2 4DB Garage Services Active Automatically positioned to the address	A13NW (NW)	286	-	366717 426567
207	Contemporary Trad Name: Location: Classification: Status:		A13NE (N)	292	-	367066 426660
207	Contemporary Trad Name: Location: Classification: Status:		A13NE (N)	300	-	367076 426664
208	Contemporary Trad Name: Location: Classification: Status:		A12NE (W)	334	-	366618 426475
209	Contemporary Trad Name: Location: Classification: Status:		A8NE (S)	337	-	367017 425990
210	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Polymet Ltd Slater Street, Blackburn, BB2 4LY Metal Finishing Services Active Automatically positioned to the address	A13SE (SE)	339	-	367249 426114
210	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Verifyne Plastic Products Ltd Lever Mill, Slater Street, Blackburn, BB2 4PA Plastics - Injection Moulding Active Automatically positioned to the address	A13SE (SE)	343	-	367277 426148

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
211		loulds ck Lane, Blackburn, BB2 4PS lanufacturers, Supplies & Services	A12SE (W)	340	-	366589 426314
212	Location: Bonsall St Classification: Meat - Wh Status: Inactive	lon & Co Ltd , Blackburn, Lancashire, BB2 4DD	A12NE (NW)	351	-	366624 426540
213		rs ry Street, Blackburn, BB2 4PT ıfacturers - Domestic	A12NE (W)	367	-	366562 426377
214	Location: Primrose I Classification: Road Hau Status: Active	Entries Id Haulage Services Aill,Slater Street, Blackburn, Lancashire, BB2 4LY age Services vositioned within the geographical locality	A13SE (SE)	386	-	367294 426096
215	Contemporary Trade Directory Name: Unit 3 Eng Location: Parkinson Classification: Engineers Status: Active Positional Accuracy: Automatic	ineering Street, Blackburn, BB2 4ET - General	A18SE (NE)	389	-	367204 426699
215		nill Hill Engineering Ltd ik Works, Albert Street, Blackburn, BB2 4BL - General	A13NE (NE)	391	-	367273 426646
215		Groom Ltd y Warehouse, Parkinson Street, Blackburn, BB2 4ET inufacturers	A13NE (NE)	399	-	367241 426685
215	Contemporary Trade Directory Name: T & M Eng Location: Parkinson Classification: Precision Status: Inactive Positional Accuracy: Automatic	ineering Street, Blackburn, BB2 4ET Engineers	A13NE (NE)	399	-	367242 426685
215		epair Shop ert Street, Blackburn, Lancashire, BB2 4BL ervices	A13NE (NE)	411	-	367274 426674
215	Classification: Fascias an Status: Inactive	Windows rt Street, Blackburn, Lancashire, BB2 4BL	A13NE (NE)	412	-	367274 426674
216	Contemporary Trade Directory Name: Total Stop Location: Blackburn Classification: Damp & D Status: Active Positional Accuracy: Automatic	Damp BB2 4LY ry Rot Control	A14SW (SE)	398	-	367343 426152
217	Classification: Door Man Status: Inactive		A12SE (SW)	402	-	366571 426163

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
217	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Bob Wright 108, Shorrock Lane, Blackburn, BB2 4TT Wrought Ironwork Inactive Automatically positioned to the address	A12SE (SW)	412	-	366555 426172
218	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Shaun Millbank Unit 5 Reeds Farm,Cow Watering Lane, Writtle, Chelmsford, Essex, CM1 3SB Garage Services Active Manually positioned within the geographical locality	A13NE (NE)	408	-	367299 426643
218	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Bob Hodkinson Spring Bank Works, Albert Street, Blackburn, BB2 4BL Garage Services Inactive Automatically positioned to the address	A13NE (NE)	408	-	367299 426643
218	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Hazelhurst Supplies Unit 2,Albert St, Blackburn, Lancashire, BB2 4BL Plastic Products - Manufacturers Inactive Manually positioned to the road within the address or location	A14NW (NE)	428	-	367318 426652
218	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Bob Hodkinson Garage Albert Street, Blackburn, Lancashire, BB2 4BL Garage Services Active Manually positioned to the road within the address or location	A14NW (NE)	433	-	367307 426671
218	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Pfd Motortune Parkside Units,Albert St, Blackburn, Lancashire, BB2 4BL Garage Services Inactive Manually positioned to the road within the address or location	A13NE (NE)	435	-	367296 426686
219	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Seddon Bonsall St, Blackburn, Lancashire, BB2 4DD Meat - Wholesale Inactive Manually positioned to the road within the address or location	A12NE (W)	424	-	366540 426526
219	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Pagey'S Cleaning 81, Bonsall Street, Blackburn, BB2 4DD Cleaning Services - Domestic Inactive Automatically positioned to the address	A12NE (W)	430	-	366530 426512
220	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Blackburn & Darwen Appliance Centre 140, Livesey Branch Road, Blackburn, BB2 4NB Domestic Appliances - Servicing, Repairs & Parts Inactive Automatically positioned to the address	A8NE (SE)	428	-	367202 425957
221	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Read Motor Body Commercials Queen Victoria St, Blackburn, Lancashire, BB2 2QG Commercial Vehicle Bodybuilders & Repairers Inactive Manually positioned to the road within the address or location	A18SE (N)	434	-	366978 426826
221	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries M D A Associates Ltd Warehouse,Waterfall Mill,Queen Victoria St, Blackburn, Lancashire, BB2 2QG Distribution Services Inactive Manually positioned to the address or location	A18SE (N)	442	-	366982 426834
221	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries North West Containers Ltd Unit 3, Waterfall Mill, Queen Victoria Street, Blackburn, BB2 2QG Recycling Services Active Automatically positioned to the address	A18SE (N)	443	-	366983 426835

LANDMARK INFORMATION GROUP*

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
221	Contemporary Trade Directory Entries Name: Tdk Architectural Hardware Ltd Location: Unit 5, Waterfall Mill, Queen Victoria Street, Blackburn, BB2 2QG Classification: Hardware Status: Inactive Positional Accuracy: Automatically positioned to the address	A18SE (N)	443	-	366983 426835
221	Contemporary Trade Directory Entries Name: Plastic Product Services Ltd Location: Unit 3, Waterfall Mill, Queen Victoria Street, Blackburn, BB2 2QG Classification: Plastics - Raw Materials Status: Inactive Positional Accuracy: Automatically positioned to the address	A18SE (N)	443	-	366983 426835
221	Contemporary Trade Directory Entries Name: Amazon Bioguard Ltd Location: Unit 3, Waterfall Mill, Queen Victoria Street, Blackburn, Lancashire, B Classification: Hygiene & Cleansing Services Status: Inactive Positional Accuracy: Automatically positioned to the address	A18SE B2 2QG (N)	443	-	366983 426835
222	Contemporary Trade Directory Entries Name: C V P Location: Neales Yard,Queen Victoria St, Blackburn, Lancashire, BB2 2QG Classification: Commercial Vehicle Bodybuilders & Repairers Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A18SW (N)	466	-	366916 426858
223	Contemporary Trade Directory Entries Name: C T Trade Dies Ltd Location: Unit 1, Parkside, Albert Street, Blackburn, BB2 4BL Classification: Tool Design, Manufacturers & Makers Status: Inactive Positional Accuracy: Automatically positioned to the address	A14NW (NE)	471	-	367344 426688
224	Contemporary Trade Directory Entries Name: Martyns Mica Local Electrical & Hardware Location: 88-90, Livesey Branch Road, Blackburn, BB2 4LU Classification: Electrical Goods Sales, Manufacturers & Wholesalers Status: Inactive Positional Accuracy: Automatically positioned to the address	A14SW (SE)	475	-	367360 426034
224	Contemporary Trade Directory Entries Name: G F Burns Location: 86, Livesey Branch Road, Blackburn, BB2 4LU Classification: Office Equipment Servicing & Maintenance Status: Active Positional Accuracy: Automatically positioned to the address	A14SW (SE)	478	-	367364 426036
225	Contemporary Trade Directory Entries Name: Peugeot Citroen Breakers Location: Unit 4, The Goods Yard, Queen Victoria Street, Blackburn, BB2 2QG Classification: Car Breakers & Dismantlers Status: Inactive Positional Accuracy: Automatically positioned to the address	A18SE (NE)	478	-	367161 426821
226	Contemporary Trade Directory Entries Name: Tower Linen Services Location: Spring Bank Works, Aqueduct Road, Blackburn, BB2 4HT Classification: Laundries & Launderettes Status: Inactive Positional Accuracy: Automatically positioned to the address	A14NW (NE)	507	-	367447 426602
226	Contemporary Trade Directory Entries Name: F J Fabrication Ltd Location: Spring Bank Works, Aqueduct Road, BLACKBURN, BB2 4HT Classification: Gate Manufacturers Status: Active Positional Accuracy: Automatically positioned to the address	A14NW (NE)	507	-	367447 426602
226	Contemporary Trade Directory Entries Name: Tower Linen Ltd Location: Spring Bank Works, Aqueduct Road, Blackburn, Lancashire, BB2 4HT Classification: Laundries & Launderettes Status: Inactive Positional Accuracy: Automatically positioned to the address	A14NW F (NE)	507	-	367447 426602
227	Contemporary Trade Directory Entries Name: Three Arches Garage Location: Unit 1, Dimmock Street, Blackburn, BB2 2QB Classification: Garage Services Status: Active Positional Accuracy: Automatically positioned to the address	A18SE (NE)	509	-	367231 426822

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
227	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Clothes Aid Services Ltd Unit 2, Dimmock Street, BLACKBURN, BB2 2QB Distribution Services Inactive Automatically positioned to the address	A18SE (NE)	514	-	367223 426832
228	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Riverside Products Riverside Ho,Aqueduct Rd, Blackburn, Lancashire, BB2 4HT PVC-U Products - Manufacturers & Suppliers Inactive Manually positioned to the address or location	A14NW (NE)	530	-	367443 426654
229	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Shining House 124, Greenside Avenue, Blackburn, BB2 4TQ Cleaning Services - Domestic Inactive Automatically positioned to the address	A12SE (SW)	544	-	366471 426052
230	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Control Systems Engineering Ltd 11, Baden Terrace, Blackburn, BB2 4LT Electrical Engineers Inactive Automatically positioned to the address	A14SW (SE)	554	-	367475 426069
231	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Star Uretech Ltd Enterprise House, Hollin Bridge Street, BLACKBURN, BB2 4AY Chemical Manufacturers Active Automatically positioned to the address	A19SW (NE)	561	-	367412 426747
232	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries More Polythene Blackburn, BB2 2QU Polythene & Plastic Sheeting Supplies Active Automatically positioned to the address	A18SE (N)	562	-	367049 426945
233	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries A Fraser Plumbing & Heating 52, Heys Lane, Blackburn, BB2 4ND Boilers - Servicing, Replacements & Repairs Active Automatically positioned to the address	A8NE (SE)	584	-	367213 425789
234	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries D R Service & Repairs Ltd Unit 3a, Griffin Mill, Amberley Street, Blackburn, BB2 2QH Plant & Machinery Repairs Inactive Automatically positioned to the address	A18SE (N)	601	-	367140 426963
235	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries M J D Recycling Unit 1, Griffin Mill, Stancliffe Street, Blackburn, BB2 2QU Recycling Services Inactive Automatically positioned to the address	A18SE (N)	603	-	367085 426981
235	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Dutton Carpets Ltd Stancliffe Street, Blackburn, BB2 2QU Carpets & Rugs - Manufacturers Inactive Automatically positioned to the address	A18SE (N)	603	-	367085 426981
235	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Dutton Carpets Stancliffe Street, Blackburn, BB2 2QU Carpets & Rugs - Manufacturers Inactive Automatically positioned to the address	A18SE (N)	603	-	367085 426981
235	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Witton Mill Co Ltd Stancliffe Street, Blackburn, BB2 2QU Textile Manufacturing Inactive Automatically positioned to the address	A18SE (N)	603	-	367085 426981

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
236	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Whittle Bros Coal Merchants Ltd 221, Shorrock Lane, Blackburn, BB2 4TT Coal & Smokeless Fuel Merchants & Distributors Inactive Automatically positioned to the address	A7NE (SW)	604	-	366540 425885
237	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries M A N (Northwest Blackburn) Hollin Bridge St, Blackburn, Lancashire, BB2 4AZ Commercial Vehicle Dealers Inactive Manually positioned to the road within the address or location	A19SW (NE)	631	-	367532 426703
238	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Sexy Curves Plus More 16, Brookway, Blackburn, BB2 4RB Lingerie & Hosiery Manufacturers & Wholesalers Inactive Automatically positioned to the address	A8NW (S)	636	-	366742 425737
239	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Houseproud 10, Honiton Avenue, Blackburn, BB2 4PD Cleaning Services - Domestic Inactive Automatically positioned to the address	A8NE (SE)	644	-	367298 425763
240	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Iddon Hydraulics Ltd Albion Works, Albion Road, Blackburn, BB2 4LJ Hydraulic Equipment & Accessories - Sales & Service Inactive Automatically positioned to the address	A14SW (SE)	650	-	367592 426096
240	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Iddon Psv Parts Albion Works, Albion Road, Blackburn, BB2 4LJ Commercial Vehicle Servicing, Repairs, Parts & Accessories Inactive Automatically positioned to the address	A14SW (SE)	650	-	367592 426096
241	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Progen International Stancliffe St Ind Est, Blackburn, Lancashire, BB2 2QR Food Products - Manufacturers Inactive Manually positioned within the geographical locality	A19SW (NE)	686	-	367310 426981
241	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries S P Fabs Stancliffe St Ind Est, Blackburn, Lancashire, BB2 2QR Sheet Metal Work Inactive Manually positioned within the geographical locality	A19SW (NE)	686	-	367310 426981
241	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Velocity Composites Unit 2, Waterfall Trade Park, Stancliffe Street, Blackburn, BB2 2QD Manufacturers Inactive Automatically positioned to the address	A19SW (NE)	723	-	367355 426998
241	Contemporary Trad Name: Location: Classification: Status:		A19NW (NE)	760	-	367349 427044
242	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries D J Quality Food Super Life Unit 5b Havelock St, Blackburn, Lancashire, BB2 2QA Meat Product Manufacturers & Wholesalers Inactive Manually positioned to the road within the address or location	A19SW (NE)	698	-	367408 426934
242	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Riverside Precision Engineering Stancliffe Street Industrial Estate, Blackburn, BB2 2QR Precision Engineers Active Automatically positioned to the address	A19SW (NE)	737	-	367428 426967

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
242	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Farnworth & Langan Ltd Stancliffe Street Industrial Estate, Blackburn, BB2 2QR Precision Engineers Active Automatically positioned to the address	A19SW (NE)	737	-	367428 426967
242	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Crown Blinds Unit 5, Waterfall Trade Park, Stancliffe Street, Blackburn, BB2 2QD Blinds, Awnings & Canopies Active Automatically positioned to the address	A19SW (NE)	737	-	367428 426967
242	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Turners Blinds & Harwoods Curtians Unit 5, Waterfall Trade Park, Stancliffe Street, Blackburn, BB2 2QD Blinds, Awnings & Canopies Inactive Automatically positioned to the address	A19SW (NE)	737	-	367428 426967
242	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Lancashire Edible Oil Refining Co Stansfeld Street, Blackburn, BB2 2NG Oils - Edible Active Automatically positioned to the address	A19SW (NE)	779	-	367452 427003
243	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Zampino Uk Ltd 200, Bolton Road, Blackburn, BB2 4HU T-Shirts Active Automatically positioned to the address	A14SE (E)	703	-	367669 426159
243	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Ewood Print Bar 200, Bolton Road, Blackburn, BB2 4HU T-Shirts Inactive Automatically positioned to the address	A14SE (E)	704	-	367669 426155
244	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Contract Fabrics Witton Mill, Stancliffe Street, Blackburn, BB2 2QU Textile Manufacturing Inactive Automatically positioned to the address	A18NE (N)	718	-	367053 427103
244	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Warwick & Bailey Engineering Witton Mill, Stancliffe Street, Blackburn, BB2 2QU Metal Products - Fabricated Inactive Automatically positioned to the address	A18NE (N)	718	-	367053 427103
245	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries The Iron Inn 220, Bolton Road, Blackburn, BB2 4HU Ironing & Home Laundry Services Active Automatically positioned to the address	A14SE (E)	726	-	367669 426082
246	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Texaco Bolton Road, Blackburn, Lancashire, BB2 4HL Petrol Filling Stations Inactive Manually positioned within the geographical locality	A14NE (E)	727	-	367724 426399
246	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries The Washbowl 152, Bolton Road, Blackburn, BB2 4HL Laundries & Launderettes Active Automatically positioned to the address	A14NE (E)	730	-	367724 426429
247	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Ewood M O T & Service Centre 1, Calico Street, Blackburn, BB2 4HX Garage Services Active Automatically positioned to the address	A14SE (E)	733	-	367713 426206

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
247	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Kings Transport Ltd 1, Calico Street, Blackburn, BB2 4HX Road Haulage Services Inactive Automatically positioned to the address	A14SE (E)	734	-	367713 426206
248	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries K R C 3a, Cartmel Road, Blackburn, BB2 2TA Car Dealers Inactive Automatically positioned to the address	A17SE (NW)	734	-	366505 426980
249	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Lockmill Service Station Bolton Road, BLACKBURN, BB2 4HL Petrol Filling Stations Active Automatically positioned to the address	A14NE (E)	743	-	367722 426532
250	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Micro Matic Ltd Stancliffe St Ind Est, Blackburn, Lancashire, BB2 2QR Brewers Inactive Manually positioned to the road within the address or location	A18NE (N)	751	-	367234 427088
251	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Furniture Medic 24, Fielding Crescent, Blackburn, BB2 4TD Furniture - Repairing & Restoring Inactive Automatically positioned in the proximity of the address	A12SW (W)	757	-	366218 426083
252	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Hollin Bridge Tyre & M O T Centre Hollin Bridge Street, Blackburn, Lancashire, BB2 4BA Garage Services Active Manually positioned to the address or location	A14NE (E)	761	-	367717 426614
252	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Abbott'S Car Repairs Ltd Hollin Bridge Street, Blackburn, BB2 4BA Car Body Repairs Active Automatically positioned to the address	A14NE (E)	762	-	367718 426615
253	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Business Furnishings 27, Herbert Street, Blackburn, BB2 4AP Office Furniture & Equipment Inactive Automatically positioned to the address	A19SW (NE)	788	-	367603 426873
253	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Business Furnishings 27, Herbert Street, Blackburn, BB2 4AP Soft Furnishings - Manufacturers Active Automatically positioned to the address	A19SW (NE)	788	-	367603 426873
254	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Worldwide Tyres & Repairs Stansfeld Street, Blackburn, BB2 2NG Tyre Dealers Active Automatically positioned to the address	A19SW (NE)	790	-	367457 427012
254	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Durasak Stansfeld Street, Blackburn, BB2 2NG Distribution Services Inactive Automatically positioned to the address	A19SW (NE)	804	-	367469 427020
254	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Durasak Ltd Stansfeld Street, Blackburn, BB2 2NG Polythene & Plastic Sheeting Supplies Inactive Automatically positioned to the address	A19SW (NE)	804	-	367469 427020

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
255	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Pillbox38 Uk Ltd Stancliffe Street Industrial Estate, Blackburn, BB2 2QR Electrical Goods Sales, Manufacturers & Wholesalers Active Automatically positioned to the address	A18NE (NE)	790	-	367299 427101
255	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Blackburn Car Centre Stancliffe Street Industrial Estate, Blackburn, BB2 2QR Car Dealers Inactive Automatically positioned to the address	A19NW (NE)	802	-	367310 427110
256	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Broughtons Cleaning Contractors 45, Parklands Way, Blackburn, BB2 4QS Commercial Cleaning Services Active Automatically positioned to the address	A8SW (SW)	792	-	366646 425606
256	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Broughtons Cleaning Contractors 45, Parklands Way, Blackburn, BB2 4QS Commercial Cleaning Services Inactive Automatically positioned to the address	A8SW (SW)	792	-	366646 425606
257	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Blackburn Blind Co 300, Bolton Road, Blackburn, BB2 4HY Blinds, Awnings & Canopies Inactive Automatically positioned to the address	A9NE (SE)	797	-	367668 425917
258	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Enviroline Ltd 59, Brotherston Drive, Blackburn, BB2 4FJ Recycling Services Inactive Automatically positioned to the address	A9SW (SE)	830	-	367372 425591
259	Contemporary Trad Name: Location: Classification: Status:		A19SW (NE)	843	-	367626 426930
259	Contemporary Trad Name: Location: Classification: Status:		A19SW (NE)	856	-	367606 426971
260	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Shorrock Concrete 103, Green Lane, Blackburn, BB2 4SR Concrete Manufacturers & Distributors Active Automatically positioned to the address	A7NW (SW)	844	-	366153 426013
261	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Voith Fabrics (Blackburn) Ltd Cartmel Road, Blackburn, BB2 2SZ Textile Manufacturing Inactive Automatically positioned to the address	A17NE (NW)	859	-	366413 427068
261	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Voith Fabrics Blackburn Cartmel Road, Blackburn, Lancashire, BB2 2SZ Paper & Cardboard Manufacturers Inactive Automatically positioned to the address	A17NE (NW)	859	-	366413 427068
261	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Voith Fabrics (Blackburn) Cartmel Road, Blackburn, Lancashire, BB2 2SZ Clothing & Fabrics - Manufacturers Inactive Automatically positioned to the address	A17NE (NW)	859	-	366413 427068

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	Contemporary Trad	le Directory Entries				
261	Name: Location: Classification: Status:	Voith Paper Fabrics Cartmel Road, Blackburn, Lancashire, BB2 2SZ Textile Manufacturing Inactive Automatically positioned to the address	A17NE (NW)	859	-	366413 427068
	Contemporary Trad	e Directory Entries				
262	Name: Location: Classification: Status:	J W Doody Unit 19, Hamilton Street, Blackburn, Lancashire, BB2 4AJ Wrought Ironwork Active Automatically positioned to the address	A19SW (NE)	893	-	367631 426999
	Contemporary Trad	e Directory Entries				
262	Name: Location: Classification: Status: Positional Accuracy:	Smartbuyer Unit 14, Hamilton Street, Blackburn, BB2 4AJ Electrical Goods Sales, Manufacturers & Wholesalers Inactive Automatically positioned to the address	A19SE (NE)	917	-	367671 426991
	Contemporary Trad	e Directory Entries				
262	Name: Location: Classification: Status: Positional Accuracy:	Barnes Plastic Welding Equipment Ltd Unit 11, Hamilton Street, Blackburn, BB2 4AJ Plastics - Welding Active Automatically positioned to the address	A19SE (NE)	923	-	367673 426997
	Contemporary Trad	e Directory Entries				
262	Name: Location: Classification: Status: Positional Accuracy:	Hodervalley Fine Foods Ltd Unit 10, Hamilton Street, Blackburn, BB2 4AJ Sausage Manufacturers Inactive Automatically positioned to the address	A19SE (NE)	937	-	367681 427009
	Contemporary Trad					
262	Name: Location: Classification: Status:	M J D Recycling Ltd Unit 5-6, Hamilton Street, Blackburn, BB2 4AJ Scrap Metal Merchants Active Automatically positioned to the address	A19SE (NE)	953	-	367718 426993
	Contemporary Trad					
263	Name: Location: Classification: Status:	Carpet Cleaning Blackburn 3, Agnes Street, Blackburn, BB2 2NR Cleaning Services - Domestic Inactive Automatically positioned to the address	A19NW (NE)	894	-	367359 427188
	Contemporary Trad	e Directory Entries				
264	Name: Location: Classification: Status:	Highgrove Suites Ltd Unit 1, Lower Hollin Bank Street, Blackburn, BB2 4AD Leather Merchants & Wholesalers Inactive Automatically positioned to the address	A19SE (NE)	915	-	367762 426869
	Contemporary Trad	le Directory Entries				
265	Name: Location: Classification: Status:	Blackburn Royal Infirmary Infirmary Road, Blackburn, BB2 3LR Hospitals Inactive Automatically positioned to the address	A14NE (E)	916	-	367860 426675
	Contemporary Trad					
266	Name: Location: Classification: Status:	Rockets Car Repairs Livesey Branch Road, Blackburn, BB2 4RA Garage Services Active Automatically positioned to the address	A7NW (SW)	919	-	366272 425704
	Contemporary Trad	le Directory Entries				
267	Name: Location: Classification: Status:	Kappa (Gb) Ltd 2nd Floor Darwin End Stand Ewood Pk Nuttall St, Blackburn, Lancashire, BB2 4JF Leisure & Sportswear Manufacturers & Wholesalers Inactive	A9NE (SE)	928	-	367822 425928
	Positional Accuracy:	Manually positioned within the geographical locality				

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	Contemporary Trad	e Directory Entries				
268	Name: Location: Classification: Status:	Blackburn Power Ltd Lower Hollin Bank Street, Blackburn, BB2 4AD Mechanical Engineers Active Automatically positioned to the address	A19SE (NE)	971	-	367780 426942
268	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Advanced Dyers Lower Hollin Bank St, Blackburn, Lancashire, BB2 4AD Dyers Inactive Manually positioned to the road within the address or location	A19SE (NE)	987	-	367776 426975
268	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Hamp Products Ltd Unit 3,Lower Hollin Bank St, Blackburn, Lancashire, BB2 4AD Exhaust System Manufacturers & Wholesalers Inactive Manually positioned to the address or location	A19SE (NE)	998	-	367802 426959
269	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries A G Marsden & Son Ltd Vauxhall Street, BLACKBURN, BB2 1XD Garage Services Active Automatically positioned to the address	A18NW (N)	977	-	366735 427346
270	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Controls 4 Steam Uk Ltd Blackburn Rovers Enterprise Centre, Nuttall Street, Blackburn, BB2 4JF Automation Systems & Equipment Active Automatically positioned to the address	A9NE (SE)	979	-	367822 425820
271	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries B & B Autocare Hamilton Street, Blackburn, BB2 4AJ Garage Services Inactive Automatically positioned to the address	A19NE (NE)	984	-	367704 427053
271	Contemporary Trad Name: Location: Classification: Status:		A19NE (NE)	988	-	367708 427055
271	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries J Abbott Unit 2 Fletcher St, Blackburn, Lancashire, BB2 4AQ Car Dealers - Used Inactive Manually positioned to the road within the address or location	A19NE (NE)	989	-	367714 427050
272	Contemporary Trad Name: Location: Classification: Status: Positional Accuracy:	e Directory Entries Northern Garage Supplies 17 St. Philips Court, St. Philips Street, Blackburn, BB2 1US Garage Equipment Active Automatically positioned to the address	A23SE (N)	989	-	367013 427380
273	Fuel Station Entries Name: Location: Brand: Premises Type: Status: Positional Accuracy:	s Livesey Service Station Livesey Branch Road, Ewood,, BLACKBURN, Lancashire, BB2 5DQ Unbranded Not Applicable Obsolete Automatically positioned to the address	A8NW (S)	508	-	366908 425823
274	Fuel Station Entries Name: Location: Brand: Premises Type: Status: Positional Accuracy:	Lock Mill Service Station Bolton Road, Blackburn, BB2 4HL Texaco Petrol Station Open Automatically positioned to the address	A14NE (E)	741	-	367721 426527

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	Fuel Station Entries	3				
275	Name: Location: Brand: Premises Type: Status: Positional Accuracy:	Former Garage Stancliffe Street, BLACKBURN, Lancashire, BB2 2 Obsolete Not Applicable Obsolete Manually positioned to the road within the address or location	A19NW (NE)	743	-	367314 427043
276	Fuel Station Entries Name: Location: Brand: Premises Type: Status: Positional Accuracy:	G Beardsworth And Son Ltd Stancliffe Street, Blackburn, Lancashire, Bb2 2qr Obsolete Not Applicable Obsolete Manually positioned to the address or location	A18NE (NE)	785	-	367297 427097
277	Fuel Station Entries Name: Location: Brand: Premises Type: Status: Positional Accuracy:	Green Lane Garage Livesey Branch Road, BLACKBURN, Lancashire, BB2 4RA Obsolete Not Applicable Obsolete Located by supplier to within 100m	A7SW (SW)	964	-	366286 425628
278	Name: Location: Category: Class Code:	Commercial Services H Light Haulage Ltd 14 Moorgate Street, Blackburn, BB2 4EZ Transport, Storage and Delivery Distribution and Haulage Positioned to address or location	A13NE (E)	115	7	367103 426412
279	Name: Location: Category: Class Code:	Commercial Services Rda Mobile Vehicle Servicing 8 Kings Bridge Close, Blackburn, BB2 4RY Repair and Servicing Vehicle Repair, Testing and Servicing Positioned to address or location	A13SW (W)	115	7	366814 426330
280	Name: Location: Category: Class Code:	Commercial Services Cash for Clothes Blackburn 7 New Chapel Street, Blackburn, BB2 4DT Recycling Services Recycling, Reclamation and Disposal Positioned to address or location	A13NW (N)	195	7	366949 426588
281	Name: Location: Category: Class Code:	Commercial Services Mill Hill Car Centre Parkinson Street, Blackburn, BB2 4BY Repair and Servicing Vehicle Repair, Testing and Servicing Positioned to address or location	A13NE (N)	267	7	367010 426653
281	Name: Location: Category: Class Code:	Commercial Services Station Garage Parkinson Street, Blackburn, BB2 4BY Repair and Servicing Vehicle Repair, Testing and Servicing Positioned to address or location	A13NE (N)	268	7	367011 426654
282	Name: Location: Category: Class Code:	Commercial Services J H Mackereth 36 Bonsall Street, Blackburn, BB2 4DB Repair and Servicing Vehicle Repair, Testing and Servicing Positioned to address or location	A13NW (NW)	286	7	366717 426567
283	Name: Location: Category: Class Code:	Commercial Services Bob Hodkinson Garage Mill Hill Motors, Albert Street, Blackburn, BB2 4BL Repair and Servicing Vehicle Repair, Testing and Servicing Positioned to address or location	A14NW (NE)	416	7	367337 426608
284	Name: Location: Category: Class Code:	Commercial Services Htg Road Haulage Services 1 Slater Street, Blackburn, BB2 4LY Transport, Storage and Delivery Distribution and Haulage Positioned to address or location	A14SW (SE)	423	7	367359 426131

LANDMARK INFORMATION GROUP*

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
285	Points of Interest - Commercial Services Name: Pfd Motortune Location: 1 Albert Street, Blackburn, BB2 4BL Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A18SE (NE)	432	7	367279 426697
286	Points of Interest - Commercial Services Name: Casa Bella Furnishings Ltd Location: Unit 3 Waterfall Mill, Queen Victoria Street, Blackburn, BB2 2QG Category: Transport, Storage and Delivery Class Code: Distribution and Haulage Positional Accuracy: Positioned to address or location	A18SE (N)	443	7	366983 426835
286	Points of Interest - Commercial Services Name: North West Containers Ltd Location: Unit 3 Waterfall Mill, Queen Victoria Street, Blackburn, BB2 2QG Category: Recycling Services Class Code: Recycling, Reclamation and Disposal Positional Accuracy: Positioned to address or location	A18SE (N)	443	7	366982 426835
287	Points of Interest - Commercial Services Name: Three Arches Garage Location: Unit 1, Dimmock Street, Blackburn, BB2 2QB Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A18SE (NE)	506	7	367228 426821
287	Points of Interest - Commercial Services Name: Clothes Aid Services Ltd Location: Unit 2, Dimmock Street, Blackburn, BB2 2QB Category: Transport, Storage and Delivery Class Code: Distribution and Haulage Positional Accuracy: Positioned to address or location	A18SE (NE)	514	7	367223 426832
288	Points of Interest - Commercial Services Name: Iddon PSV Parts Location: Albion Works, Albion Road, Blackburn, BB2 4LJ Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14SW (SE)	650	7	367592 426096
289	Points of Interest - Commercial Services Name: Walsh & Midgley Ltd Location: Stancliffe Street Industrial Estate, Blackburn, BB2 2QR Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A19SW (NE)	686	7	367310 426981
290	Points of Interest - Commercial Services Name: M J D Recycling Location: Unit 1 Griffin Mill, Stancliffe Street, Blackburn, BB2 2QU Category: Recycling Services Class Code: Recycling, Reclamation and Disposal Positional Accuracy: Positioned to address or location	A18NE (N)	718	7	367052 427103
291	Points of Interest - Commercial Services Name: Millgate Garage Location: Hollin Bridge Street, Blackburn, BB2 4BA Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14NE (E)	728	7	367696 426571
291	Points of Interest - Commercial Services Name: Mill Hill M O T Centre Location: Hollin Bridge Street, Blackburn, BB2 4BA Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14NE (E)	728	7	367696 426571
291	Points of Interest - Commercial Services Name: Millgate Garage Location: Hollin Bridge Street, Blackburn, BB2 4BA Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14NE (E)	728	7	367696 426571
291	Points of Interest - Commercial Services Name: Lock Mill Service Station Location: Bolton Road, Blackburn, BB2 4HL Category: Personal, Consumer and other Services Class Code: Vehicle Cleaning Services Positional Accuracy: Positioned to address or location	A14NE (E)	741	7	367721 426527

LANDMARK INFORMATION GROUP*

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
291	Points of Interest - Commercial Services Name: Car Wash Location: Bolton Road, Blackburn, BB2 4HL Category: Personal, Consumer and other Services Class Code: Vehicle Cleaning Services Positional Accuracy: Positioned to address or location	A14NE (E)	741	7	367721 426527
291	Points of Interest - Commercial Services Name: Lock Mill Service Station Location: Bolton Road, Blackburn, BB2 4HL Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14NE (E)	743	7	367722 426532
291	Points of Interest - Commercial Services Name: Lock Mill Service Station Location: Bolton Road, Blackburn, BB2 4HL Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14NE (E)	743	7	367722 426532
291	Points of Interest - Commercial Services Name: Hollin Bridge Tyre & M O T Centre Location: Hollin Bridge Street, Blackburn, BB2 4BA Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14NE (E)	761	7	367717 426614
291	Points of Interest - Commercial Services Name: Abbott's Car Repairs Ltd Location: Hollin Bridge Street, Blackburn, BB2 4BA Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14NE (E)	761	7	367717 426614
291	Points of Interest - Commercial Services Name: Abbotts Car Repairs Ltd Location: Hollin Bridge Street, Blackburn, BB2 4BA Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14NE (E)	762	7	367718 426615
292	Points of Interest - Commercial Services Name: Automotive T V S Location: 1 Calico Street, Blackburn, BB2 4HX Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14SE (E)	733	7	367713 426206
292	Points of Interest - Commercial Services Name: Ewood M O T & Service Centre Location: 1 Calico Street, Blackburn, BB2 4HX Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14SE (E)	733	7	367713 426206
292	Points of Interest - Commercial Services Name: Kings Transport Ltd Location: 1 Calico Street, Blackburn, BB2 4HX Category: Transport, Storage and Delivery Class Code: Distribution and Haulage Positional Accuracy: Positioned to address or location	A14SE (E)	734	7	367713 426206
292	Points of Interest - Commercial Services Name: M & R Services Location: 1 Calico Street, Blackburn, BB2 4HX Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14SE (E)	734	7	367713 426206
292	Points of Interest - Commercial Services Name: W S King Location: 1 Calico Street, Blackburn, BB2 4HX Category: Transport, Storage and Delivery Class Code: Distribution and Haulage Positional Accuracy: Positioned to address or location	A14SE (E)	734	7	367713 426206
293	Points of Interest - Commercial Services Name: Enviroline Ltd Location: 59 Brotherston Drive, Blackburn, BB2 4FJ Category: Recycling Services Class Code: Recycling, Reclamation and Disposal Positional Accuracy: Positioned to address or location	A9SW (SE)	830	7	367372 425591

LANDMARK INFORMATION GROUP*

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
294	Points of Interest - Commercial Services Name: J W Doody Location: Unit 19, Hamilton Street, Blackburn, BB2 4AJ Category: Construction Services Class Code: Metalworkers Including Blacksmiths Positional Accuracy: Positioned to address or location	A19SW (NE)	893	7	367631 426999
294	Points of Interest - Commercial Services Name: J W Doody Location: Unit 19, Hamilton Street, Blackburn, BB2 4AJ Category: Construction Services Class Code: Metalworkers Including Blacksmiths Positional Accuracy: Positioned to address or location	A19SW (NE)	893	7	367631 426998
294	Points of Interest - Commercial Services Name: Ride N Shine Ltd Location: Unit 17, Hamilton Street, Blackburn, BB2 4AJ Category: Personal, Consumer and other Services Class Code: Vehicle Cleaning Services Positional Accuracy: Positioned to address or location	A19SE (NE)	901	7	367646 426995
295	Points of Interest - Commercial Services Name: Rockets Car Repairs Location: Livesey Branch Road, Blackburn, BB2 4RA Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A7NW (SW)	919	7	366272 425703
296	Points of Interest - Commercial Services Name: M J D Recycling Ltd Location: Unit 5, Hamilton Street, Blackburn, BB2 4AJ Category: Recycling Services Class Code: Scrap Metal Merchants Positional Accuracy: Positioned to address or location	A19SE (NE)	953	7	367718 426992
296	Points of Interest - Commercial Services Name: Croft Commercial Services Ltd Location: Unit 20, Hamilton Street, Blackburn, BB2 4AJ Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A19NE (NE)	986	7	367685 427076
296	Points of Interest - Commercial Services Name: A1 Car Glass Location: Unit 1, Hamilton Street, Blackburn, BB2 4AJ Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A19NE (NE)	993	7	367724 427045
297	Points of Interest - Commercial Services Name: A G Marsden & Son Ltd Location: Vauxhall Street, Blackburn, BB2 1XD Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A18NW (N)	977	7	366735 427346
297	Points of Interest - Commercial Services Name: A G Marsden & Son Ltd Location: Vauxhall Street, Blackburn, BB2 1XD Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A18NW (N)	977	7	366735 427346
297	Points of Interest - Commercial Services Name: Marsdens of Blackburn Location: Witton Garage, Vauxhall Street, Blackburn, BB2 1XD Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A18NW (N)	977	7	366735 427346
298	Points of Interest - Commercial Services Name: L C Towbars Location: 7 Heyworth Avenue, Blackburn, BB2 4SB Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A8SE (S)	996	7	367266 425370
299	Points of Interest - Education and Health Name: Blackburn Royal Infirmary Location: Infirmary Road, Blackburn, BB2 3LR Category: Health Practitioners and Establishments Class Code: Hospitals Positional Accuracy: Positioned to address or location	A14NE (E)	916	7	367860 426675

LANDMARK INFORMATION GROUP*

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
300	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A13NE (NE)	53	7	367005 426425
301	Points of Interest - Manufacturing and Production Name: Tank Location: BB2 Category: Industrial Features Class Code: Tanks (Generic) Positional Accuracy: Positioned to address or location	A13SE (S)	64	7	366966 426264
302	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A13NW (N)	207	7	366891 426592
303	Points of Interest - Manufacturing and Production Name: Works Location: BB2 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A13SE (SE)	254	7	367115 426108
304	Points of Interest - Manufacturing and Production Name: Works Location: BB2 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A13SE (SE)	321	7	367247 426142
305	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A13NW (NW)	341	7	366656 426576
305	Points of Interest - Manufacturing and Production Name: Works Location: BB2 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A13NW (NW)	341	7	366656 426576
306	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A18SE (N)	350	7	367072 426720
306	Points of Interest - Manufacturing and Production Name: Works Location: BB2 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A18SE (N)	350	7	367072 426720
306	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A18SE (N)	361	7	367021 426747
306	Points of Interest - Manufacturing and Production Name: Works Location: BB2 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A18SE (N)	362	7	367022 426747
307	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A12NE (W)	362	7	366567 426373

LANDMARK INFORMATION GROUP*

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
307	Points of Interest - Manufacturing and Production Name: Works Location: BB2 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A12NE (W)	362	7	366567 426373
308	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A8NE (SE)	365	7	367160 426006
308	Points of Interest - Manufacturing and Production Name: Works Location: BB2 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A8NE (SE)	365	7	367160 426006
308	Points of Interest - Manufacturing and Production Name: Works Location: BB2 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A8NE (SE)	373	7	367155 425994
309	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A18SE (NE)	388	7	367206 426697
309	Points of Interest - Manufacturing and Production Name: Works Location: BB2 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A18SE (NE)	388	7	367206 426697
309	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A18SE (NE)	406	7	367230 426703
309	Points of Interest - Manufacturing and Production Name: Works Location: BB2 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A18SE (NE)	406	7	367230 426703
309	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A13NE (NE)	422	7	367284 426679
309	Points of Interest - Manufacturing and Production Name: Works Location: BB2 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A13NE (NE)	422	7	367284 426679
310	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A14NW (NE)	408	7	367336 426596
310	Points of Interest - Manufacturing and Production Name: Works Location: BB2 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A14NW (NE)	408	7	367336 426596

LANDMARK INFORMATION GROUP*

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
311	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A12NE (W)	422	7	366518 426447
311	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A12NE (W)	425	7	366524 426478
311	Points of Interest - Manufacturing and Production Name: Works Location: BB2 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A12NE (W)	429	7	366511 426446
311	Points of Interest - Manufacturing and Production Name: Works Location: BB2 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A12NE (W)	431	7	366517 426477
311	Points of Interest - Manufacturing and Production Name: Works Location: BB2 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A12NE (W)	456	7	366481 426438
312	Points of Interest - Manufacturing and Production Name: Workshop Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A18SW (N)	444	7	366884 426832
313	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A18SE (N)	478	7	366974 426870
313	Points of Interest - Manufacturing and Production Name: Works Location: BB2 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A18SE (N)	478	7	366974 426870
314	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A18SE (NE)	568	7	367269 426869
314	Points of Interest - Manufacturing and Production Name: Works Location: BB2 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A18SE (NE)	568	7	367269 426869
314	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A18SE (NE)	604	7	367238 426925
314	Points of Interest - Manufacturing and Production Name: Works Location: BB2 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A18SE (NE)	604	7	367238 426925

LANDMARK INFORMATION GROUP*

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
314	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A19SW (NE)	681	7	367309 426976
315	Points of Interest - Manufacturing and Production Name: Albion Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A14SW (E)	653	7	367599 426106
315	Points of Interest - Manufacturing and Production Name: Works Location: BB2 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A14SW (E)	653	7	367599 426106
316	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A18SW (NW)	656	7	366663 426985
316	Points of Interest - Manufacturing and Production Name: Works Location: BB2 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A18SW (NW)	658	7	366658 426984
317	Points of Interest - Manufacturing and Production Name: Works Location: BB2 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to address or location	A19SW (NE)	682	7	367312 426975
318	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A19SW (NE)	687	7	367367 426949
318	Points of Interest - Manufacturing and Production Name: Works Location: BB2 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A19SW (NE)	687	7	367367 426949
318	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A19SW (NE)	718	7	367351 426995
318	Points of Interest - Manufacturing and Production Name: Works Location: BB2 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A19SW (NE)	719	7	367351 426996
318	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A19SW (NE)	728	7	367424 426960
318	Points of Interest - Manufacturing and Production Name: Works Location: BB2 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A19SW (NE)	728	7	367424 426960

LANDMARK INFORMATION GROUP*

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
318	Points of Interest - Manufacturing and Production Name: Works Location: BB2 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A19SW (NE)	772	7	367447 426997
318	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A19SW (NE)	795	7	367464 427013
318	Points of Interest - Manufacturing and Production Name: Works Location: BB2 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to address or location	A19SW (NE)	799	7	367468 427015
319	Points of Interest - Manufacturing and Production Name: Wks Location: BB2 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A18NE (N)	915	7	367262 427253
320	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A19SE (NE)	942	7	367709 426986
320	Points of Interest - Manufacturing and Production Name: Works Location: BB2 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A19SE (NE)	945	7	367714 426985
320	Points of Interest - Manufacturing and Production Name: Works Location: BB2 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A19SE (NE)	955	7	367710 427004
320	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A19SE (NE)	982	7	367726 427027
321	Points of Interest - Manufacturing and Production Name: Artson Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A12NW (W)	986	7	365958 426525
321	Points of Interest - Manufacturing and Production Name: Artson Works Location: BB2 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A12NW (W)	986	7	365958 426525
322	Points of Interest - Public Infrastructure Name: Mill Hill (Lancs) Rail Station Location: Parkinson Street, BB2 Category: Public Transport, Stations and Infrastructure Class Code: Railway Stations, Junctions and Halts Positional Accuracy: Positioned to address or location	A13NE (N)	267	7	367010 426653
322	Points of Interest - Public Infrastructure Name: Mill Hill Station Location: Parkinson Street, BB2 Category: Public Transport, Stations and Infrastructure Class Code: Railway Stations, Junctions and Halts Positional Accuracy: Positioned to address or location	A13NE (N)	267	7	367010 426653

LANDMARK INFORMATION GROUP*

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
323	Points of Interest - Public Infrastructure Name: Sluice Location: BB2 Category: Water Class Code: Weirs, Sluices and Dams Positional Accuracy: Positioned to an adjacent address or location	A12NE (W)	465	7	366466 426402
324	Points of Interest - Public Infrastructure Name: Lock Mill Service Station Location: Bolton Road, Blackburn, BB2 4HL Category: Road And Rail Class Code: Petrol and Fuel Stations Positional Accuracy: Positioned to address or location	A14NE (E)	741	7	367721 426527
324	Points of Interest - Public Infrastructure Name: Texaco Location: Bolton Road, Blackburn, BB2 4HL Category: Road And Rail Class Code: Petrol and Fuel Stations Positional Accuracy: Positioned to address or location	A14NE (E)	742	7	367721 426532
324	Points of Interest - Public Infrastructure Name: Texaco Location: Bolton Road, Blackburn, BB2 4HL Category: Road And Rail Class Code: Petrol and Fuel Stations Positional Accuracy: Positioned to address or location	A14NE (E)	743	7	367722 426532
324	Points of Interest - Public Infrastructure Name: Lock Mill Service Station Location: Bolton Road, Blackburn, BB2 4HL Category: Road And Rail Class Code: Petrol and Fuel Stations Positional Accuracy: Positioned to address or location	A14NE (E)	743	7	367722 426532
325	Points of Interest - Public Infrastructure Name: Cherry Tree Rail Station Location: Cherry Lea, BB2 Category: Public Transport, Stations and Infrastructure Class Code: Railway Stations, Junctions and Halts Positional Accuracy: Positioned to address or location	A12NW (W)	815	7	366122 426467
325	Points of Interest - Public Infrastructure Name: Cherry Tree Station Location: Cherry Lea, BB2 Category: Public Transport, Stations and Infrastructure Class Code: Railway Stations, Junctions and Halts Positional Accuracy: Positioned to address or location	A12NW (W)	815	7	366122 426467
326	Points of Interest - Public Infrastructure Name: Enviroline Ltd Location: 59 Brotherston Drive, Blackburn, BB2 4FJ Category: Infrastructure and Facilities Class Code: Recycling Centres Positional Accuracy: Positioned to address or location	A9SW (SE)	830	7	367372 425591
327	Points of Interest - Public Infrastructure Name: Weir Location: BB2 Category: Water Class Code: Weirs, Sluices and Dams Positional Accuracy: Positioned to an adjacent address or location	A17SW (NW)	972	7	366194 427012
328	Points of Interest - Recreational and Environmental Name: Playground Location: Not Supplied Category: Recreational Class Code: Playgrounds Positional Accuracy: Positioned to an adjacent address or location	A13NE (E)	228	7	367209 426450
328	Points of Interest - Recreational and Environmental Name: Playground Location: St Aidan'S Close, BB2 Category: Recreational Class Code: Playgrounds Positional Accuracy: Positioned to an adjacent address or location	A13NE (E)	228	7	367209 426450
329	Points of Interest - Recreational and Environmental Name: Play Area Location: Tresco Close, BB2 Category: Recreational Class Code: Playgrounds Positional Accuracy: Positioned to an adjacent address or location	A13SE (S)	246	7	367035 426085

LANDMARK INFORMATION GROUP*

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
329	Points of Interest - Recreational and Environmental Name: Play Area Location: Not Supplied Category: Recreational Class Code: Playgrounds Positional Accuracy: Positioned to an adjacent address or location	A13SE (S)	247	7	367042 426085
330	Points of Interest - Recreational and Environmental Name: Playground Location: Not Supplied Category: Recreational Class Code: Playgrounds Positional Accuracy: Positioned to an adjacent address or location	A13NE (NE)	353	7	367226 426638
331	Points of Interest - Recreational and Environmental Name: Play Area Location: Livesey Branch Road, BB2 Category: Recreational Class Code: Playgrounds Positional Accuracy: Positioned to address or location	A8NE (S)	490	7	367118 425854
331	Points of Interest - Recreational and Environmental Name: Play Area Location: Not Supplied Category: Recreational Class Code: Playgrounds Positional Accuracy: Positioned to an adjacent address or location	A8NE (S)	492	7	367116 425852
332	Points of Interest - Recreational and Environmental Name: Play Area Location: Not Supplied Category: Recreational Class Code: Playgrounds Positional Accuracy: Positioned to an adjacent address or location	A8NW (S)	525	7	366936 425803
332	Points of Interest - Recreational and Environmental Name: Play Area Location: Scotland Bank Terrace, BB2 Category: Recreational Class Code: Playgrounds Positional Accuracy: Positioned to an adjacent address or location	A8NW (S)	525	7	366936 425803
332	Points of Interest - Recreational and Environmental Name: Play Area Location: Not Supplied Category: Recreational Class Code: Playgrounds Positional Accuracy: Positioned to an adjacent address or location	A8NW (S)	570	7	366881 425765
333	Points of Interest - Recreational and Environmental Name: Playground Location: Nr Aqueduct Road, BB2 Category: Recreational Class Code: Playgrounds Positional Accuracy: Positioned to address or location	A14NW (NE)	566	7	367466 426685
334	Points of Interest - Recreational and Environmental Name: Play Area Location: Not Supplied Category: Recreational Class Code: Playgrounds Positional Accuracy: Positioned to an adjacent address or location	A8NW (S)	589	7	366793 425769
334	Points of Interest - Recreational and Environmental Name: Play Area Location: Brookway, BB2 Category: Recreational Class Code: Playgrounds Positional Accuracy: Positioned to an adjacent address or location	A8NW (S)	589	7	366793 425769
335	Points of Interest - Recreational and Environmental Name: Play Area Location: Wolseley Street, BB2 Category: Recreational Class Code: Playgrounds Positional Accuracy: Positioned to address or location	A14SE (E)	812	7	367803 426262
335	Points of Interest - Recreational and Environmental Name: Play Area Location: Not Supplied Category: Recreational Class Code: Playgrounds Positional Accuracy: Positioned to an adjacent address or location	A14SE (E)	814	7	367804 426259

LANDMARK INFORMATION GROUP*

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	Points of Interest - I	Recreational and Environmental				
336	Name: Location: Category: Class Code: Positional Accuracy:	Play Area Not Supplied Recreational Playgrounds Positioned to an adjacent address or location	A19NW (NE)	844	7	367337 427143
	Points of Interest - I	Recreational and Environmental				
336	Name: Location: Category: Class Code: Positional Accuracy:	Play Area Wellington Road, BB2 Recreational Playgrounds Positioned to an adjacent address or location	A19NW (NE)	844	7	367337 427143
	Points of Interest - I	Recreational and Environmental				
337	Name: Location: Category: Class Code: Positional Accuracy:	Play Area Not Supplied Recreational Playgrounds Positioned to an adjacent address or location	A18NE (N)	882	7	367027 427272

LANDMARK INFORMATION GROUP*

Sensitive Land Use

Map ID		Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	Areas of Adopted	Green Belt				
338	Authority: Plan Name: Status: Plan Date:	Blackburn with Darwen Borough Council Local Plan Part 2: Allocations And Development Management Adopted 3rd December 2015	A17NE (NW)	879	9	366511 427157
	Local Nature Rese	rves				
339	Name: Multiple Area: Area (m2): Source: Designation Date:	River Darwen Parkway Y 240464.41 Natural England 18th August 2004	A14SE (E)	700	8	367694 426303

LANDMARK INFORMATION GROUP*

Data Currency

Agency & Hydrological	Version	Update Cycle
Contaminated Land Register Entries and Notices		
Chorley Borough Council - Environmental Health Department	August 2013	Annual Rolling Update
Blackburn with Darwen Borough Council - Environmental Health Department	July 2013	Annual Rolling Update
Hyndburn Borough Council - Environmental Health Department	July 2013	Annual Rolling Update
Ribble Valley Borough Council - Environmental Health Department	October 2014	Annual Rolling Update
South Ribble Borough Council - Environmental Health Department	September 2014	Annual Rolling Update
Discharge Consents		
Environment Agency - North West Region	July 2017	Quarterly
Enforcement and Prohibition Notices Environment Agency - North West Region	March 2013	As notified
Integrated Pollution Controls		
Environment Agency - North West Region	October 2008	Not Applicable
Integrated Pollution Prevention And Control		
Environment Agency - North West Region	July 2017	Quarterly
Local Authority Integrated Pollution Prevention And Control		
Blackburn with Darwen Borough Council - Environmental Health Department	February 2015	Annual Rolling Update
Chorley Borough Council - Environmental Health Department	June 2014	Annual Rolling Update
Ribble Valley Borough Council - Environmental Health Department	June 2014	Annual Rolling Update
Hyndburn Borough Council - Environmental Health Department	October 2014	Annual Rolling Update
South Ribble Borough Council - Environmental Health Department	September 2014	Annual Rolling Update
Local Authority Pollution Prevention and Controls		
Blackburn with Darwen Borough Council - Environmental Health Department	February 2015	Annual Rolling Update
Chorley Borough Council - Environmental Health Department	June 2014	Annual Rolling Update
Ribble Valley Borough Council - Environmental Health Department	June 2014	Annual Rolling Update
Hyndburn Borough Council - Environmental Health Department	October 2014	Annual Rolling Update
South Ribble Borough Council - Environmental Health Department	September 2014	Annual Rolling Update
Local Authority Pollution Prevention and Control Enforcements		
Blackburn with Darwen Borough Council - Environmental Health Department	February 2015	Annual Rolling Update
Chorley Borough Council - Environmental Health Department	June 2014	Annual Rolling Update
Ribble Valley Borough Council - Environmental Health Department	June 2014	Annual Rolling Update
Hyndburn Borough Council - Environmental Health Department	October 2014	Annual Rolling Update
South Ribble Borough Council - Environmental Health Department	September 2014	Annual Rolling Update
Nearest Surface Water Feature		
Ordnance Survey	May 2017	
Pollution Incidents to Controlled Waters		
Environment Agency - North West Region	January 2000	Not Applicable
Prosecutions Relating to Authorised Processes	March 2012	As notified
Environment Agency - North West Region	March 2013	As houned
Prosecutions Relating to Controlled Waters Environment Agency - North West Region	March 2012	As notified
	March 2013	AS notified
Registered Radioactive Substances Environment Agency - North West Region	January 2015	
River Quality	January 2013	
Environment Agency - Head Office	November 2001	Not Applicable
River Quality Biology Sampling Points		
Environment Agency - Head Office	July 2012	Annually
River Quality Chemistry Sampling Points		
Environment Agency - Head Office	July 2012	Annually
Substantiated Pollution Incident Register		
Environment Agency - North West Region - Central Area	July 2017	Quarterly
Environment Agency - North West Region - North Area	July 2017	Quarterly

LANDMARK INFORMATION GROUP*

Data Currency

Agency & Hydrological	Version	Update Cycle
Water Abstractions		
Environment Agency - North West Region	July 2017	Quarterly
Water Industry Act Referrals Environment Agency - North West Region	July 2017	Quarterly
Groundwater Vulnerability Environment Agency - Head Office	April 2015	Not Applicable
Drift Deposits Environment Agency - Head Office	January 1999	Not Applicable
Bedrock Aquifer Designations British Geological Survey - National Geoscience Information Service	August 2015	As notified
Superficial Aquifer Designations British Geological Survey - National Geoscience Information Service	August 2015	As notified
Source Protection Zones Environment Agency - Head Office	July 2017	Quarterly
Extreme Flooding from Rivers or Sea without Defences Environment Agency - Head Office	August 2017	Quarterly
Flooding from Rivers or Sea without Defences Environment Agency - Head Office	August 2017	Quarterly
Areas Benefiting from Flood Defences Environment Agency - Head Office	August 2017	Quarterly
Flood Water Storage Areas Environment Agency - Head Office	August 2017	Quarterly
Flood Defences Environment Agency - Head Office	August 2017	Quarterly
OS Water Network Lines Ordnance Survey	July 2017	6 Weekly
Surface Water 1 in 30 year Flood Extent Environment Agency - Head Office	October 2013	As notified
Surface Water 1 in 100 year Flood Extent Environment Agency - Head Office	October 2013	As notified
Surface Water 1 in 1000 year Flood Extent Environment Agency - Head Office	October 2013	As notified
Surface Water Suitability Environment Agency - Head Office	October 2013	As notified
BGS Groundwater Flooding Susceptibility British Geological Survey - National Geoscience Information Service	May 2013	Annually

LANDMARK INFORMATION GROUP*

Waste	Version	Update Cycle
BGS Recorded Landfill Sites		
British Geological Survey - National Geoscience Information Service	June 1996	Not Applicable
Historical Landfill Sites		
Environment Agency - Head Office	July 2017	Quarterly
Integrated Pollution Control Registered Waste Sites		
Environment Agency - North West Region	October 2008	Not Applicable
Licensed Waste Management Facilities (Landfill Boundaries)		
Environment Agency - North West Region - Central Area	July 2017	Quarterly
Environment Agency - North West Region - North Area	July 2017	Quarterly
Licensed Waste Management Facilities (Locations)		
Environment Agency - North West Region - Central Area	July 2017	Quarterly
Environment Agency - North West Region - North Area	July 2017	Quarterly
Local Authority Landfill Coverage		-
Blackburn with Darwen Borough Council	May 2000	Not Applicable
Chorley Borough Council - Development Control Section	May 2000	Not Applicable
Hyndburn Borough Council - Environmental Health Department	May 2000	Not Applicable
Lancashire County Council - Waste Management Group	May 2000	Not Applicable
Ribble Valley Borough Council - Environmental Health Department	May 2000	Not Applicable
South Ribble Borough Council - Environmental Health Department	May 2000	Not Applicable
Local Authority Recorded Landfill Sites		
Blackburn with Darwen Borough Council	May 2000	Not Applicable
Chorley Borough Council - Development Control Section	May 2000	Not Applicable
Hyndburn Borough Council - Environmental Health Department	May 2000	Not Applicable
Lancashire County Council - Waste Management Group	May 2000	Not Applicable
Ribble Valley Borough Council - Environmental Health Department	May 2000	Not Applicable
South Ribble Borough Council - Environmental Health Department	May 2003	Not Applicable
Potentially Infilled Land (Non-Water)		
Landmark Information Group Limited	December 1999	Not Applicable
Potentially Infilled Land (Water)		
Landmark Information Group Limited	December 1999	Not Applicable
Registered Landfill Sites		
Environment Agency - North West Region - Central Area	March 2003	Not Applicable
Environment Agency - North West Region - North Area	March 2003	Not Applicable
Registered Waste Transfer Sites		
Environment Agency - North West Region - Central Area	March 2003	Not Applicable
Environment Agency - North West Region - North Area	March 2003	Not Applicable
Registered Waste Treatment or Disposal Sites		11
Environment Agency - North West Region - Central Area	March 2003	Not Applicable
Environment Agency - North West Region - North Area	March 2003	Not Applicable

LANDMARK INFORMATION GROUP*

Hazardous Substances	Version	Update Cycle
Control of Major Accident Hazards Sites (COMAH)		
Health and Safety Executive	September 2017	Bi-Annually
Explosive Sites	March 2017	Pi Appuelly
Health and Safety Executive	March 2017	Bi-Annually
Notification of Installations Handling Hazardous Substances (NIHHS) Health and Safety Executive	November 2000	Not Applicable
Planning Hazardous Substance Enforcements		
Blackburn with Darwen Borough Council	February 2016	Annual Rolling Update
Hyndburn Borough Council - Planning	February 2016	Annual Rolling Update
Lancashire County Council	February 2016	Annual Rolling Update
Ribble Valley Borough Council South Ribble Borough Council	February 2016	Annual Rolling Update
Chorley Borough Council - Development Control Section	February 2016 January 2016	Annual Rolling Update Annual Rolling Update
	January 2010	Annual Rolling Opuale
Planning Hazardous Substance Consents	Eshmismi 2010	Annual Dalling Lindate
Blackburn with Darwen Borough Council	February 2016	Annual Rolling Update
Hyndburn Borough Council - Planning Lancashire County Council	February 2016 February 2016	Annual Rolling Update Annual Rolling Update
Ribble Valley Borough Council	February 2016	Annual Rolling Update
South Ribble Borough Council	February 2016	Annual Rolling Update
Chorley Borough Council - Development Control Section	January 2016	Annual Rolling Update
Geological	Version	Update Cycle
BGS 1:625,000 Solid Geology		
British Geological Survey - National Geoscience Information Service	January 2009	Not Applicable
	Sandary 2000	
BGS Estimated Soil Chemistry British Geological Survey - National Geoscience Information Service	October 2015	As notified
		As notified
BGS Recorded Mineral Sites	April 2017	
British Geological Survey - National Geoscience Information Service	April 2017	Bi-Annually
CBSCB Compensation District Cheshire Brine Subsidence Compensation Board (CBSCB)	August 2011	Not Applicable
Coal Mining Affected Areas		
The Coal Authority - Property Searches	March 2014	As notified
Mining Instability		
Ove Arup & Partners	October 2000	Not Applicable
Non Coal Mining Areas of Great Britain British Geological Survey - National Geoscience Information Service	May 2015	Not Applicable
	Way 2015	
Potential for Collapsible Ground Stability Hazards	1:00 2015	Annually
British Geological Survey - National Geoscience Information Service	June 2015	Annually
Potential for Compressible Ground Stability Hazards	hun - 2015	A
British Geological Survey - National Geoscience Information Service	June 2015	Annually
Potential for Ground Dissolution Stability Hazards		
British Geological Survey - National Geoscience Information Service	June 2015	Annually
Potential for Landslide Ground Stability Hazards		
British Geological Survey - National Geoscience Information Service	June 2015	Annually
Potential for Running Sand Ground Stability Hazards		
British Geological Survey - National Geoscience Information Service	June 2015	Annually
Potential for Shrinking or Swelling Clay Ground Stability Hazards		
British Geological Survey - National Geoscience Information Service	June 2015	Annually
Radon Potential - Radon Affected Areas		
British Geological Survey - National Geoscience Information Service	July 2011	As notified
Radon Potential - Radon Protection Measures		
British Geological Survey - National Geoscience Information Service	July 2011	As notified
Potential for Shrinking or Swelling Clay Ground Stability Hazards British Geological Survey - National Geoscience Information Service Radon Potential - Radon Affected Areas British Geological Survey - National Geoscience Information Service Radon Potential - Radon Protection Measures	June 2015 July 2011	Annually As notified

LANDMARK INFORMATION GROUP*

Industrial Land Use	Version	Update Cycle
Contemporary Trade Directory Entries		
Thomson Directories	September 2017	Quarterly
Fuel Station Entries		
Catalist Ltd - Experian	August 2017	Quarterly
Gas Pipelines		
National Grid	July 2014	Quarterly
Points of Interest - Commercial Services		
PointX	September 2017	Quarterly
Points of Interest - Education and Health		
PointX	September 2017	Quarterly
Points of Interest - Manufacturing and Production		
PointX	September 2017	Quarterly
Points of Interest - Public Infrastructure		
PointX	September 2017	Quarterly
Points of Interest - Recreational and Environmental		
PointX	September 2017	Quarterly
Underground Electrical Cables		
National Grid	December 2015	Bi-Annually

LANDMARK INFORMATION GROUP*

Sensitive Land Use	Version	Update Cycle
Ancient Woodland		
Natural England	May 2017	Bi-Annually
Areas of Adopted Green Belt		
Blackburn with Darwen Borough Council	May 2017	As notified
Chorley Borough Council - Development Control Section	May 2017	As notified
Hyndburn Borough Council	May 2017	As notified
Ribble Valley Borough Council	May 2017	As notified
South Ribble Borough Council	May 2017	As notified
Areas of Unadopted Green Belt		
Blackburn with Darwen Borough Council	May 2017	As notified
Chorley Borough Council - Development Control Section	May 2017	As notified
Hyndburn Borough Council	May 2017	As notified
Ribble Valley Borough Council	May 2017	As notified
South Ribble Borough Council	May 2017	As notified
Areas of Outstanding Natural Beauty		
Natural England	August 2017	Bi-Annually
Environmentally Sensitive Areas		
Natural England	January 2017	Annually
Forest Parks		
Forestry Commission	April 1997	Not Applicable
Local Nature Reserves		
Natural England	August 2017	Bi-Annually
Marine Nature Reserves		
Natural England	August 2017	Bi-Annually
National Nature Reserves		
Natural England	August 2017	Bi-Annually
National Parks		
Natural England	August 2017	Bi-Annually
Nitrate Vulnerable Zones		
Department for Environment, Food and Rural Affairs (DEFRA - formerly FRCA)	October 2015	
Ramsar Sites		
Natural England	August 2017	Bi-Annually
Sites of Special Scientific Interest		
Natural England	August 2017	Bi-Annually
Special Areas of Conservation		
Natural England	August 2017	Bi-Annually
Special Protection Areas		
Natural England	August 2017	Bi-Annually



Data Suppliers

A selection of organisations who provide data within this report

Data Supplier	Data Supplier Logo
Ordnance Survey	Mop data
Environment Agency	Environment Agency
Scottish Environment Protection Agency	SEP PAPE
The Coal Authority	The Coal Authority
British Geological Survey	British Geological Survey NATURAL ENVIRONMENT RESEARCH COUNCIL
Centre for Ecology and Hydrology	Centre for Ecology & Hydrology NATURAL ENVIRONMENT RESEARCH COUNCIL
Natural Resources Wales	Cyfoeth Naturiol Cymru Haturiol Resources Wales
Scottish Natural Heritage	SCOTTISH NATURAL HERITAGE
Natural England	
Public Health England	Public Health England
Ove Arup	ARUP
Peter Brett Associates	peterbrett

LANDMARK INFORMATION GROUP*

Useful Contacts

Contact	Name and Address	Contact Details
1	British Geological Survey - Enquiry Service British Geological Survey, Kingsley Dunham Centre, Keyworth, Nottingham, Nottinghamshire, NG12 5GG	Telephone: 0115 936 3143 Fax: 0115 936 3276 Email: enquiries@bgs.ac.uk Website: www.bgs.ac.uk
2	Environment Agency - National Customer Contact Centre (NCCC)	Telephone: 03708 506 506 Email: enquiries@environment-agency.gov.uk
	PO Box 544, Templeborough, Rotherham, S60 1BY	
3	Blackburn with Darwen Borough Council - Environmental Health Department	Telephone: 01254 585585 Website: www.blackburn.gov.uk
	Town Hall, Blackburn, Lancashire, BB1 7DY	
4	Ordnance Survey Adanac Drive, Southampton, Hampshire, SO16 0AS	Telephone: 023 8079 2000 Email: customerservices@ordnancesurvey.co.uk Website: www.ordnancesurvey.gov.uk
5	Blackburn with Darwen Borough Council Town Hall, BLACKBURN, Lancashire, BB1 7DY	Telephone: 01254 585585 Fax: 01254 680870 Website: www.blackburn.gov.uk
6	The Coal Authority - Property Searches 200 Lichfield Lane, Mansfield, Nottinghamshire, NG18 4RG	Telephone: 0345 762 6848 Fax: 01623 637 338 Email: groundstability@coal.gov.uk Website: www2.groundstability.com
7	PointX 7 Abbey Court, Eagle Way, Sowton, Exeter, Devon, EX2 7HY	Website: www.pointx.co.uk
8	Natural England County Hall, Spetchley Road, Worcester, WR5 2NP	Telephone: 0300 060 3900 Email: enquiries@naturalengland.org.uk Website: www.naturalengland.org.uk
9	Blackburn with Darwen Borough Council Town Hall, Blackburn, Lancashire, BB1 7DY	Telephone: 01254 585585 Fax: 01254 680870 Website: www.blackburn.gov.uk
10	Environment Agency - Head Office Rio House, Waterside Drive, Aztec West, Almondsbury, Bristol, Avon, BS32 4UD	Telephone: 01454 624400 Fax: 01454 624409
-	Public Health England - Radon Survey, Centre for Radiation, Chemical and Environmental Hazards Chilton, Didcot, Oxfordshire, OX11 0RQ	Telephone: 01235 822622 Fax: 01235 833891 Email: radon@phe.gov.uk Website: www.ukradon.org
-	Landmark Information Group Limited Imperium, Imperial Way, Reading, Berkshire, RG2 0TD	Telephone: 0844 844 9952 Fax: 0844 844 9951 Email: customerservices@landmarkinfo.co.uk Website: www.landmarkinfo.co.uk

Please note that the Environment Agency / Natural Resources Wales / SEPA have a charging policy in place for enquiries.



Non-Residential Coal Mining Consultants Report



UNIT 6, PIONEER MILL, MOORGATE STREET, BLACKBURN, BLACKBURN WITH DARWEN, BB2 4PJ

Date of enquiry: Date enquiry received: Issue date: 07 November 2017 07 November 2017 07 November 2017

Our reference: Your reference: 51001693999001 bb2 4pj

Non-Residential Coal Mining Consultants Report

This report is based on and limited to the records held by the Coal Authority at the time the report was produced.

Client name

David Lord

Enquiry address

UNIT 6, PIONEER MILL, MOORGATE STREET, BLACKBURN, BLACKBURN WITH DARWEN, BB2 4PJ

How to contact us

0345 762 6848 (UK) +44 (0)1623 637 000 (International)

200 Lichfield Lane Mansfield Nottinghamshire NG18 4RG

www.groundstability.com



in /company/the-coal-authority

/thecoalauthority

🥑 /coalauthority



Approximate position of property



Reproduced by permission of Ordnance Survey on behalf of HMSO. © Crown copyright and database right 2017. All rights reserved.

Ordnance Survey Licence number: 100020315

Detailed findings

Past underground coal mining None recorded.

Probable unrecorded shallow workings None.

Outcrops None recorded.

Spine roadways at shallow depth None recorded.

Future underground mining None recorded.

Licence details (AOR) None recorded.

Section 46 notices None recorded.

Geology Fault under or close to the property recorded.

Mine entries None recorded.

Court orders None recorded.

Worked out opencast sites None recorded.

Coal mining related hazards

None recorded.

Coal mining subsidence

The Coal Authority has not received a damage notice or claim for the subject property, or any property within 50 metres, since 31 October 1994.

There is no current Stop Notice delaying the start of remedial works or repairs to the property.

The Coal Authority is not aware of any request having been made to carry out preventive works before coal is worked under section 33 of the Coal Mining Subsidence Act 1991.

Enquiry boundary

Key

Approximate position of enquiry boundary shown



Map data

Reproduced by permission of Ordnance Survey on behalf of HMSO. © Crown copyright and database right 2017. All rights reserved.

Ordnance Survey Licence number: 100020315

How to contact us

0345 762 6848 (UK) +44 (0)1623 637 000 (International)


200 Lichfield Lane Mansfield Nottinghamshire NG18 4RG

www.groundstability.com

in /company/the-coal-authority

/thecoalauthority

/coalauthority

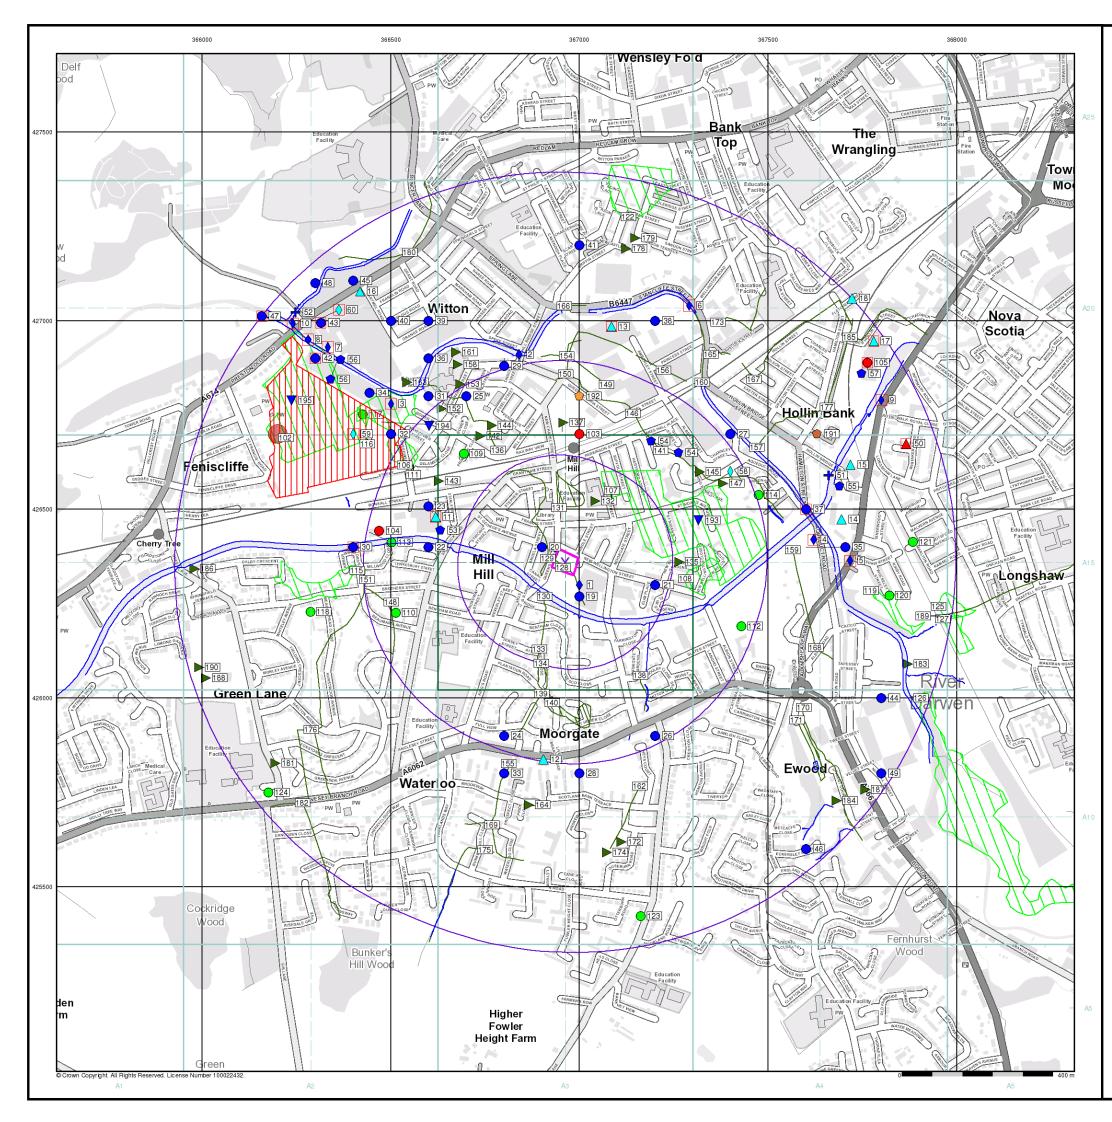


Envirocheck[®] LANDMARK INFORMATION GROUP*



Geological

BGS Recorded Mineral Site

Site Sensitivity Map - Slice A

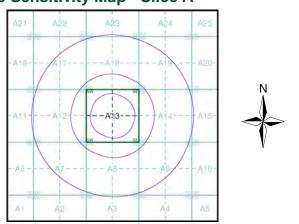

Order Details

Order Number:	14
Customer Ref:	BE
National Grid Reference:	36
Slice:	А
Site Area (Ha):	0.3
Search Buffer (m):	10

44159325_1_1 B2 4PJ 66960, 426360 .31 000

Site Details


Former Pioneer Mill, New Wellington Street, Blackburn, BB2 4DY



Tel: Fax: Web 0844 844 9952 0844 844 9951 www.envirocheck.co.uk

A Landmark Information Group Service v50.0 25-Oct-2017

Page 1 of 6

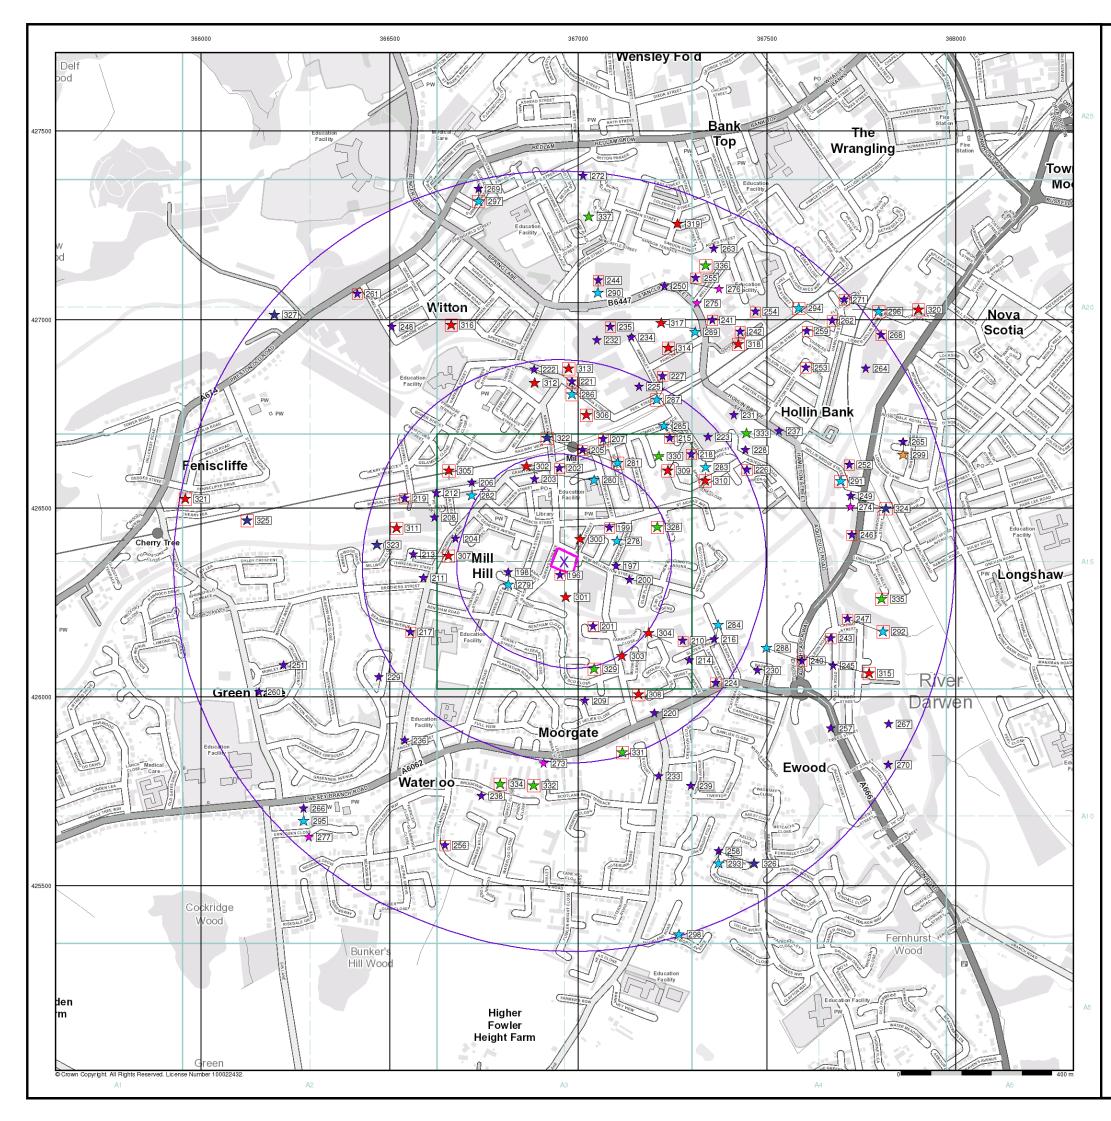

Envirocheck[®] LANDMARK INFORMATION GROUP*

Industrial Land Use Map

General




8 Map ID

Specified Site
Specified Buffer(s)
Specified Site

Industrial Land Use

- ★ Contemporary Trade Directory Entry
- 🛧 Fuel Station Entry
- 🗸 Gas Pipeline
- 🔆 Points of Interest Commercial Services
- 🚖 Points of Interest Education and Health
- ★ Points of Interest Manufacturing and Production
- ★ Points of Interest Public Infrastructure
- 🚖 Points of Interest Recreational and Environmental
- 🔍 Underground Electrical Cables

Industrial Land Use Map - Slice A

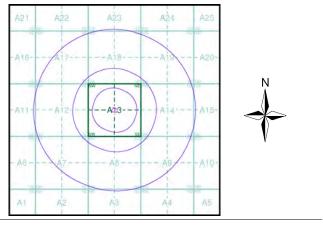

Order Details

Order Number: 144159325_1_1 Customer Ref: BB2 4PJ National Grid Reference: 366960, 426360 Slice: Α Site Area (Ha): Search Buffer (m): 0.31 1000

Site Details

Former Pioneer Mill, New Wellington Street, Blackburn, BB2 4DY




0844 844 9952

Tel: Fax:

Web:

0844 844 9951 www.envirocheck.co.uk

A Landmark Information Group Service v50.0 25-Oct-2017 Page 2 of 6

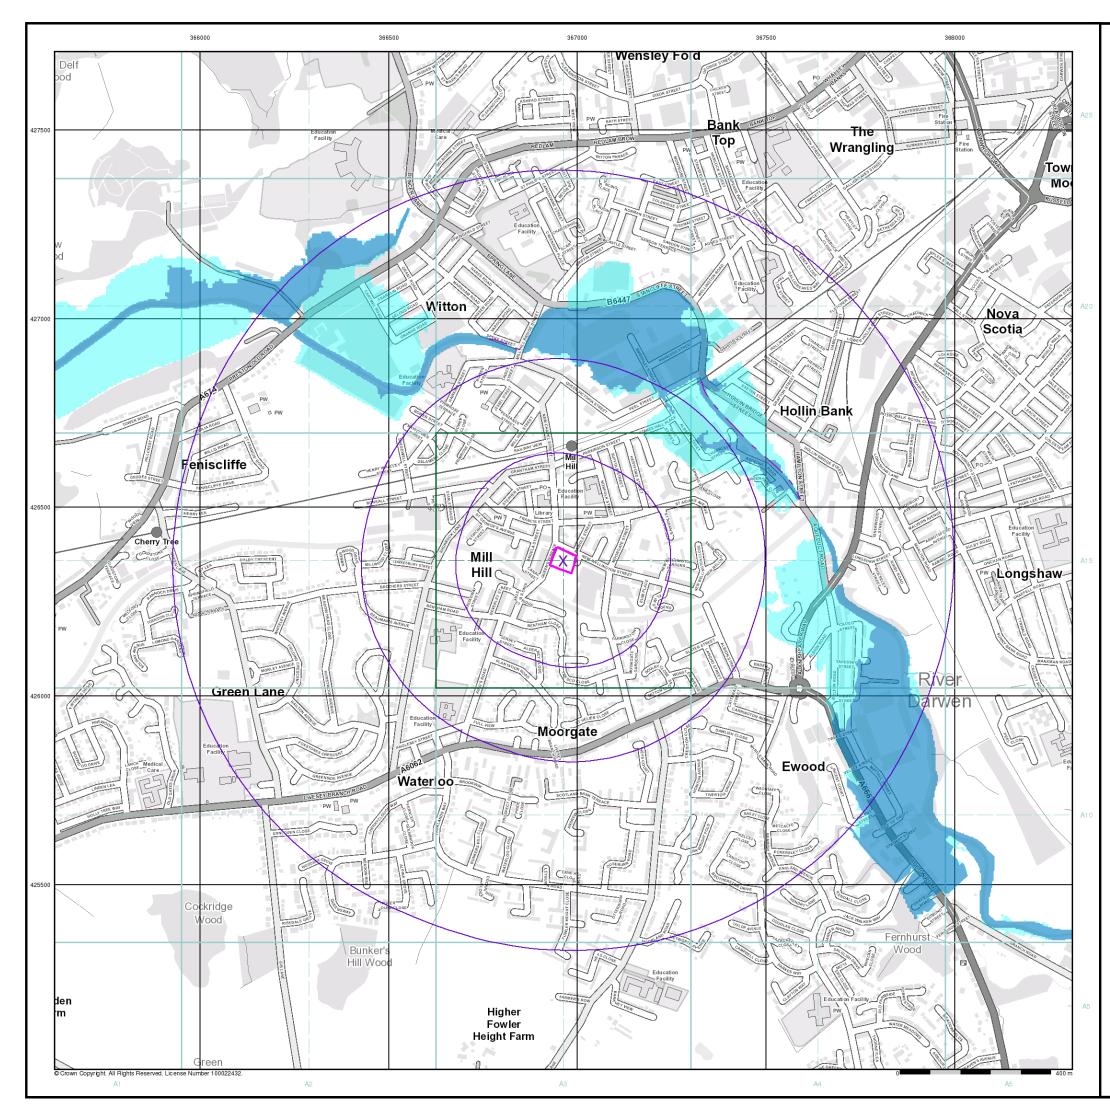

Envirocheck LANDMARK INFORMATION GROUP*

General

🔼 Specified Site

- C Specified Buffer(s)
- X Bearing Reference Point

Agency and Hydrological (Flood)

Extreme Flooding from Rivers or Sea without Defences (Zone 2)

Flooding from Rivers or Sea without Defences (Zone 3)


Area Benefiting from Flood Defence



Flood Water Storage Areas

--- Flood Defence

Flood Map - Slice A

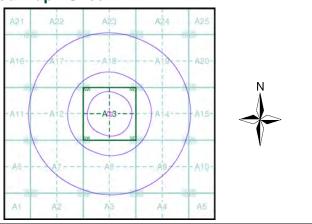

Order Details

Order Number: Customer Ref: National Grid Reference: 366960, 426360 Slice: Site Area (Ha): Search Buffer (m):

144159325_1_1 BB2 4PJ Α 0.31 1000


Site Details

Former Pioneer Mill, New Wellington Street, Blackburn, BB2 4DY





0844 844 9952 0844 844 9951 www.envirocheck.co.uk

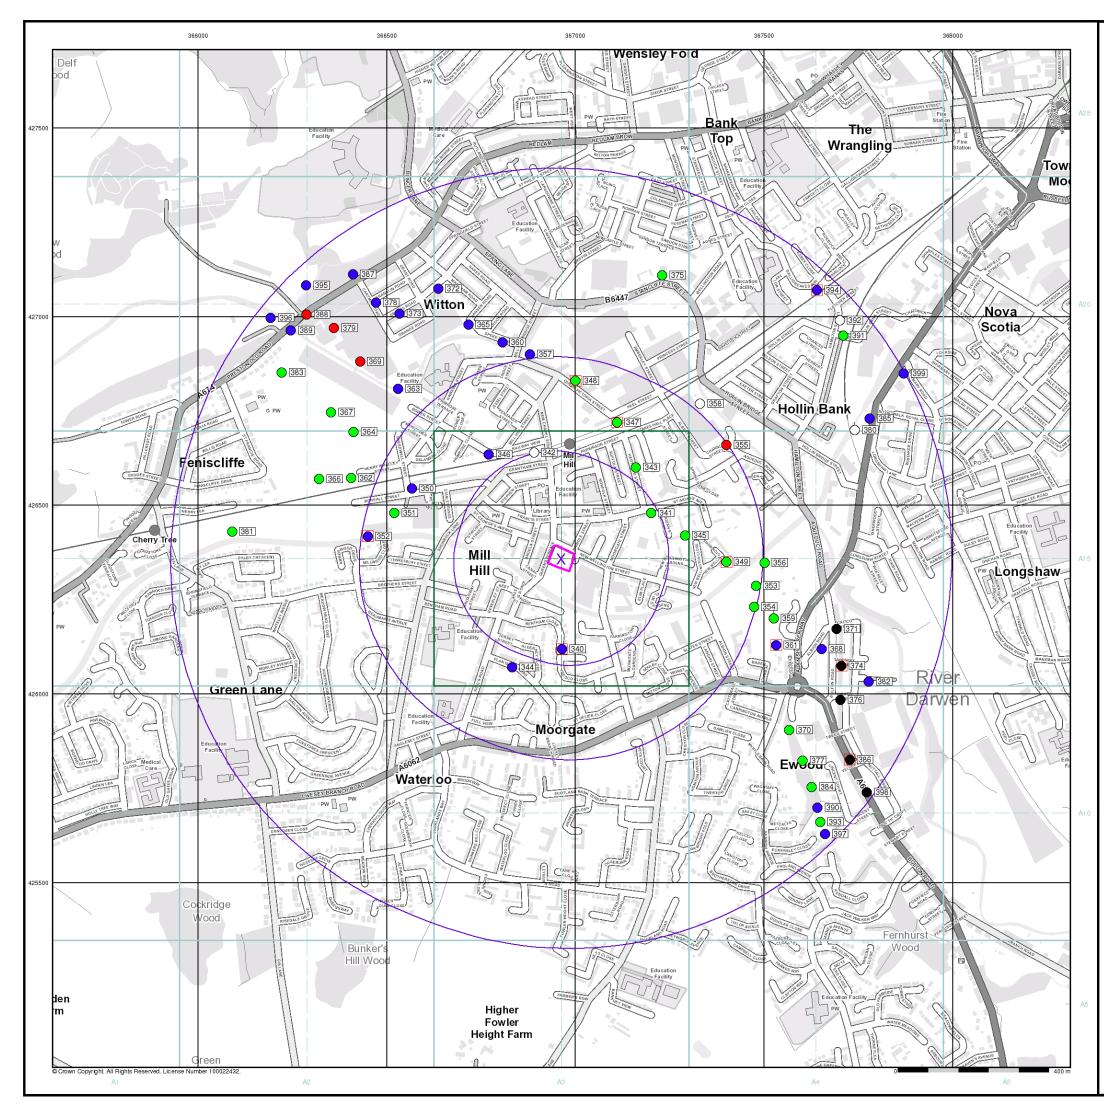

General

Specified Site
Specified Buffer(s)
Bearing Reference Point
Map ID
Several of Type at Location

Agency and Hydrological (Boreholes)


- 😑 BGS Borehole Depth 0 10m
- 😑 BGS Borehole Depth 10 30m
- 🔴 BGS Borehole Depth 30m +
- Confidential

⊖ Other

For Borehole information please refer to the Borehole .csv file which accompanied this slice.

A copy of the BGS Borehole Ordering Form is available to download from the Support section of www.envirocheck.co.uk.

Borehole Map - Slice A

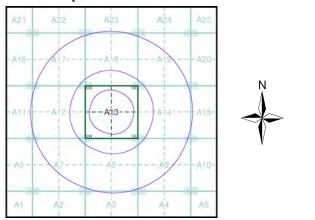

Order Details

Order Number:144159325_1_1Customer Ref:BB2 4PJNational Grid Reference:366960, 426360Slice:ASite Area (Ha):0.31Search Buffer (m):1000


Site Details


Former Pioneer Mill, New Wellington Street, Blackburn, BB2 4DY




Tel: Fax: Web: 0844 844 9952 0844 844 9951 www.envirocheck.co.uk

Page 4 of 6

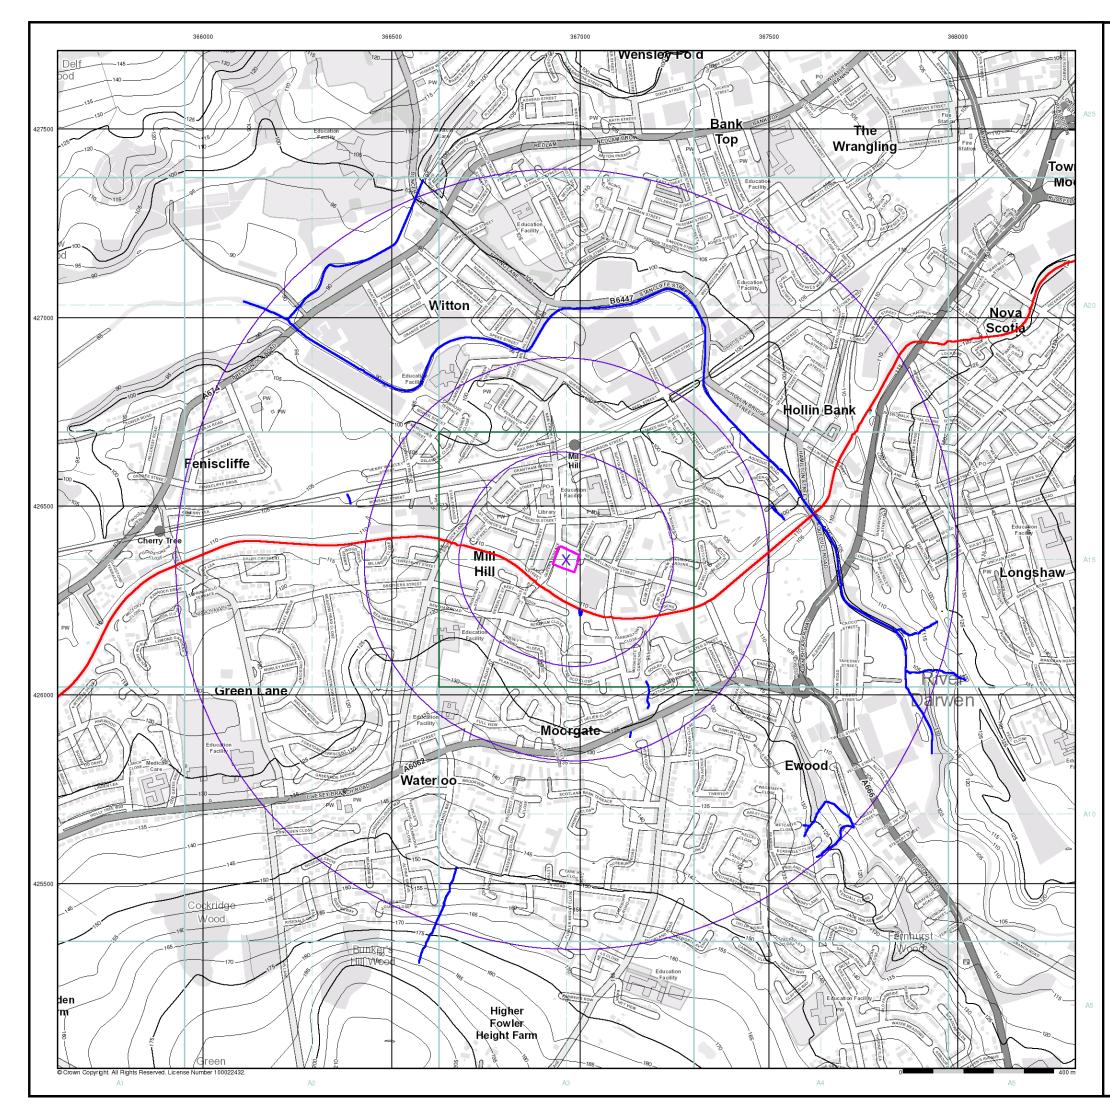

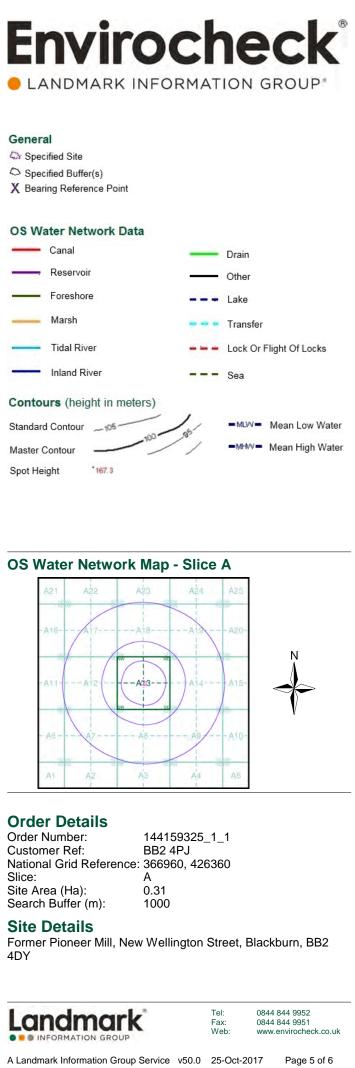

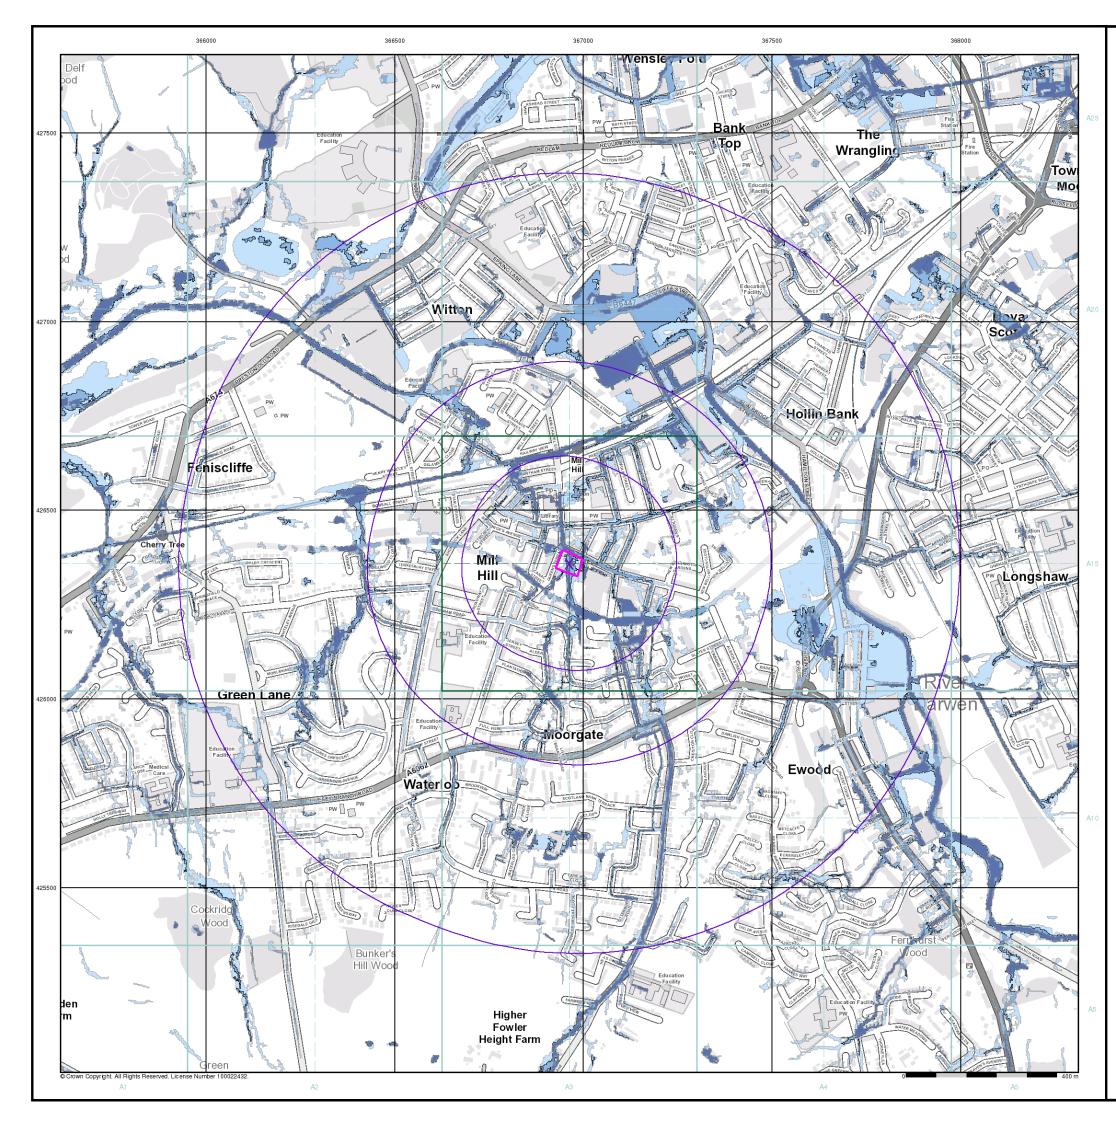

Envirocheck[®] LANDMARK INFORMATION GROUP*

General

- 🗅 Specified Site
- Specified Buffer(s)
- X Bearing Reference Point

Risk of Flooding from Surface Water

High - 30 Year Return
Medium - 100 Year Return


Low - 1000 Year Return

Suitability See the suitability map below National to county County to town Town to street

Street to parcels of land

Property

EA/NRW Suitability Map - Slice A

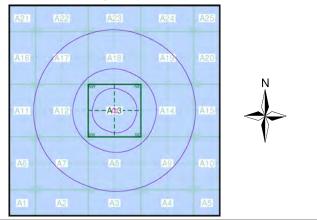

Order Details

Order Number:	144159325_1_1
Customer Ref:	BB2 4PJ
National Grid Reference:	366960, 426360
Slice:	A
Site Area (Ha):	0.31
Search Buffer (m):	1000


Site Details


Former Pioneer Mill, New Wellington Street, Blackburn, BB2 4DY








0844 844 9952 0844 844 9951 www.envirocheck.co.uk

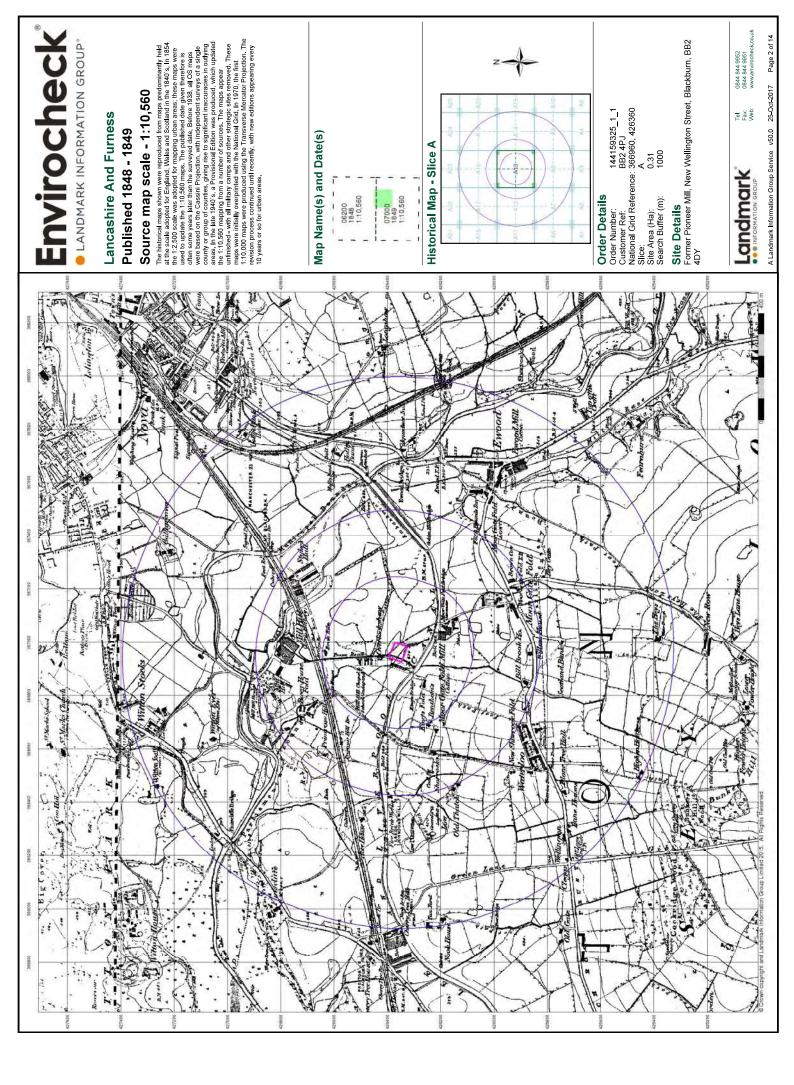


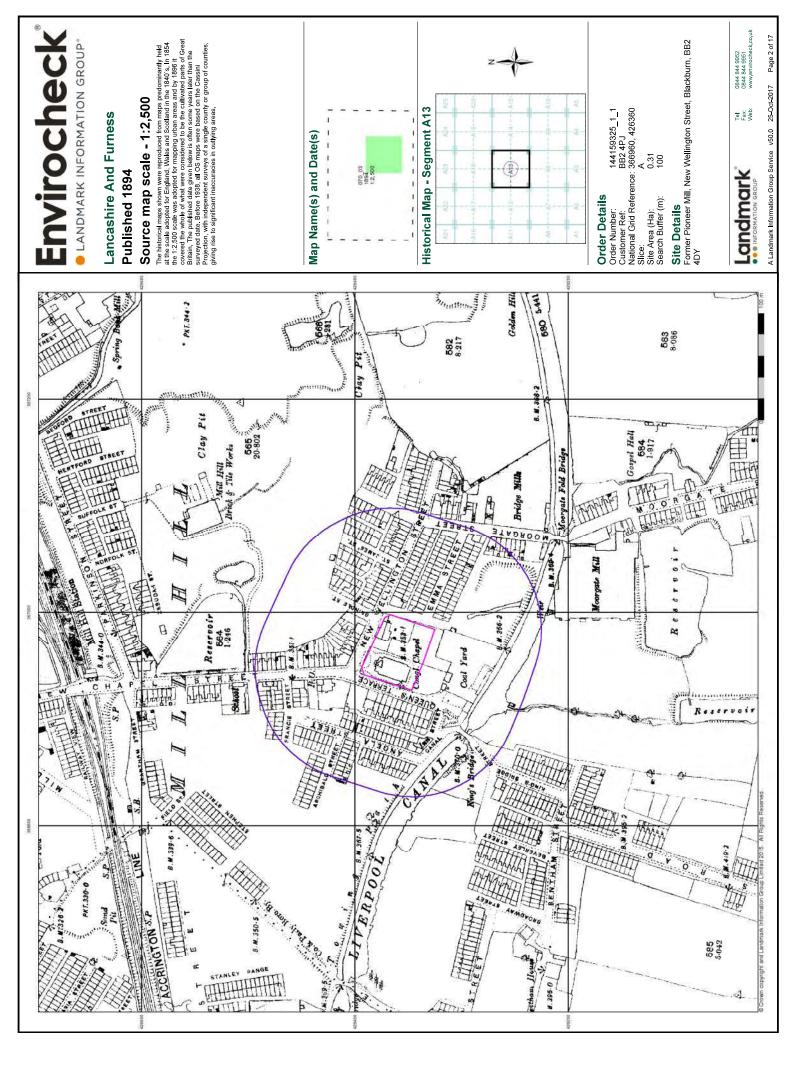


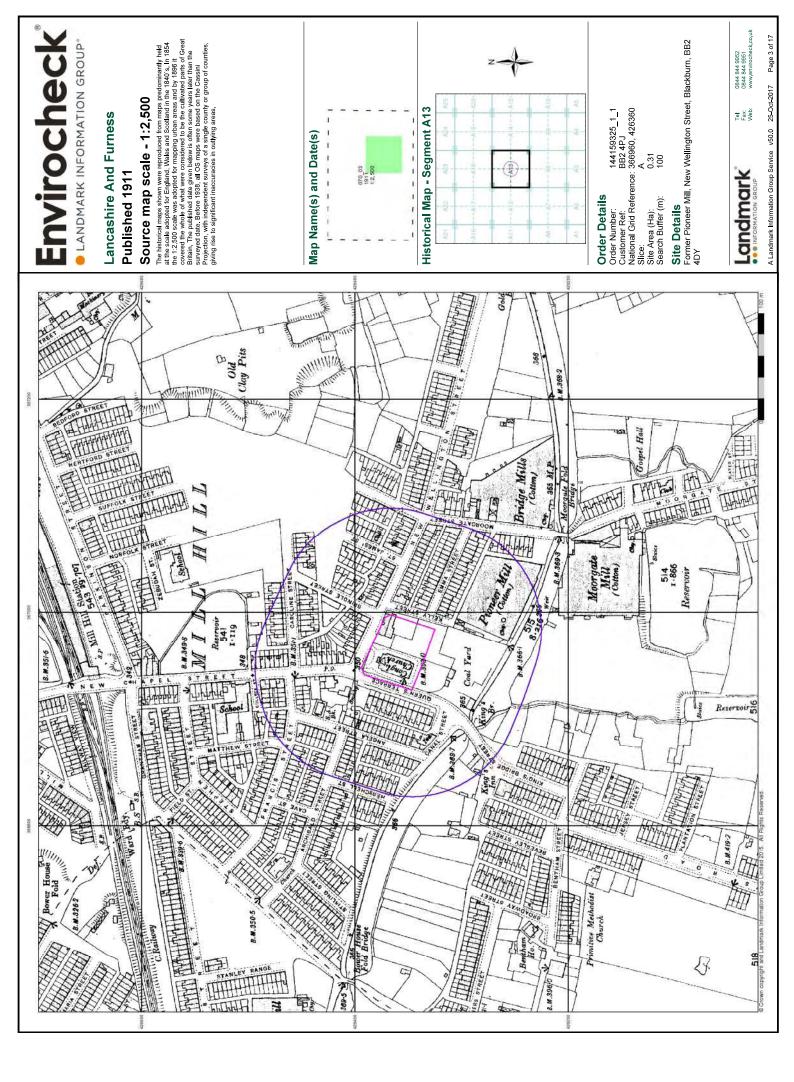


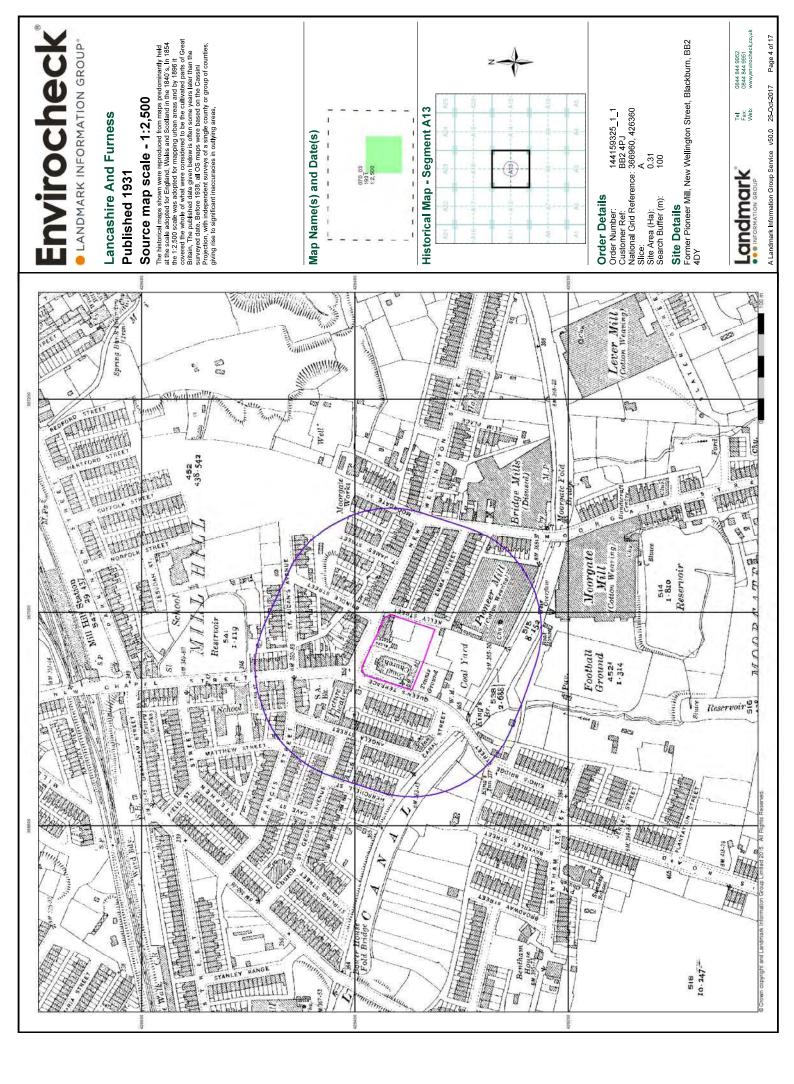

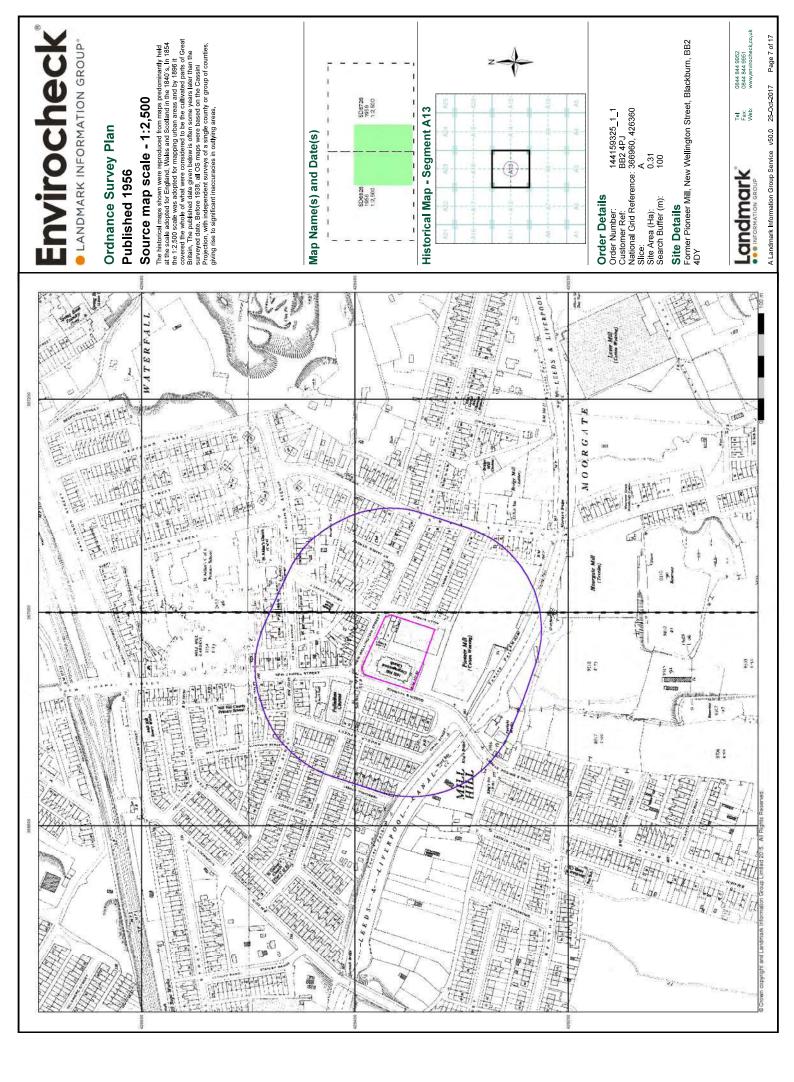

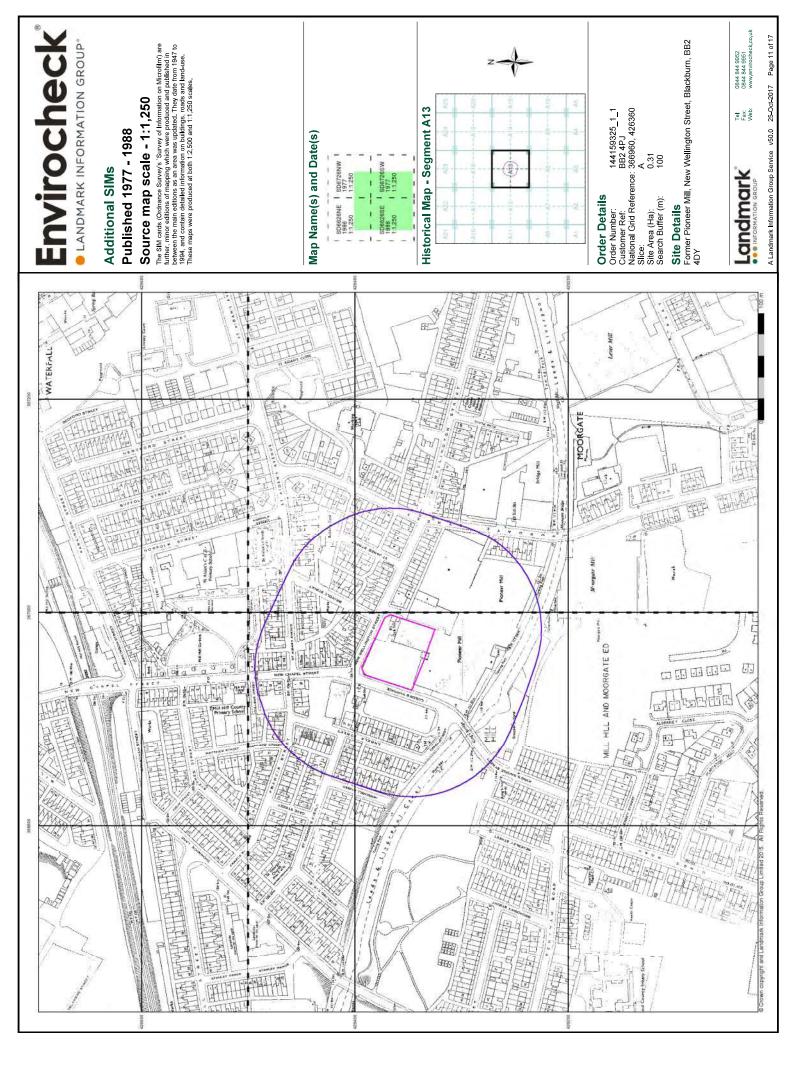

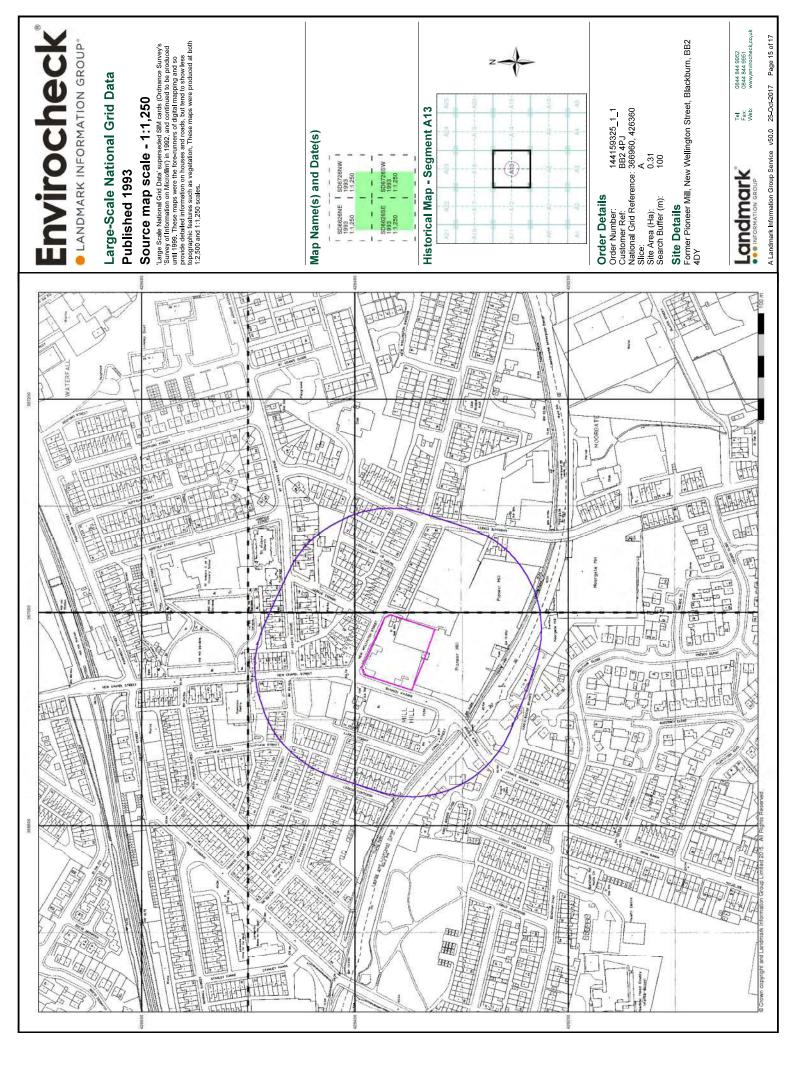

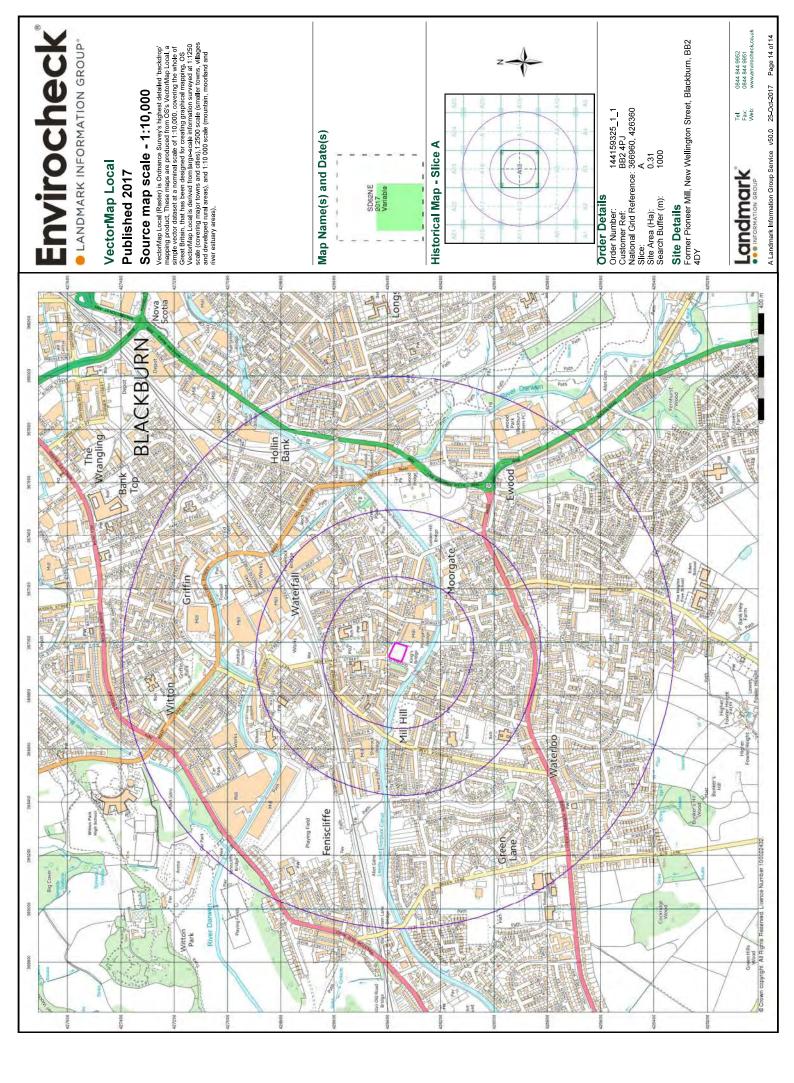

site is a former church, housing site and engineers	Heron Foods, New Wellington Street Blackburn, BB2 4PJ	WORMS EYE
potential contaminants: heavy metals, cyanide, sulphate, phenols, VOC's. TPH's, acids, asbestos, PCB's, PAH's	Conceptual Model based on PRA	52 Bank Parade Burnley, BB11 1TS
low risk to end-users expected, based on commercial end-use	Not to scale 13.11.2017	01282 414 649
low risk to controlled water expected		

low gas risk likely

radon protection not needed

coal seams sufficiently deep to not pose a significant risk

